

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/III24060100/UNH3M4

Date: 23/08/2024

REFERENCE

|                              |                                       |                             |               |               |
|------------------------------|---------------------------------------|-----------------------------|---------------|---------------|
| Handling Insurer:            | India International Insurance Pte Ltd | Policy No:                  | D23MPCM001863 |               |
| <b>Claimant Vehicle No :</b> | XD9022Y                               | <b>Insured Vehicle No :</b> | SJW2823P      |               |
| Date of Loss:                | 27/03/2024                            | Nature of Claim:            | TP            | Claim No: N/A |

DESCRIPTION & IDENTIFICATION OF VEHICLE

|                             |                                         |             |                       |
|-----------------------------|-----------------------------------------|-------------|-----------------------|
| Reg No:                     | XD9022Y                                 |             |                       |
| Make & Model:               | MITSUBISHI FUSO, 12.0 D FV51SJD2DEA (M) | Engine No:  | OM457LA457972C0285088 |
| Reg. Date:                  | 06/06/2014 (Man. Year: 2014)            | Chassis No: | FV51SJA10037          |
| Colour:                     | White                                   | Odometer:   | 678169 km             |
| Engine Capacity:            | 11967 cc                                |             |                       |
| Market Value/New Car Price: | N/A                                     |             |                       |
| Sum Insured (S\$):          | Market Value/New Car Price              |             |                       |

CONDITION OF VEHICLE AT THE TIME OF SURVEY

|                          |                         |                      |                          |                         |
|--------------------------|-------------------------|----------------------|--------------------------|-------------------------|
| General Condition:       | Steering (Serviceable): | Yes                  | Footbrake (Serviceable): | Yes                     |
| Handbrake (Serviceable): | Yes                     | Engine Modification: | No                       | Pre-accident Condition: |

CONDITION OF TYRES

|                   |              |                  |                     |
|-------------------|--------------|------------------|---------------------|
| Front Tyre Size:  | 295/80 R22.5 | Rear Tyre Size:  | 295/80 R22.5 (D/D)  |
| Front Left Side:  | KPATOS 5 mm  | Rear Left Side:  | MAX WIND 5/5/5/5 mm |
| Front Right Side: | KPATOS 5 mm  | Rear Right Side: | MAX WIND 5/5/5/5 mm |

The above values represent the remaining tyre treads depth

| COST OF CLAIMS                    | Repairer's | Adjuster's | Difference | Diff % |
|-----------------------------------|------------|------------|------------|--------|
| Parts                             | 9,097.66   | 3,416.33   | 5,681.33   | 62.45  |
| Miscellaneous Items               | 0.00       | 0.00       | 0.00       |        |
| Labour                            | 4,380.00   | 1,120.00   | 3,260.00   | 74.43  |
| Paintwork Labour                  | 0.00       | 0.00       | 0.00       |        |
| Towing                            | 0.00       | 0.00       | 0.00       |        |
| Calculated Gross Total (S\$)      | 13,477.66  | 4,536.33   | 8,941.33   | 66.34  |
| Approved Total (Overridden) (S\$) |            | 3,600.00   |            |        |
| (S\$)                             | 13,477.66  | 3,600.00   | 9,877.66   | 73.29  |
| + GST 9.00/9.00% (S\$)            | 1,212.99   | 324.00     | 888.99     | 73.29  |
| Nett Amount (S\$)                 | 14,690.65  | 3,924.00   | 10,766.65  | 73.29  |

INSPECTION

|                             |            |               |                                                                     |
|-----------------------------|------------|---------------|---------------------------------------------------------------------|
| Date of Assignment:         | 13/06/2024 |               |                                                                     |
| Date Inspected:             | 16/07/2024 | Inspected At: | HUP LIAN HUAT ENGINEERING WORKS<br>38 DEFU LANE 9, SINGAPORE 539278 |
| Estimated Period of Repair: | 3.0 days   |               |                                                                     |

Adjuster: MARCUS CHUA

Manager: HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

|               |                                                                                                                                                                              |                                                                          |
|---------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------|
| Reference     |                                                                                                                                                                              |                                                                          |
| Part Source:  | (Last Synchronised: 23 Aug 2024)                                                                                                                                             |                                                                          |
| Parts:        | N/A                                                                                                                                                                          | MITSUBISHI FUSO 12.0 D FV51SJD2DEA (M) (Model not available in database) |
| Labour:       | Repairer's                                                                                                                                                                   | (Price-denominated Standard List)                                        |
| Print Code:   | (Unsubmitted, no print-code for XD9022Y)                                                                                                                                     |                                                                          |
| Validity:     | These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page |                                                                          |
| Further Info: | Items/values not in reference catalogue are prefixed with an asterisk *.                                                                                                     |                                                                          |

Recommended Parts

| No. | Qty | Part No. | Particulars                           | Condition     | Repairer's  | Amount       |
|-----|-----|----------|---------------------------------------|---------------|-------------|--------------|
| 1   | 1   |          | *FRONT BUMPER                         | Dented/Bent   | 2,259.31 FL | *2,259.31 FL |
| 2   | 1   |          | *FRONT BUMPER COVER -LH               | Repair        | 305.89 FL   | *- FL        |
| 3   | 1   |          | *FRONT BUMPER SIDE -LH                | Twisted       | 140.29 FL   | *140.29 FL   |
| 4   | 1   |          | *FRONT BUMPER STEP GARNISH            | Cracked       | 217.26 FL   | *217.26 FL   |
| 5   | 2   |          | *FRONT BUMPER LOWER STAY              | Not Necessary | 338.14 FL   | *- FL        |
| 6   | 1   |          | *FRONT BUMPER BRACKET                 | Not Necessary | 37.30 FL    | *- FL        |
| 7   | 1   |          | *FRONT BUMPER SIDE AIR DUST -LH       | Not Necessary | 96.70 FL    | *- FL        |
| 8   | 1   |          | *FRONT TOP BUMPER                     | Repair        | 273.12 FL   | *- FL        |
| 9   | 1   |          | *FRONT TOP BUMPER REINFORCEMENT       | Not Necessary | 884.79 FL   | *- FL        |
| 10  | 1   |          | *FRONT TOP BUMPER -LH                 | Not Necessary | 193.04 FL   | *- FL        |
| 11  | 1   |          | *FRONT TOP BUMPER REINFORCEMENT -LH   | Not Necessary | 226.06 FL   | *- FL        |
| 12  | 1   |          | *FRONT HEADLAMP ASSY -LH              | Not Necessary | 1,286.45 FL | *- FL        |
| 13  | 1   |          | *FRONT HEADLAMP RIM -LH               | Cracked       | 181.18 FL   | *181.18 FL   |
| 14  | 1   |          | *FRONT HEADLAMP ALUMINIUM BRACKET -LH | Not Necessary | 947.63 FL   | *- FL        |
| 15  | 1   |          | *FRONT FOG LAMP ASSY -LH              | Not Necessary | 293.25 FL   | *- FL        |
| 16  | 1   |          | *FRONT FOG LAMP RIM -LH               | Cracked       | 186.05 FL   | *186.05 FL   |
| 17  | 1   |          | *FRONT DOOR LAMP -LH                  | Not Necessary | 195.03 FL   | *- FL        |
| 18  | 1   |          | *STAND PANEL -LH                      | Cracked       | 744.59 FL   | *744.59 FL   |
| 19  | 1   |          | *STAND PANEL ALLOY MAT CENTRE -LH     | Repair        | 289.84 FL   | *- FL        |
| 20  | 1   |          | *STAND PANEL SIDE BRACKET -LH         | Serviceable   | 254.70 FL   | *- FL        |
| 21  | 1   |          | *STEP PANEL -LH                       | Repair        | 324.55 FL   | *- FL        |
| 22  | 1   |          | *STEP PANEL LOWER -LH                 | Cracked       | 270.56 FL   | *270.56 FL   |
| 23  | 1   |          | *STEP PANEL UNDER COVER -LH           | Torn          | 229.87 FL   | *229.87 FL   |
| 24  | 1   |          | *STEP PANEL REFLECTOR -LH             | Serviceable   | 123.45 FL   | *- FL        |
| 25  | 1   |          | *STEP ALLOY MAT -LH                   | Cracked       | 326.00 FL   | *326.00 FL   |
| 26  | 1   |          | *STEP HOLDER FRONT -LH                | Repair        | 875.91 FL   | *- FL        |
| 27  | 1   |          | *STEP HOLDER REAR -LH                 | Repair        | 629.25 FL   | *- FL        |

F=Franchise part. L=ListItemDisc.

|                                                     |           |          |
|-----------------------------------------------------|-----------|----------|
| Sub Total (\$\$)                                    | 12,130.21 | 4,555.11 |
| - List Item Discount on L Items 25.00/25.00% (\$\$) | 3,032.55  | 1,138.78 |
| Total Parts (\$\$)                                  | 9,097.66  | 3,416.33 |

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

| No                              | Particulars                                                                 | Lab.Type | Repairer's      | Amount          |
|---------------------------------|-----------------------------------------------------------------------------|----------|-----------------|-----------------|
| <b>Labour Items</b>             |                                                                             |          |                 |                 |
| 1                               | TO REMOVE & REFIT HEADLAMP CABLE, SYSTEM & CHECK WIRING & REFOCUS ALL LIGHT | New      | 230.00          | 20.00           |
| 2                               | LABOUR CHARGE TO CUT & WELD & DISMANTLE & REMOVE & REFIT ALL ABOVE PARTS    | New      | 1,800.00        | 600.00          |
| 3                               | TO RUST PROOFING ON AFFECTED AREA                                           | New      | 850.00          | 0.00            |
| 4                               | TO SPRAY & PAINTING ALL ACCIDENT AFFECTED AREA                              | New      | 1,500.00        | 500.00          |
| <b>Gross Labour Cost (\$\$)</b> |                                                                             |          | <b>4,380.00</b> | <b>1,120.00</b> |

Report was unsubmitted during this print-out.

< END OF ESTIMATES >