

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/ICS24080285/RNH3E2
Date: 25/10/2024REFERENCE

Handling Insurer:	ECICS Limited	Policy No:	
Claimant Vehicle No :	SJW5812B	Insured Vehicle No :	SMZ9063T
Date of Loss:	23/07/2024	Nature of Claim:	TP
		Claim No:	DMPC2400955H/02/ST

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJW5812B	Engine No:	2AR1712892
Make & Model:	LEXUS ES300H, 2.5 Executive (A)	Chassis No:	JTHBW1GG902155441
Reg. Date:	03/08/2017 (Man. Year: 2017)	Odometer:	107641 km
Colour:	Grey		
Engine Capacity:	2494 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	245/40R19	Rear Tyre Size:	245/40R19
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	380.00	300.00	80.00	21.05
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	380.00	300.00	80.00	21.05
+ GST 9.00/9.00% (S\$)	34.20	27.00	7.20	21.05
Nett Amount (S\$)	414.20	327.00	87.20	21.05

INSPECTION

Date of Assignment:	19/08/2024	
Date Inspected:	27/08/2024	Inspected At: Puan Chew Motor Work Pte Ltd (Pandan) Blk K #01-12, Pandan Loop Industrial Estate Singapore 128219
Estimated Period of Repair:	2.0 days	

Adjuster: MOHD RASUL**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 25 Oct 2024)
Parts:	143	LEXUS ES300H 2.5 Executive (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJW5812B)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	SPRAY PAINTING OF ACCIDENT SECTIONS	New	380.00	300.00
Gross Labour Cost (S\$)			380.00	300.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >