

## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933 TEL: 6256 3561 FAX: 6256 4315 Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Dos Experts En Automobile							
Date: 11/09/2024   SINGAPORE LAND TOWER SINGAPORE 048623   Code: SMO	Affiliated to Federation Internationale Des Experts En Automobile						
SINGAPORE LAND TOWER SINGAPORE 048623	MS	SOMPO INSURANCE SINGAPORE PL		Ref:	CS3/SMO24080319/Uqp3e2		
Note				Date:	11/09/2024		
Insured Veh.   SMF 3597P				Code:	SMO		
Policy No.	1.	1. Policy Particulars :- PRE-REPAIR SURVEY					
Claim No.   CMTD2402679/SYH   Excess   \$0.00     Assign From   GRACE   Assign Date   20/08/2024		Insured Veh.	SMF 3597P	Veh. Inspected	SKZ 6435Y		
Assign From   GRACE   Assign Date   20/08/2024		Policy No.	-	Coverage	0		
Make & Model		Claim No.	CMTD2402679/SYH	Excess	\$0.00		
Make & Model		Assign From	GRACE	Assign Date	20/08/2024		
Engine No.	2.		Vehicle	Details			
Chassis No.   VF73DBHZTFJ816270   Colour   WHITE		Make & Model	CITROEN C4 PICASSO (A)	C.C	1560		
Normal		Engine No.	10JBHD3020791	Year of Reg.	29/01/2016		
Brakes   IN ORDER   General   GOOD		Chassis No.	VF73DBHZTFJ816270	Colour	WHITE		
Modification(s)   RIMS: SPORTS RIM		Odometer	307053 KM	Steering	IN ORDER		
Size   Make   Balance (mm)		Brakes	IN ORDER	General	GOOD		
Size   Make   Balance (mm)		Modification(s)	RIMS: SPORTS RIM				
R/H Front Tyre	3.		Conditions	of Tyres			
L/H Front Tyre 215/55R17 MICHELIN 6 R/H Rear Tyre 215/55R17 CONTINENATL 6 L/H Rear Tyre 215/55R17 CONTINENATL 6  4. Description of Damages THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.  5. General Information  Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45) Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000			Size	Make	Balance (mm)		
R/H Rear Tyre 215/55R17 CONTINENATL 6  L/H Rear Tyre 215/55R17 CONTINENATL 6  4. Description of Damages  THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.  5. General Information  Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45)  Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000		R/H Front Tyre	215/55R17	MICHELIN	6		
L/H Rear Tyre 215/55R17 CONTINENATL 6  4. Description of Damages  THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.  5. General Information  Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45)  Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000		L/H Front Tyre	215/55R17	MICHELIN	6		
4. Description of Damages  THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.  5. General Information  Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45)  Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000		R/H Rear Tyre	215/55R17	CONTINENATL	6		
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.  5. General Information  Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45)  Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000		L/H Rear Tyre	215/55R17	CONTINENATL	6		
5. General Information  Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45)  Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000	4.		Description of	of Damages			
Accident Date 15/08/2024 Inspection Date 02/09/2024 (10:45)  Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.						
Survey held at A S AUTO SERVICE NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  5a. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000	5.	General Information					
NO 1 KAKI BUKIT #01-106 SINGAPORE 417883  Fa. Remarks  A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000		Accident Date	15/08/2024	Inspection Date	02/09/2024 (10:45)		
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000		Survey held at	NO 1 KAKI BUKIT #01-106				
B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000	5a. Remarks						
DD. Louinlate Days of Nepall	B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$4,000-\$5,000						
ESTIMATED NORMAL PERIOD FOR REPAIR: 3 Working Days		IMATED NORMAL DI		o nepair			
LOTHVIATED NORWAL FERIOD FOR REPAIR. 3 WORKING Days	E31	IIVIATED NORWAL PI	LINOD FOR REPAIR. 3 WORKING Days				

**CKS** 

MARCUS CHUA KANG SENG Licensed Appraiser