

ASS. REC. BY:

REF:

C121 24060013 - P

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

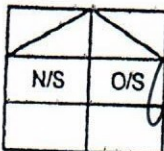

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

03

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLQ 1574Y

Yr Regn:

06 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

BMW

116d

C.C.

1498

Colour

M. P. White

AC:

Insured / Std / NI / NA

Sp. Reading

146793

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WBA1V72010V944935

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

225/40ZR18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

S mm

R/Bal.

S

mm

L/Bal.

S mm

L/Bal.

S

mm

D.O.A.

4/5/24

D.O.I.

10/6/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S body

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

12/6 21h @ 1100h Carbur

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

源摩哆廠

GUAN MOTOR WORKS

Business Regn No: 08102600F

176 Sin Ming Drive #02-03 Sin Ming Autocare Singapore 575721 Tel: 6453 6111 Fax: 6453 8292 HUP: 9742 6003

REPAIR ESTIMATE SLQ1574Y

No.	Qty	List Items	
1	1	RH lower rocker panel outer cover/skirting	<i>Bye/m</i> 580.00 ✓
			\$ 580.00
		Less 5%	\$ 29.00
		Total :	\$ 551.00
Labour			
1		Labour Charges for remove, refit, panel beat and replacement of damages.	\$ 400.00 <i>250</i>
2		To putty and spray Spray Paintings charges.	\$ 700.00 <i>600</i>
3		To check wirings.	\$ 40.00 <i>20</i>
4		To supply and apply anti rust treatment.	\$ <i>na</i> 30.00 <i>X</i>
		Total :	\$ 1,170.00
Total Parts and Labour :			\$ 1,721.00

Not Notched
11 Sep @ 1100h
Return After Paint
3 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date: