

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CD/AIG24090015/UPA3Q2
Date: 18/11/2024

REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	7210021803		
Claimant Vehicle No :	SGN8272Y	Insured Vehicle No :	SLH7938P		
Date of Loss:	02/09/2024	Nature of Claim:	TP	Claim No:	1814025395SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SGN8272Y	Engine No:	27091030783047
Make & Model:	MERCEDES-BENZ B180, 1.6 STYLE (R16 LED) (A)	Chassis No:	WDD2462422J360939
Reg. Date:	21/10/2015 (Man. Year: 2015)	Odometer:	147483 km
Colour:	White		
Engine Capacity:	1595 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Bridgestone 7 mm	Rear Left Side:	Bridgestone 7 mm
Front Right Side:	Bridgestone 7 mm	Rear Right Side:	Bridgestone 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	22,326.50	11,171.29	11,155.21	49.96
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,250.00	2,200.00	2,050.00	48.24
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	26,576.50	13,371.29	13,205.21	49.69
Approved Total (Overridden) (S\$)		10,000.00		
(S\$)	26,576.50	10,000.00	16,576.50	62.37
+ GST 9.00/9.00% (S\$)	2,391.89	900.00	1,491.89	62.37
Nett Amount (S\$)	28,968.39	10,900.00	18,068.39	62.37
+ Car Rental (8.0 x S\$100.00/day) (S\$)		800.00		
+ Doc/Search Fee (S\$)		2.18		
Nett Liability (S\$)		11,702.18		
Global Sum Settlement (S\$)		11,700.00		

INSPECTION

Date of Assignment:	02/09/2024		
Date Inspected:	02/09/2024	Inspected At:	Fastech Auto Pte Ltd (HQ) 1 Kaki Bukit Ave 6, #01-46/48/50 Autobay Singapore 417883
Estimated Period of Repair:	7.0 days		

Adjuster: MARCUS CHUA Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR WINDSCREEN	Not Necessary	980.00 FL	*- FL
2	1		*REAR WINDSCREEN MOULDING	Necessary	199.00 FL	*110.00 FL
3	1		*TAILGATE	Badly Dented	2,450.00 FL	*2,102.35 FL
4	1		*TAILGATE REAR LOGO	Necessary	101.00 FL	*101.00 FL
5	1		*TAILGATE B 180 EMBLEM	Necessary	98.00 FL	*98.00 FL
6	1		*TAILGATE C&C LOGO	Serviceable	50.00 FL	*- FL
7	1		*TAILGATE OUTER CHROME MOULDING	Bent / Cracked	485.00 FL	*366.01 FL
8	1		*TAILGATE INNER LOCK	Damaged	895.00 FL	*645.80 FL
9	1		*TAILGATE INNER LOCK PUMP	Serviceable	850.00 FL	*- FL
10	1		*TAILGATE INNER LOCK CATCH ASSY	Twisted / Cracked	880.00 FL	*600.00 FL
11	1		*TAILGATE INNER TRIM BOARD	Deformed / Twisted	582.00 FL	*368.20 FL
12	1		*SET TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 FL	*50.00 FL
13	1		*TAILGATE WEATHERSTRIP	Twisted	399.00 FL	*301.00 FL
14	1		*TAILGATE REFLECTORS	O/S Cracked	1,240.00 FL	*466.00 FL
15	1		*TAILGATE INNER LOCK OUTER GARNISH	Twisted / Cracked	341.00 FL	*218.50 FL
16	1		*SET TAILGATE DAMPER	Serviceable	1,650.00 FL	*- FL
17	1		*REAR BUMPER	Distorted	1,680.00 FL	*1,366.21 FL
18	1		*REAR BUMPER CENTRE PAD	Grazed	750.00 FL	*605.80 FL
19	1		*REAR BUMPER LOWER CHROME	Cracked	980.00 FL	*480.00 FL
20	1		*REAR BUMPER TOP CHROME PLATE	Broken	660.00 FL	*380.00 FL
21	2		*REAR BUMPER PDC SENSORS	Malfunction (1 PCS ONLY)	450.00 FL	*225.00 FL
22	1		*REAR BUMPER BEAM	Bent	715.00 FL	*615.00 FL
23	1		*REAR BUMPER TOP RETAINER	Cracked / Twisted	282.00 FL	*266.01 FL
24	2		*REAR BUMPER SIDE RETAINERS	Not Necessary	210.00 FL	*- FL
25	1		*SET REAR BUMPER CLIPS & RIVET	Necessary	60.00 FL	*60.00 FL
26	1		*REAR END PANEL	Badly Dented	1,018.00 FL	*1,018.00 FL
27	1		*REAR END PANEL TOP GARNISH	Twisted	366.00 FL	*342.00 FL
28	2		*TAILLAMPS	Cracked	1,850.00 FL	*1,240.00 FL
29	2		*REAR FENDER INNER TRIMS	Not Necessary	642.00 FL	*- FL
30	1		*REAR EXHAUST	Repair	1,450.00 FL	*- FL
31	1		*REAR EXHAUST HEAT SHIELD	Bent	422.00 FL	*221.00 FL
32	1		*REAR FLOOR PANEL	Repair	1,180.00 FL	*- FL
33	1		*REAR FLOOR PANEL TOP BOARD	Serviceable	620.00 FL	*- FL
34	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
35	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*20.00 FS
36	1		*REAR END PANEL SEALANT	Necessary	50.00 FS	*50.00 FS
37	1		*REAR LICENCE PLATE W/HOLDER	Bent	50.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	24,785.00	12,395.88
- List Item Discount on L Items 10.00/10.00% (\$\$)	2,458.50	1,224.59
Total Parts (\$\$)	22,326.50	11,171.29

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	20.00
2	TO DISMANTLE & REPLACED REAR PDC SENSOR	New	80.00	30.00
3	TO DISMANTLE & REFIX REAR WINDSCREEN	New	150.00	120.00
4	TO DISMANTLE & REFIX CUSHION UPHOLSTERY	New	120.00	60.00
5	TO DISMANTLE & REFIX REAR EXHAUST	New	150.00	60.00
6	TO TRANSFER TAILGATE MECHANISM	New	100.00	60.00
7	TO RESET & REPROFRAMME SYSTEM	New	180.00	0.00
8	TO SPRAU RUST PROOFING	New	120.00	50.00
9	LABOUR FOR PANEL BEATING & REPLACE PARTS	New	1,500.00	800.00
10	TO PUTTY & SPRAY PAINTING	New	1,800.00	1,000.00
Gross Labour Cost (\$\$)			4,250.00	2,200.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >