

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORTAIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120**Our File No:** CS/AIG24090038/RQP3E2
Date: 11/12/2024REFERENCE

Insured/Claimant:	PEH CHEE CHUNG (BAI ZHICONG)	Policy No:	2070161773
Date of Loss:	31/08/2024	Nature of Claim:	OD Claim No: 5631415507SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMW3476R		
Make & Model:	AUDI Q3, 1.4 TFSI S TRONIC (17") (A)	Engine No:	CZDC13618
Reg. Date:	16/11/2020 (Man. Year: 2020)	Chassis No:	WAUZZZF30M1031152
Colour:	Blue	Odometer:	43022 km
Engine Capacity:	1395 cc		
Market Value/New Car Price:	S\$141,000.00		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/60 R18	Rear Tyre Size:	225/60 R18
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repaire's	Adjuster's	Difference	Diff %
Parts	48,400.00	30,720.08	17,679.92	36.53
Miscellaneous Items	0.00	0.00	0.00	
Labour	13,452.00	11,352.00	2,100.00	15.61
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	61,852.00	42,072.08	19,779.92	31.98
- Excess (\$\$)	400.00	400.00	0.00	0.00
(\$\$)	61,452.00	41,672.08	19,779.92	32.19
+ GST 9.00/9.00% (\$\$)	5,530.68	3,750.49	1,780.19	32.19
Nett Amount (\$\$)	66,982.68	45,422.57	21,560.11	32.19

INSPECTION

Date of Assignment:	03/09/2024	
Date Inspected:	04/09/2024	Inspected At: 24 Benoi Sector Repairer: Premium Automobiles Pte Ltd
Estimated Period of Repair:	16.0 days	

Adjuster: MOHD RASUL**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	2,594.00 FS	*2,074.80 FS
2	2		*FRONT BUMPER CLOSING ELEMENT - LH / RH	Serviceable	148.00 FS	*- FS
3	1		*FRONT BUMPER GRILLE - CENTER	Not Necessary	272.00 FS	*- FS
4	1		*FRONT BUMPER COVER	Not Necessary	65.00 FS	*- FS
5	2		*FRONT BUMPER GRILLE - LH / RH	Not Necessary	278.00 FS	*- FS
6	1		*FRONT BUMPER CLOSING ELEMENT	Serviceable	238.00 FS	*- FS
7	1		*FRONT BUMPER SPOILER	Not Necessary	479.00 FS	*- FS
8	1		*FRONT BUMPER BRACKET	Serviceable	27.00 FS	*- FS
9	2		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	Not Necessary	384.00 FS	*- FS
10	1		*RADIATOR GRILLE	Cracked	1,795.00 FS	*1,436.00 FS
11	1		*RADIATOR GRILLE STRIKER PLATE	Cracked	303.00 FS	*242.40 FS
12	1		*360 DEGREE CAMERA COVER CAP	Cracked	52.00 FS	*41.44 FS
13	1		*360 DEGREE CAMERA BRACKET	Cracked	53.00 FS	*42.32 FS
14	1		*360 DEGREE CAMERA SECURING PLATE	Cracked	42.00 FS	*32.88 FS
15	1		*360 DEGREE CAMERA	Cracked	1,353.00 FS	*1,082.40 FS
16	2		*FRONT PARKING AID SENSOR	Not Necessary	572.00 FS	*- FS
17	4		*FRONT PARKING AID SENSOR SEAL RING	Not Necessary	11.00 FS	*- FS
18	2		*FRONT BUMPER GUIDE SECTION - LH / RH	Serviceable	98.00 FS	*- FS
19	1		*FRONT BUMPER TOP COVER	Deformed	154.00 FS	*123.20 FS
20	1		*CAUTION STICKER	Necessary	25.00 FS	*19.44 FS
21	1		*OIL STANDARD STICKER	Not Necessary	25.00 FS	*- FS
22	1		*A/C STICKER	Necessary	10.00 FS	*7.52 FS
23	1		*FRONT FOAM FILLER PIECE	Cracked	129.00 FS	*102.80 FS
24	1		*FRONT REINFORCEMENT BEAM	Bent	1,116.00 FS	*892.60 FS
25	1		*OUTSIDE TEMP SENSOR	Serviceable	10.00 FS	*- FS
26	2		*LED HEADLIGHT - LH / RH	Cracked	13,392.00 FS	*10,713.60 FS
27	2		*LED HEADLIGHT SPACER	Necessary	100.00 FS	*79.68 FS
28	2		*LIFT CYLINDER - LH / RH	Not Necessary	488.00 FS	*- FS
29	1		*LIFT CYLINDER HOSE	Serviceable	102.00 FS	*- FS
30	2		*LED HEADLIGHT MOUNTING - LH / RH	Cracked	294.00 FS	*235.20 FS
31	2		*LED HEADLIGHT POWER MODULE - LH / RH	Serviceable	1,807.00 FS	*- FS
32	2		*FRONT FENDER - LH / RH	Bent	3,074.00 FS	*2,598.40 FS
33	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	74.00 FS	*- FS
34	2		*FRONT FENDER BRACE - LH / RH	Serviceable	254.00 FS	*- FS
35	2		*FRONT FENDER BRACKET - LH / RH	Serviceable	134.00 FS	*- FS
36	2		*FRONT FENDER CLOSING ELEMENT - LH / RH	Serviceable	84.00 FS	*- FS
37	2		*FRONT FENDER INSULATION - LH / RH	Serviceable	108.00 FS	*- FS
38	2		*FRONT FENDER DAMPER - LH / RH UPPER	Serviceable	80.00 FS	*- FS
39	2		*FRONT FENDER SEAL - LH / RH	Serviceable	90.00 FS	*- FS
40	2		*FRONT WHEEL HOUSING LINER - LH / RH	Serviceable	578.00 FS	*- FS
41	2		*BONNET HINGE COVER - LH / RH	Not Necessary	106.00 FS	*- FS
42	2		*FRONT WHEEL ARCH COVER - LH / RH	Necessary	636.00 FS	*508.00 FS
43	1		*BONNET	Bent	3,746.00 FS	*3,166.40 FS
44	2		*BONNET HINGE - LH / RH	Bent	210.00 FS	*168.00 FS
45	1		*BONNET ATTACHMENT PARTS	Not Necessary	321.00 FS	*- FS
46	2		*BONNET STRIKER - LH / RH	Bent	260.00 FS	*208.00 FS
47	1		*BONNET SOUNDS ABSORBER	Not Necessary	275.00 FS	*- FS
48	1		*BONNET IMPACT PROTECTION - CENTER	Necessary	36.00 FS	*28.40 FS
49	1		*BONNET BOWDEN CABLE - CENTER	Loose	71.00 FS	*56.40 FS
50	2		*BONNET LOCK WITH MICRO SWITCH - LH / RH	Shorted	491.00 FS	*392.80 FS
51	1		*BONNET RELEASE ELEMENT	Bent	73.00 FS	*57.76 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
52	1		*BONNET RELEASE LEVER	Not Necessary	18.00 FS	*- FS
53	1		*BONNET LOCK COVER	Cut	12.00 FS	*9.52 FS
54	1		*BONNET LOCK CABLE	Serviceable	92.00 FS	*- FS
55	1		*BONNET GAS FILLED STRUT (NPA)	Not Necessary	0.00 FS	*- FS
56	1		*PLENUM CHAMBER COVER	Cut	214.00 FS	*170.80 FS
57	1		*SEAL FOR WATER BOX	Not Necessary	74.00 FS	*- FS
58	2		*RADIATOR AIR GUIDE - LH / RH	Torn	100.00 FS	*79.84 FS
59	2		*RADIATOR AIR GUIDE - UPPER / LOWER	Torn	112.00 FS	*89.28 FS
60	1		*LOCK CARRIER	Deformed	1,591.00 FS	*1,272.80 FS
61	1		*A/C CONDENSOR	Bent	876.00 FS	*700.80 FS
62	1		*SET A/C CONDENSOR SEAL RING	Not Necessary	30.00 FS	*- FS
63	1		*ADDITIONAL RADIATOR	Bent	1,059.00 FS	*847.20 FS
64	1		*RADIATOR	Bent	1,177.00 FS	*941.60 FS
65	2		*RADIATOR BUSH	Serviceable	94.00 FS	*- FS
66	2		*RADIATOR BUSH - LOWER	Serviceable	24.00 FS	*- FS
67	1		*RADIATOR COOLANT (6PCS)	Necessary	332.00 FS	*265.44 FS
68	1		*RADIATOR FAN	Serviceable	1,685.00 FS	*- FS
69	2		*HORN - LH / RH	Cracked	56.00 FS	*21.68 FS
70	2		*HORN SIGNAL - LH / RH	Serviceable	324.00 FS	*- FS
71	1		*WASH WATER RESERVOIR	Deformed	269.00 FS	*214.80 FS
72	1		*WASH WATER RESERVOIR CAP	Not Necessary	26.00 FS	*- FS
73	1		*WINDSCREEN WASHER PUMP	Serviceable	147.00 FS	*- FS
74	1		*FRONT NO PLATE	Necessary	60.00 FS	*60.00 FS
75	1		*SUNDRIES	Necessary	800.00 FS	*49.88 FS
76	1		*INTAKE AIR GUIDE LOWER (Supplementary)	Cracked	61.00 FS	*48.72 FS
77	1		*INTAKE AIR GUIDE UPPER COVER (Supplementary)	Cracked	32.00 FS	*24.96 FS
78	1		*INTAKE AIR GUIDE INNER (Supplementary)	Cracked	24.00 FS	*18.72 FS
79	1		*INTAKE CONNECTION (Supplementary)	Cracked	851.00 FS	*680.40 FS
80	1		*REFRIGERANT LINE A/C COMPRESSOR TO CUT OFF (Supplementary)	Cut	663.00 FS	*530.40 FS
81	1		*AIR FILTER (Supplementary)	Cracked	368.00 FS	*294.00 FS
82	1		*INTAKE AIR GUIDE HOSE (Supplementary)	Cut	41.00 FS	*32.40 FS
83	1		*SPRING BAND CLAMP (3pcs)(Supplementary)	Cracked	71.00 FS	*56.40 FS
					Total Parts (\$\$)	48,400.00 30,720.08

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR, HEADLIGHT WASHER AND FRONT PARKING AID	New	480.00	480.00
2	TO REMOVE AND TRANSFER BOTH HEADLIGHT CONTROL UNIT AND POWER MODULE	New	800.00	500.00
3	TO REMOVE AND RENEW AIRCON CONDENSER, CHARGE AIR COOLER AND RADIATOR, CHECK ELECTRICAL FANS AND CONTROL UNIT	New	1,800.00	1,800.00
4	TO CARRY OUT VACUUM AND REGAS FOR R1234	New	1,200.00	1,200.00
5	TO DISMANTLE AND RENEW FRONT BUMPER, BOTH FRONT FENDERS, BONNET AND BOTH HEADLIGHTS. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	4,000.00	3,500.00
6	TO RESPRAY FRONT BUMPER, BOTH FRONT FENDERS AND BONNET	New	3,800.00	2,500.00
7	TO CARRY OUT CALIBRATION FOR 360 DEGREE CAMERA SYSTEM WITH VAS TOOLS	New	800.00	800.00
8	TO CARRY OUT DIAGNOSTIC CHECK	New	292.00	292.00
9	TO REMOVE AND RENEW AIR INTAKE SYSTEM ASSY (Supplementary)	New	280.00	280.00
Gross Labour Cost (\$)			13,452.00	11,352.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >