

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CD/III24090053/KMA3Q2
Date: 19/11/2024

REFERENCE

Handling Insurer:	India International Insurance Pte Ltd	Policy No:	D23MFL0002571
Claimant Vehicle No :	SLN9039P	Insured Vehicle No :	SLR1172T
Date of Loss:	14/08/2024	Nature of Claim:	TP
		Claim No:	MFL2024D0009383

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLN9039P	Engine No:	P520442097
Make & Model:	MAZDA 3, 1.5 SEDAN AT EU6 (A)	Chassis No:	JM6BN22A8H0150394
Reg. Date:	22/05/2017 (Man. Year: 2017)	Odometer:	175741 km
Colour:	Metallic Silver		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Triangle 5 mm	Rear Left Side:	Triangle 6 mm
Front Right Side:	Triangle 5 mm	Rear Right Side:	Triangle 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,577.38	4,195.21	7,382.17	63.76
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,950.00	1,070.00	2,880.00	72.91
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	15,527.38	5,265.21	10,262.17	66.09
Approved Total (Overridden) (S\$)		4,100.00		
(S\$)	15,527.38	4,100.00	11,427.38	73.60
+ GST 9.00/9.00% (S\$)	1,397.46	369.00	1,028.46	73.59
Nett Amount (S\$)	16,924.84	4,469.00	12,455.84	73.60
+ Loss of Use (4.0 x S\$60.00/day) (S\$)		240.00		
+ Doc/Search Fee (S\$)		27.25		
Nett Liability (S\$)		4,736.25		
Global Sum Settlement (S\$)		4,700.00		

INSPECTION

Date of Assignment:	02/09/2024	
Date Inspected:	02/09/2024 Inspected At:	Wega Engineering Pte Ltd (HQ) BLK 176 Sin Ming Drive #04-16, Sin Ming AutoCare Singapore 57521
Estimated Period of Repair:	4.0 days	

Adjuster: KENNETH KONG

Manager: Daphne Lee Mooi Ngiuk

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 09 Oct 2024)
Parts:	143	MAZDA 3 1.5 SEDAN AT EU6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLN9039P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Buckled	994.32 F	*866.80 FL
2	1		*BUMPER RETAINER RH	Serviceable	15.77 F	*- FL
3	1		*BUMPER RETAINER LH	Distorted	15.77 F	*15.77 FL
4	1		*BUMPER SPONGE	Cracked	38.10 F	*38.10 FL
5	1		*FRONT BUMPER REINFORCEMENT	Buckled	576.77 F	*478.80 FL
6	1		*FRONT BUMPER GRILLE UPPER	Cracked	163.43 F	*163.43 FL
7	1		*FRONT BUMPER GRILLE LOWER	Serviceable	163.43 F	*- FL
8	10		*FRONT BUMPER GRILLE CLIP	Necessary	50.00 F	*50.00 FL
9	1		*FRONT TOW COVER RH	Missing	39.62 F	*39.62 FL
10	1		*FRONT TOW COVER LH	Missing	39.62 F	*39.62 FL
11	1		*FRONT RADIATOR MOULDING GRILLE RH	Cracked	273.53 F	*191.00 FL
12	1		*FRONT RADIATOR MOULDING GRILLE LH	Cracked	273.53 F	*191.00 FL
13	1		*HEADLAMP RH	Mtg Cracked	1,228.05 F	*1,228.05 FL
14	1		*HEADLAMP LH	Mtg Cracked	1,228.05 F	*1,228.05 FL
15	1		*HEADLAMP BRACKET RH	Repair	473.00 F	*- FL
16	1		*HEADLAMP BRACKET LH	Repair	473.00 F	*- FL
17	1		*FOG LAMP RH	Serviceable	185.52 F	*- FL
18	1		*FOG LAMP LH	Serviceable	185.52 F	*- FL
19	1		*FOG LAMP COVER RH	Serviceable	31.53 F	*- FL
20	1		*FOG LAMP COVER LH	Serviceable	31.53 F	*- FL
21	1		*LOGO EMBLEM	Necessary	74.18 F	*74.18 FL
22	1		*FRONT BONNET	Repair	1,147.47 F	*- FL
23	1		*FRONT BONNET HINGE RH	Repair	45.01 F	*- FL
24	1		*FRONT BONNET HINGE LH	Repair	45.01 F	*- FL
25	1		*FRONT SUPPORT PANEL	Cracked	479.34 F	*479.34 FL
26	1		*TOP PANEL	Repair	576.77 F	*- FL
27	1		*CONDENSER	Serviceable	1,085.18 F	*- FL
28	1		*RADIATOR	Serviceable	1,144.94 F	*- FL
29	1		*NUMBER PLATE WITH CASING	Dented	84.04 FS	*45.00 FS
30	1		*FRONT BUMPER COVER RH	Serviceable	123.45 F	*- FL
31	1		*FRONT BUMPER COVER LH	Serviceable	123.45 F	*- FL
32	1		*LICENCE PLATE HOLDER	Dented	168.45 F	*104.00 FL

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	11,577.38	5,232.76
- List Item Discount on L Items 0.00/20.00% (\$\$)	0.00	1,037.55
Total Parts (\$\$)	11,577.38	4,195.21

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK AND REPAIR HEADLAMP & FOG LAMP WIRING	New	250.00	20.00
2	TO REPAIR PANEL BEATING & DISMANTLE REPLACE FRONT BUMPER ,FRONT BONNET ,SUPPORT PANEL & TOP PANEL	New	500.00	500.00
3	TO PUTTY & SPRAY PAINTING FRONT BUMPER ,FRONT BONNET ,SUPPORT PANEL & TOP PANEL	New	2,000.00	550.00
4	TO REMOVE AND REFIT CONDENSER & RADIATOR	New	800.00	0.00
5	TO VACCUM AND TOP UP AIRCON GAS	New	200.00	0.00
6	TO APPLY RUST PROOFING VACUUM INTERIOR AND WASH CAR	New	200.00	0.00
Gross Labour Cost (\$\$)			3,950.00	1,070.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >