



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD

INV No. AC2507107

300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555
ATTN: ENG HUEY NI

INV Date 17/10/2025
Reference CD/LPC24090061/Kua3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SMD 8637K
Insured Veh. YP 9466A
Claim No. 23/24/24/VC05/029804
Policy No. Z23VC05020051
Accident Date 02/09/2024
Inspection Date 04/09/2024

Description	Total
Third Party Express Settlement	450.00
Subtotal	450.00
GST (9%)	40.50
Grand Total	490.50

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MS LONPAC INSURANCE BHD	Ref:	CD/LPC24090061/Kua3q2
300 BEACH ROAD	Date:	17/10/2025
#17-04/07 THE CONCOURSE SINGAPORE 199555	Code:	LPC2

1. Policy Particulars :- DIRECT SETTLEMENT

Insured Veh.	YP 9466A	Veh. Inspected	SMD 8637K
Policy No.	Z23VC05020051	Coverage	0
Claim No.	23/24/24/VC05/029804	Excess	\$0.00
Assign From	ENG HUEY NI	Assign Date	04/09/2024

2. Vehicle Details

Make & Model	NISSAN SYLPHY 1.6 CVT	C.C	1598
Engine No.	HR16929216C	Year of Reg.	10/09/2018
Chassis No.	MNTBBAB17Z0032569	Colour	METALLIC RED
Odometer	30801 KM	Steering	JAMMED
Brakes	IN ORDER	General	GOOD
Modification(s)	RIMS: STANDARD ALLOY RIM		

3. Conditions of Tyres

	Size	Make	Balance (mm)
R/H Front Tyre	195/60R16	BRIDGESTONE	7
L/H Front Tyre	195/60R16	BRIDGESTONE	7
R/H Rear Tyre	195/60R16	BRIDGESTONE	7
L/H Rear Tyre	195/60R16	BRIDGESTONE	7

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT PORTION & UNDERCARRIAGE.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	02/09/2024	Inspection Date	04/09/2024
Survey held at	TSR AUTOMOTIVE PTE LTD 160 SIN MING DRIVE #06-01 SIN MING AUTOCITY SINGAPORE 575722		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SMD 8637K

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	BONNET	BENT	\$1,985.00	\$1,137.90
1	BONNET LOCK	TO REPAIR SEE LABOUR	\$480.00	\$0.00
1	BONNET HINGE LH	TO REPAIR SEE LABOUR	\$285.00	\$0.00
1	WIPER GARNISH SIDE LH	SERVICEABLE	\$280.00	\$0.00
1	FRONT SUPPORT PANEL	TO REPAIR SEE LABOUR	\$1,478.00	\$0.00
1	FRONT SUPPORT PANEL TOP COVER	DISTORTED	\$420.00	\$165.20
1	FRONT GRILLE	SERVICEABLE	\$789.50	\$0.00
1	FRONT GRILLE LOGO	SERVICEABLE	\$68.00	\$0.00
1	HEADLAMP LH	MTG BRO	\$2,218.00	\$1,972.20
1	HEADLAMP LOWER BRACKET LH	CRACKED	\$220.00	\$50.40
1	FRONT FENDER LH	BENT	\$698.50	\$698.50
1	FRONT FENDER QUARER GARNISH LH	MISSING	\$198.00	\$78.20
1	FRONT FENDER UNDERSHIELD LH	CRACKED	\$398.00	\$155.80
1	FRONT WHEELHOUSING LH	TO REPAIR SEE LABOUR	\$985.60	\$0.00
1	FRONT DOOR LH (NPA)	TO REPAIR SEE LABOUR	\$0.00	\$0.00
1	FRONT DOOR AIR PILLAR LH (NPA)	TO REPAIR SEE LABOUR	\$0.00	\$0.00
1	FRONT BUMPER	CRACKED	\$1,385.00	\$759.20
1	FRONT BUMPER RETAINER LH	CRACKED	\$198.00	\$45.50
1	FRONT BUMPER BRACKET LH	TO REPAIR SEE LABOUR	\$150.00	\$0.00
1	FRONT BUMPER TOW COVER	MISSING	\$228.00	\$21.80
1	FRONT BUMPER SPONGE	CRACKED	\$480.00	\$134.00
1	AIR BOX CENTER SUCTION PIPE LH	SERVICEABLE	\$745.00	\$0.00
1	AIR BOX LOWER LH	DENTED	\$850.00	\$164.80
1	FRONT WHEELHUB LH	BENT	\$480.00	\$290.20
1	FRONT WHEEL BEARING LH	NECESSARY	\$398.00	\$310.00
1	FRONT SUSPENSION LH	BENT	\$785.90	\$444.50
1	FRONT SUSPENSION MOUNTING LH	BENT	\$280.00	\$160.70
1	FRONT LOWER ARM LH	DISTORTED	\$650.00	\$234.80
1	FRONT KNUCKLE ARM LH	BENT	\$678.50	\$402.90
1	FRONT STABILIZER BAR LINK LH	SERVICEABLE	\$338.00	\$0.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRONT BUMPER REINFORCEMENT (ADDITIONAL)	BENT	\$589.60	\$589.60
1	FRONT AIR PILLAR INNER GARNISH LH (ADDITIONAL)	SERVICEABLE	\$228.00	\$0.00
1	HEADLAMP PANEL LH (ADDITIONAL)	BENT	\$268.00	\$166.00
1	FRONT FENDER INNER BRACKET LH (ADDITIONAL)	DISTORTED	\$181.40	\$108.20
1	FRONT ENGINE LOWER COVER (ADDITIONAL)	CRACKED	\$575.40	\$210.00
	LESS 10.00% DISCOUNT		(\$1,999.24)	(\$830.04)
			\$17,993.16	\$7,470.36

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
10	FRONT SUPPORT PANEL TOP CLIPS (SN)	NECESSARY	\$45.00	\$45.00
10	FRONT GRILLE CLIPS (SN)	NOT NECESSARY	\$50.00	\$0.00
10	FRONT BUMPER CLIPS (SN)	NECESSARY	\$45.00	\$45.00
10	FRONT FENDER UNDERSHIELD CLIPS (SN)	NECESSARY	\$45.00	\$45.00
1	FRONT RIM LH (SN)	DENTED	\$1,200.00	\$500.00
1	FRONT TYRE LH (\$280.00)(60%) (SN)	PUNCTURE	\$600.00	\$112.00
1	FRONT BUMPER SENSOR WITH METER (SN)	SERVICEABLE	\$600.00	\$0.00
			\$2,585.00	\$747.00

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	LABOUR CHARGES.INCLUSIVE OF THE REPAIR OF BONNET LOCK,BONNET HINGE LH,FRONT SUPPORT PANEL,FRONT WHEELHOUSING LH,FRONT DOOR LH,FRONT DOOR AIR PILLAR LH AND FRONT BUMPER BRACKET LH.		\$1,800.00	\$600.00
	REPLACE RIM TYRE,FRONT UNDERCARRIAGE		\$500.00	\$200.00
	CHECK WIRING SYSTEM ,REPLACE SENSOR ,FORCUS HEAD LAMP ETC		\$200.00	\$60.00
	TO DO COMPUTER WHEEL ALIGNMENT		\$80.00	\$60.00
	TO DO COMPUTER SETTING AFTER REPAIR	NOT NECESSARY	\$180.00	\$0.00
	ANTI RUST		\$120.00	\$60.00
	SEALANT ,SEAL GAP ,WATERPROOFING ON ACCIDENT AREA	NOT NECESSARY	\$200.00	\$0.00
	TO DO SPRAY PAINTING ON ACCIDENT AREA SIGNATURE RED		\$1,600.00	\$880.00
			\$4,680.00	\$1,860.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

GRAND TOTAL		\$25,258.16	\$10,077.36
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)		\$8,000.00
Report Ref No: CD/LPC24090061/Kua3q2			

MARKET VALUE: \$57,000.00(EST) LESS LTA REBATE: \$25,059.00(EST) = NETT VALUE :\$31,941.00(EST)

KSC

KENNETH KONG SENG CHEONG

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of repositibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K




PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K

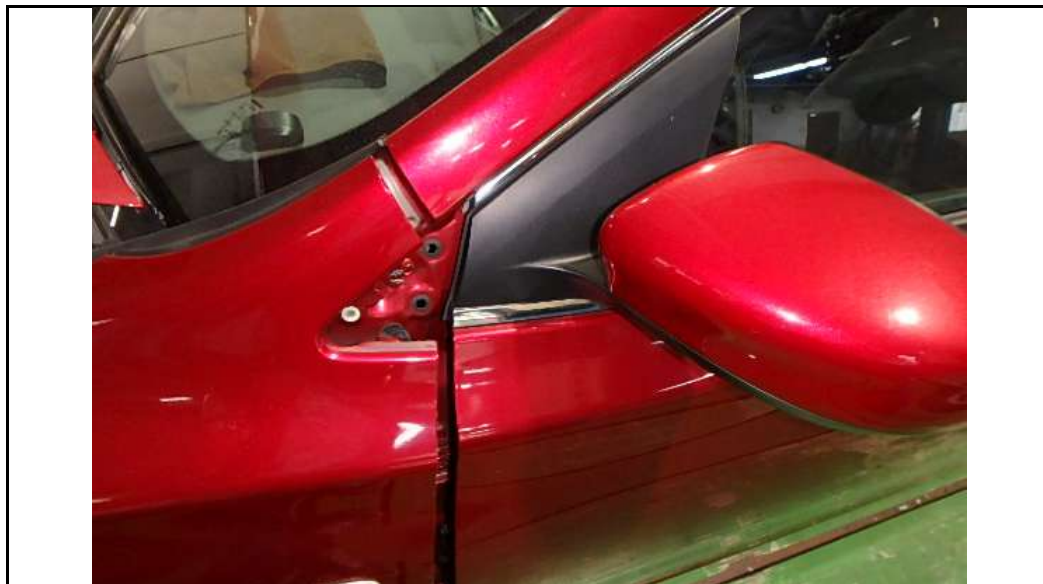

PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 6 of 6)

PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K



PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SMD 8637K

