



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

| | | |
|--------------------------------|-------|-----------------------|
| MS INCOME INSURANCE LTD | Ref: | CS/INC24090163/Aqh3e2 |
| 75 BRAS BASAH ROAD | Date: | 23/10/2024 |
| INCOME CENTRE SINGAPORE 189557 | Code: | INC |

1. Policy Particulars :- THIRD PARTY CLAIM

| | | | |
|--------------|----------------|----------------|------------|
| Insured Veh. | SJN 7652E | Veh. Inspected | SMR 3196A |
| Policy No. | - | Coverage | 0 |
| Claim No. | MT/1294111-002 | Excess | \$0.00 |
| Assign From | ASTER QUEK | Assign Date | 10/09/2024 |

2. Vehicle Details

| | | | |
|-----------------|-------------------|--------------|------------|
| Make & Model | HYUNDAI I30 | C.C | 1353 |
| Engine No. | G4LDKG035042 | Year of Reg. | 30/12/2019 |
| Chassis No. | TMAH3813VLJ068565 | Colour | SILVER |
| Odometer | 50434 KM | Steering | IN ORDER |
| Brakes | IN ORDER | General | GOOD |
| Modification(s) | RIMS: SPORTS RIM | | |

3. Conditions of Tyres

| | Size | Make | Balance (mm) |
|----------------|------------|----------|--------------|
| R/H Front Tyre | 225/45 R17 | YOKOHAMA | 6 |
| L/H Front Tyre | 225/45 R17 | YOKOHAMA | 6 |
| R/H Rear Tyre | 225/45 R17 | YOKOHAMA | 6 |
| L/H Rear Tyre | 225/45 R17 | YOKOHAMA | 6 |

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

| | | | |
|----------------|---|-----------------|--------------------|
| Accident Date | 05/09/2024 | Inspection Date | 10/09/2024 (12:24) |
| Survey held at | N-51 AUTOMOTIVE PL 2 KAKI BUKIT AVE 2 #01-17 KAKI BUKIT AUTOHUB SINGAPORE 417921 | | |

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 6 Working Days