



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD	INV No.	AC2503423
3 ANSON ROAD #16-00	INV Date	02/06/2025
SPRINGLEAF TOWER	Reference	CD/CTI24090349/Kma3q2
SINGAPORE 079909	Code	CTI

### PROFESSIONAL SERVICE FEE

Vehicle No.	SMH 3399J
Insured Veh.	GBE 4492L
Claim No.	SNM24D205231
Policy No.	DMCVSNW00026382405
Accident Date	16/09/2024
Inspection Date	18/09/2024

Description	Total
Third Party Express Settlement	400.00
<b>Subtotal</b>	<b>400.00</b>
<b>GST (9%)</b>	<b>36.00</b>
<b>Grand Total</b>	<b>436.00</b>

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

**LKM**



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909		Ref: CD/CTI24090349/Kma3q2(N) Date: 02/06/2025 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	GBE 4492L	Veh. Inspected	SMH 3399J
Policy No.	DMCVSNW00026382405	Coverage (\$)	0.00
Claim No.	SNM24D205231	Excess (\$)	0.00
Assign From		Assign Date	18/09/2024
2. Vehicle Particulars & Condition			
Make & Model	HONDA VEZEL (A)	c.c	1496
Engine No.	HIDDEN	Year of Reg.	2019
Chassis No.	RU11309951	Colour	METALLIC LIGHT MAROO
Odometer	46471 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
General	GOOD		
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre	215/60 R16	DUNLOP	5 mm
L/H Front Tyre	215/60 R16	DUNLOP	5 mm
R/H Rear Tyre	215/60 R16	DUNLOP	4 mm
L/H Rear Tyre	215/60 R16	DUNLOP	4 mm
4. Description of Damages			
THE VEHICLE SUSTAINED DAMAGES AT THE N/S FRONT BODY & UNDERCARRIAGE. DAMAGES SEE DETAILS.			
5. General Information			
Accident Date	16/09/2024	Inspection Date	18/09/2024
Survey held at	GUAN MOTOR WORKS 176 SIN MING DRIVE #02-03 SIN MING AUTOCARE SINGAPORE 575721		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair			
ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days	



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMH 3399J

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER	CRACKED	947.40	762.70
1	FRONT BUMPER GRILLE	SERVICEABLE	385.00	-
1	FRONT BUMPER LH FOG LAMP COVER	SERVICEABLE	45.00	-
1	FRONT BUMPER LH FOG LAMP	SERVICEABLE	327.00	-
1	FRONT BUMPER LOWER BLACK SKIRTING	DISTORTED	429.00	429.00
1	FRONT BUMPER LH SIDE RETAINER	CRACKED	25.00	25.00
1	FRONT BUMPER INNER REINFORCEMENT	TO REPAIR SEE LABOUR	321.00	-
1	SET FRONT BUMPER CLIPS	NECESSARY	50.00	50.00
1	LH HEADLAMP	CRACKED	2,050.00	1,917.00
1	LH HEADLAMP LOWER BRACKET	TO REPAIR SEE LABOUR	35.00	-
1	FRONT LH FENDER	BENT	444.70	444.70
1	FRONT LH FENDER LOWER BLACK GARNISH	BENT	178.00	178.00
1	SET FRONT LH FENDER LOWER BLACK GARNISH CLIPS	NECESSARY	40.00	40.00
1	FRONT LH FENDER UNDER SHIELD	DISTORTED	129.00	129.00
1	SET FRONT FENDER UNDER SHIELD CLIPS	NECESSARY	30.00	30.00
1	FRONT LH WHEEL HOUSE PANEL	TO REPAIR SEE LABOUR	670.50	-
1	FRONT LH WHEEL HOUSE EXTENSION	TO REPAIR SEE LABOUR	280.00	-
1	FRONT LH SIDE MIRROR BODY	MTG DISTORTED	623.00	623.00
1	FRONT LH SIDE MIRROR COVER	TO REPAIR SEE LABOUR	84.40	-
1	FRONT LH DOOR	BENT	950.00	950.00
2	FRONT LH DOOR HINGE (TOP & BOTTOM)	TO REPAIR SEE LABOUR	116.40	-
1	FRONT LH DOOR CHECKER	SERVICEABLE	85.70	-
1	FRONT LH DOOR WEATHERSTRIP	SERVICEABLE	87.40	-
1	SET FRONT LH DOOR INNER TRIM BOARD CLIPS	NOT NECESSARY	50.00	-
2	FRONT SPORT RIMS LH/RH	DENTED	1,645.80	1,645.80
2	FRONT SHOCK ABSORBER LH/RH	BENT	736.00	736.00
2	FRONT LOWER ARM LH/RH	DISTORTED	933.00	933.00

Report Ref No. CD/CTI24090349/Kma3q2(N)



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT KNUCKLE ARM LH/RH	BENT	540.00	540.00
1	FRONT LH DRIVE SHAFT	TO REPAIR SEE LABOUR	1,018.70	-
1	FRONT STABILIZER BAR	SERVICEABLE	211.70	-
1	FRONT STABILIZER BAR LH LINK ROD	SERVICEABLE	107.60	-
2	FRONT WHEEL HUB LH/RH	BENT	510.00	510.00
2	FRONT WHEEL BEARING LH/RH	NECESSARY	300.00	300.00
1	LH ROCKER PANEL GARNISH (ADDITIONAL)	DENTED / CUT	320.00	320.00
1	FRONT BUMPER SPOILER (ADDITIONAL)	CRACKED	84.90	84.90
	LESS 20% DISCOUNT		-	-2,129.62
			14,791.20	8,518.48
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	FRONT RH TYRE (50%) (SN) (ADDITIONAL)	CUT	220.00	110.00
1	SET FRONT LH MUD FIAP (SN) (ADDITIONAL)	DISTORTED	280.00	280.00
1	FRONT LH TYRE (50%) (SN)	TORN	220.00	110.00
			720.00	500.00
	<b><u>LABOUR</u></b>			
	TOWING CHARGES .		80.00	60.00
	LABOUR CHARGES FOR REMOVE /REFIT ,CUTTING /WELDING AND REPLACEMENT OF DAMAGES .INCLUSIVE OF THE REPAIR OF FRONT BUMPER INNER REINFORCEMENT,LH HEADLAMP LOWER BRACKET,FRONT LH WHEEL HOUSE PANEL,FRONT LH WHEEL HOUSE EXTENSION,FRONT LH SIDE MIRROR COVER,FRONT LH DOOR HINGE (TOP & BOTTOM) AND FRONT LH DRIVE SHAFT .		1,600.00	700.00
	TO PUTTY AND SPRAY SPRAY PAINTING CHARGES.		1,200.00	860.00
	TO CHECK WIRING AND LIGHTINGS.		40.00	20.00
	TO REMOVE,REFIT FRONT DOOR FITTINGS .		80.00	60.00
	TO REMOVE,REFIX BOTH FRONT UNDER CARRIAGES DAMAGE PARTS.		280.00	240.00
	TO REMOVE ,REFIT ENGINE & GEARBOX ASSY ,TO FACILITATE REPAIR .	NOT NECESSARY	350.00	-
	TO CONDUCT COMPUTERISE WHEEL ALIGNMENT TEST		100.00	60.00

Report Ref No. CD/CTI24090349/Kma3q2(N)



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO SUPPLY AND APPLY ANTI RUST TREATMENT.		80.00	60.00
			3,810.00	2,060.00
<b>GRAND TOTAL</b>			<b>19,321.20</b>	<b>11,078.48</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>8,850.00</b>

Report Ref No. CD/CT124090349/Kma3q2(N)

**KONG SENG CHEONG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

INSPECTION PHOTOS (Page 2 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

INSPECTION PHOTOS (Page 3 of 7)

### PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**





## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

INSPECTION PHOTOS (Page 7 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**



**PHOTOGRAPHS FOR VEHICLE NO. : SMH 3399J**

