

ASS. REC. BY:

REF:

3M01

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

01 days

Res.: Yes or No

Lum Sum:

118.1%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMN 5281A

Yr Regn:

07.19

Type: M.Cab / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

(A)

Make:

Honda Fit

c.c

1498

Colour

M. Black

AC:

Insured / Std / NI / NA

Sp. Reading

676674

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

GP5 1338702

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

195/55R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Black hawk

Front

R/Bal.

8

mm

Rear

R/Bal.

8

mm

L/Bal.

8

mm

L/Bal.

8

mm

D.O.A.

23/9/24

D.O.I.

29/11/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rm o/s down mirror

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

S - RS. SI

: F.R.A.S.

: Others

Report Format :

ump Sum / I.B.I: (\$

TOTAL



MOTORSPORTS

JD MOTORSPORTS PTE LTD

25 KAKI BUKIT RD 4 # 05-76 SYNERGY @ KB S417800

DATE : 23/09/2024
VEHICLE : SMM5281A
MAKE/MODEL : HYONDA / FIT
CHASSIS NO : GP5-1338702
MILLAGE :
TYRE SIZE :
DOA : 23/09/2024

Not Authorised
Phanny Bgpaing
1 day

LIST ITEM

01 PC RH SIDE MIRROR ASSY
01 PC RH SIDE MIRROR COVER

\$ 1,546.29 ?
Pen \$ 157.30 X
\$ 1,703.59

Labour:

1. TO SUPPLY PARTS & LABOUR TO REPLACE ABOVE MENTIONED PARTS
2. TO SUPPLY PAINT & LABOUR TO SPRAY ACCIDENT AFFECTED AREA
3. TO SUPPLY BODY PAINT CERAMIC COATING
4. TO SUPPLY LABOUR TO REWIRE REPLACE PARTS

\$601 100.00 *2801*
\$601 100.00
ng 300.00 X
\$ 50.00 *151*
\$ 550.00

TOTAL PARTS

TOTAL LABOUR

TOTAL COST OF REPAIR

\$ 1,703.59
\$ 550.00
\$ 2,253.59

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: