

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CD/AIG24090456/UPA3Q2
Date: 18/03/2025

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 7220085645
Claimant Vehicle No : FBK5930B **Insured Vehicle No :** SJC9311J
 Date of Loss: 15/09/2024 Nature of Claim: TP Claim No: 0473241543SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **FBK5930B**
 Make & Model: SUZUKI UH200AL5 BURGMAN, 200cc ABS Engine No: H405402312
 Reg. Date: 06/11/2015 (Man. Year: 2015) Chassis No: MLCC9112100402312
 Colour: White Odometer: 176419 km
 Engine Capacity: 200 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 110-90-13 Rear Tyre Size: 130-70-12
 Front Left Side: Pirelli 6 mm Rear Left Side: SHINK 6 mm
 Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,958.00	5,084.10	5,873.90	53.60
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,763.00	635.00	1,128.00	63.98
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	12,721.00	5,719.10	7,001.90	55.04
Approved Total (Overridden) (S\$)		3,100.00		
Nett Amount (S\$)	12,721.00	3,100.00	9,621.00	75.63
Global Sum Settlement (S\$)		0.00		

INSPECTION

Date of Assignment: 25/09/2024
 Date Inspected: 25/09/2024 Inspected At: Ban Hock Hin Co. Pte Ltd (HQ)
 Industrial City
 Singapore 533758
 Estimated Period of Repair: 5.0 days

Adjuster: MARCUS CHUA

Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BALANCER HANDLE	Not Necessary	23.00 F	*- FL
2	1		*BEARING STEERING CONE	Necessary	74.00 F	*74.00 FL
3	1		*BEARING STEERING CONE (25X47X15)	Necessary	85.00 F	*85.00 FL
4	1		*BELLY PIN	Serviceable	181.00 F	*- FL
5	1		*BOX FRONT (BLACK)	Distorted	341.00 F	*341.00 FL
6	1		*BOX REAR 45L (KKK)	Not fitted	388.00 F	*- FL
7	1		*BRACE LEG SHIELD	Cut	164.00 F	*164.00 FL
8	1		*BRACKET UNDER FORK	Bent	939.00 F	*939.00 FL
9	1		*BRAKE BOX REAR	Repair	481.00 F	*- FL
10	5		*CLIP (BLACK)	Necessary	25.00 F	*25.00 FL
11	1		*COVER SHIELD LEG FRONT (WHITE)	Serviceable	81.00 F	*- FL
12	1		*COVER SHIELD LEG FRONT (WHITE)	Cracked	458.00 F	*458.00 FL
13	1		*COVER SIDE LOWER LH (GRAY)	Cracked	205.00 F	*205.00 FL
14	1		*COVER SIDE LOWER RH (GRAY)	Serviceable	205.00 F	*- FL
15	1		*COVER TAIL LH (WHITE)	Serviceable	164.00 F	*- FL
16	1		*COVER FRONT (WHITE)	Cut	168.00 F	*168.00 FL
17	1		*COVER MUFFLER	Repair	97.00 F	*- FL
18	1		*COVER MUFFLER RR	Repair	61.00 F	*- FL
19	2		*CUSHION	Necessary	12.00 F	*12.00 FL
20	2		*CUSHION	Necessary	12.00 F	*12.00 FL
21	2		*CUSHION	Necessary	12.00 F	*12.00 FL
22	1		*CUSHION COVER	Necessary	5.00 F	*5.00 FL
23	2		*CUSHION FR BOX NO.3	Necessary	16.00 F	*16.00 FL
24	2		*CUSHION FR BOX NO.4	Necessary	16.00 F	*16.00 FL
25	2		*CUSHION FR BOX NO.5	Necessary	16.00 F	*16.00 FL
26	2		*CUSHION FR BOX NO.6	Necessary	16.00 F	*16.00 FL
27	1		*CUSHION ,FR PANEL LID NO.1	Damaged	10.00 F	*10.00 FL
28	1		*CUSHION FRAME COVER UPR NO.2	Damaged	6.00 F	*6.00 FL
29	4		*DAMPER	Necessary	20.00 F	*20.00 FL
30	1		*DAMPER ASSY FRONT FOKR LH	Bent	944.00 F	*944.00 FL
31	2		*EMBLEM 200 (GRAY/WHITE)	Serviceable	56.00 F	*- FL
32	2		*EMBLEM (BURGSMAN) LOGO	Serviceable	94.00 F	*- FL
33	1		*EMBLEM S	Serviceable	31.00 F	*- FL
34	1		*FENDER FRONT (WHITE)	Cut	183.00 F	*183.00 FL
35	1		*FOOTBOARD LH (BLACK)	Serviceable	37.00 F	*- FL
36	1		*FORK FRONT RH ASSY	Bent	944.00 F	*944.00 FL
37	1		*FRONT BELL PAN (GRAY)	Serviceable	186.00 F	*- FL
38	1		*HANDLE SEAT LH	Serviceable	186.00 F	*- FL
39	1		*HANDLE SEAT RH	Repair	186.00 F	*- FL
40	1		*HEADLAMP ASSY	Cracked	559.00 F	*559.00 FL
41	1		*LAMP SIGNAL FRONT LH ASSY	Cracked	115.00 F	*115.00 FL
42	1		*LAMP SIGNAL LFRONT RH ASSY	Not Necessary	115.00 F	*- FL
43	1		*LEVER ASSY REAR BRAKE	Serviceable	48.00 F	*- FL
44	1		*LEVER FRONT BRAKE	Serviceable	61.00 F	*- FL
45	1		*LID INNER	Distorted	41.00 F	*41.00 FL
46	1		*LID LH (BLACK)	Distorted	17.00 F	*17.00 FL
47	1		*LID OUTER (BLACK)	Not Necessary	60.00 F	*- FL
48	1		*MAT FLOOR LH (BLACK)	Cut	65.00 F	*65.00 FL
49	1		*MAT FLOOR RH (BLACK)	Serviceable	65.00 F	*- FL
50	1		*MIRROR ASSY RR VIEW LH	Broken	68.00 F	*68.00 FL
51	1		*MIRROR ASSY RR VIEW RH	Serviceable	68.00 F	*- FL
52	1		*OBU TYPE B (12V)NEW	Not Necessary	341.00 F	*- FL
53	1		*PANEL METER LOWER (BLACK)	Cut	100.00 F	*100.00 FL
54	1		*REPAIR ON BODY ALIGNMENT	Not Necessary	775.00 F	*- FL
55	1		*RUBBER FLOOR MAT SET REAR (NPA)	Not Necessary	0.00 F	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount	
56	1		*SEAL STEERING UPPER DUST	Necessary	13.00 F	*13.00 FL	
57	1		*STAND MAIN	Repair	38.00 F	*- FL	
58	1		*STICKER NUMBER PLATE FRONT (BLACK)	Not Necessary	30.00 F	*- FL	
59	1		*WINDSCREEN	Serviceable	1,251.00 F	*- FL	
					Sub Total (\$)	10,958.00	5,649.00
					- List Item Discount on L Items 0.00/10.00% (\$)	0.00	564.90
					Total Parts (\$)	10,958.00	5,084.10

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TRANSPORT CHARGES	New	63.00	35.00
2	LABOUR QUOTED FOR DISMANTLING AND INSTALLATION OF PARTS	New	1,700.00	600.00
			Gross Labour Cost (\$\$)	1,763.00
				635.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >