

ASS. REC. BY:

REF:

SMOI

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / QD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

06-21

Eng Shing

955A

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

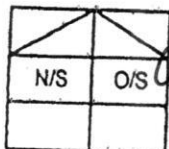

Bal. or Market Value:

\$51K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

01

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

06/28

Person Contacted:

Vehicle: IN / OUT

Veh No:

SKA 80917

Yr Regn:

06 09

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Camry

c.c

2362

Colour

M. Gold

A/C:

Insured / Std / NI / NA

Sp. Reading

866253

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

NR053BK4007034763

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

215/80R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Towadar

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

18/6/24

D.O.I.

25/6/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rt o/s down mirror

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

26/6

21 Pm

8.125d Carpal

(Red. \$ 830.93.397)

Date/Time, File Pass to?

☐

: Prel. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

1

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. \$

Fees

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

ENG SHING MECHANICAL

Business Reg. No: 34823200D

(Repair & Insurance Claim)

Sin Ming AutoCity, 160 Sin Ming Drive #06-21, Singapore 575722

Vehicle number : SKA8091Z
Date of Accident : 2024/6/18
Accident along : Queensway underpass

Parts

1	Front wing mirror housing	CM	1,694.40	✓
2	Front wing mirror outer cover	CM	62.60	✓
3	Front wing mirror signal lamp	CM	45.40	✓
4	Front wing mirror glass	CM	105.50	✓

Total parts 1,907.90
25% 476.98
1,430.93

Labour

1	Labour	300.00	801
2	Spray painting	300.00	801
3	Rewire	50.00	201

Total labour 650.00

Total repair cost 1,126.98 2080-93

NOT Noted
C/Pay @ 1250p
Review After Paint
1 day

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: