1/27/25, 11:54 AM Adjuster Report

#### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

#### VEHICLE DAMAGE INSPECTION REPORT

CS/AIG24100194/RQP3E2

AIG Asia Pacific Insurance Pte. Ltd. AIG Building, 78 Shenton Way, #09-16

nce Pte. Ltd.
Our File No:

Singapore 079120 Date: 27/01/2025

**REFERENCE** 

Insured/Claimant: TAN SOH LING MRS. CHIA CHER KENG @ CHIA CHER KENG Policy No: 2100492074

Date of Loss: 08/10/2024 Nature of Claim: OD Claim No: 9285154575SG

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: ES707K

Make & Model: AUDI A1, 999cc SB 1.0 TFSI (PI) (A) Engine No: CHZ123184

Reg. Date: 28/11/2016 (Man. Year: 2016) Chassis No: WAUZZZ8X2HB013753

Colour: Grey Odometer: 59381 km

Engine Capacity: 999 cc

Market Value/New Car Price: S\$33,000.00

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES** 

Front Tyre Size: 215/45 R16 Rear Tyre Size: 215/45 R16
Front Left Side: Continental 6 mm Rear Left Side: Continental 6 mm
Front Right Side: Continental 6 mm Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		21,109.00	6,919.60	14,189.40	67.22
Miscellaneous Items		0.00	0.00	0.00	
Labour		9,122.00	5,002.00	4,120.00	45.17
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Calculated Gross Total (S\$)	30,231.00	11,921.60	18,309.40	60.56
	- Excess (S\$)	3,100.00	3,100.00	0.00	0.00
	(S\$)	27,131.00	8,821.60	18,309.40	67.49
	+ GST 9.00/9.00% (S\$)	2,441.79	793.94	1,647.85	67.49
	Nett Amount (S\$)	29,572.79	9,615.54	19,957.25	67.49

**INSPECTION** 

Date of Assignment: 10/10/2024

Date Inspected: 11/10/2024 Inspected At: 24 Benoi Sector Singapore 629857

Repairer: Premium Automobiles Pte Ltd

Estimated Period of Repair: 7.0 days

Adjuster: MOHD RASUL Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

# **REPAIR DETAILS**

# **Recommended Parts**

No.	Qty Part No	o. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Deformed	1,955.00 FS	*1,564.00 FS
2	1	*FRONT BUMPER FIXING PARTS	Not Necessary	277.00 FS	*-FS
3	1	*FRONT BUMPER HINGE BRACKET - RH	Not Necessary	43.00 FS	*-FS
4	1	*FRONT BUMPER ADAPTOR - RH	Serviceable	22.00 FS	*-FS
5	1	*FRONT BUMPER GRILLE - CENTER	Not Necessary	245.00 FS	*- FS
3	1	*FRONT BUMPER CLOSING ELEMENT	Serviceable	210.00 FS	*- FS
7	1	*FRONT BUMPER AIR GUIDE GRILLE - RH	Missing	507.00 FS	*405.60 FS
3	1	*HEADLIGHT - RH	Scratched	2,240.00 FS	*1,792.00 FS
9	1	*HEADLIGHT MOUNTING - RH	Serviceable	147.00 FS	*- FS
10	1	*LIFT CYLINDER - RH	Cracked	170.00 FS	*136.00 FS
11	1	*LIFT CYLINDER HOSE	Serviceable	233.00 FS	*- FS
12	1	*FRONT FENDER - RH	Repair	1,058.00 FS	*- FS
13	1	*FRONT FENDER ATTACHMENT PARTS - RH	Not Necessary	52.00 FS	*-FS
14	1	*FRONT FENDER BRACKET - RH FRONT	Not Necessary	73.00 FS	*- FS
15	1	*FRONT FENDER BRACE - RH FRONT	Not Necessary	83.00 FS	*- FS
16	4	*FRONT FENDER RIVET - RH	Not Necessary	17.00 FS	*-FS
17	1	*FRONT FENDER BRACKET - CENTRE RH	Not Necessary	70.00 FS	*- FS
18	1	*FRONT WHEEL HOUSING LINER - RH	Serviceable	204.00 FS	*-FS
19	1	*FRONT WHEEL HOUSING LINER ATTACHMENT - RH	Not Necessary	47.00 FS	*- FS
20	1	*FRONT ALUMINIUM RIM - RH	Serviceable	1,394.00 FS	*- FS
21	1	*FRONT ALUMINIUM RIM RUBBER VALVE - RH	Serviceable	5.00 FS	*- FS
22	1	*FRONT LOWER ARM - RH	Bent	394.00 FS	*314.80 FS
23	1	*FRONT WHEEL BEARING HOUSING - RH	Bent	601.00 FS	*480.40 FS
24	1	*FRONT WHEEL HUB - RH	Bent	504.00 FS	*402.80 FS
25	<del>.</del> 1	*FRONT LOWER ARM JOINT - RH	Bent	135.00 FS	*107.60 FS
26	1	*FRONT ANTI-ROLL BAR	Serviceable	276.00 FS	*-FS
27	2	*FRONT ANTI-ROLL BAR BUSH	Serviceable	31.00 FS	*- FS
28	2	*FRONT COUPLING ROD	Serviceable	216.00 FS	*-FS
29	1	*FRONT DRIVESHAFT - RH	Serviceable	2,224.00 FS	*-FS
29 30	1	*FRONT SHOCK ABSORBER	Bent	471.00 FS	*376.80 FS
31	1	*FRONT ASSEMBLY CARRIER	Serviceable		*-FS
32	1	*FRONT ASSEMBLY CARRIER SUPPORT RH	Serviceable	1,218.00 FS 34.00 FS	- r s *- F S
33	1	*STEERING GEAR	Serviceable	3,282.00 FS	*-FS
34	1	*STEERING GEAR  *STEERING GEAR TIE ROD - RH		102.00 FS	*81.60 FS
			Bent		
35	1 1	*STEERING GEAR TIE ROD END - RH	Bent Serviceable	125.00 FS	*100.00 FS *- FS
36	•	*NOISE INSULATION		367.00 FS	 *-FS
37	1	*FRONT TYRE - RH (NPA)	Not Necessary	0.00 FS	-1-5
38	1	*SUNDRIES	Necessary	800.00 FS	*124.96 FS
39	1	*RADIATOR GRILLE	Cracked	1,192.00 FS	*953.60 FS
	•	(Supplementary)	2.3.3.3	.,	
40	1	*STICKER FOR CAUTION (Supplementary)	Necessary	25.00 FS	*19.44 FS
41	1	*FRONT NUMBER PLATE (Supplementary)	Necessary	60.00 FS	*60.00 FS
-=Fra	ınchise part. S=Sp	ocnett.	Total Parts (S\$)	21,109.00	6,919.60
			ισται ι αιτο (σφ)	± 1, 100.00	0,010.00

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

	Lab.Type	Repairer's	Amount
our Items			
TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	0.00
TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHT, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT	New	480.00	480.00
TO REMOVE AND TRANSFER RHS HEADLIGHT CONTROL UNIT AND POWER MODULE	New	350.00	250.00
TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER AND RHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	<b>D</b> New	2,100.00	1,000.00
TO RESPRAY FRONT BUMPER AND RHS FRONT FENDER	New	1,900.00	1,100.00
TO RENEW RHS FRONT RIM WITH TYRE AND CARRY OUT PRE/POST WHEEL ALIGNMENT	New	520.00	280.00
TO REMOVE AND REINSTALL FRONT SUSPENSION. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY	New	3,200.00	1,600.00
TO CARRY OUT DIAGNOSTIC CHECK	New	292.00	292.00
Gross Labou	r Cost (S\$)	9,122.00	5,002.00
	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHT, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT TO REMOVE AND TRANSFER RHS HEADLIGHT CONTROL UNIT AND POWER MODULE TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER AND RHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED TO RESPRAY FRONT BUMPER AND RHS FRONT FENDER TO RENEW RHS FRONT RIM WITH TYRE AND CARRY OUT PRE/POST WHEEL ALIGNMENT TO REMOVE AND REINSTALL FRONT SUSPENSION. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY TO CARRY OUT DIAGNOSTIC CHECK	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE  TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHT, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT  TO REMOVE AND TRANSFER RHS HEADLIGHT CONTROL UNIT AND POWER MODULE  TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER AND RHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED  TO RESPRAY FRONT BUMPER AND RHS FRONT FENDER  TO RENEW RHS FRONT RIM WITH TYRE AND CARRY OUT PRE/POST New WHEEL ALIGNMENT  TO REMOVE AND REINSTALL FRONT SUSPENSION. INSPECT FOR New DAMAGES AND RENEW ACCORDINGLY	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE  TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHT, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT  TO REMOVE AND TRANSFER RHS HEADLIGHT CONTROL UNIT AND POWER MODULE  TO DISMANTLE AND RENEW FRONT BUMPER, RHS FRONT FENDER AND RHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED  TO RESPRAY FRONT BUMPER AND RHS FRONT FENDER  TO RENEW RHS FRONT RIM WITH TYRE AND CARRY OUT PRE/POST WHEEL ALIGNMENT  TO REMOVE AND REINSTALL FRONT SUSPENSION. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY  TO CARRY OUT DIAGNOSTIC CHECK  New 280.00  A 80.00  A 80.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >