



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2503230

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 26/05/2025
Reference CD/CTI24100224/Dpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SHC 1012Z
Insured Veh. SMY 2369M
Claim No. SNM24D205760
Policy No. DMPCSNW00065492403
Accident Date 11/10/2024
Inspection Date 15/10/2024

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (9%)	36.00
Grand Total	436.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24100224/Dpa3q2(N)	
			Date: 26/05/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SMY 2369M	Veh. Inspected	SHC 1012Z
	Policy No.	DMPCSNW00065492403	Coverage (\$)	0.00
	Claim No.	SNM24D205760	Excess (\$)	0.00
	Assign From		Assign Date	15/10/2024
2. Vehicle Particulars & Condition				
	Make & Model	HYUNDAI IONIQ	c.c	1580
	Engine No.	HIDDEN	Year of Reg.	2018
	Chassis No.	KMHC851CVJU103466	Colour	BLUE
	Odometer	-	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	195/65 R15	WEST LAKE	5 mm
	L/H Front Tyre	195/65 R15	WEST LAKE	5 mm
	R/H Rear Tyre	195/65 R15	WEST LAKE	5 mm
	L/H Rear Tyre	195/65 R15	WEST LAKE	5 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	11/10/2024	Inspection Date	15/10/2024
	Survey held at	BIFROST AUTO PTE LTD 8 KAKI BUKIT AVENUE 4 #01-49 PREMIER @ KAKI BUKIT SINGAPORE 415875		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		9 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHC 1012Z

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BONNET	TO REPAIR SEE LABOUR	2,253.80	-
1	BONNET HINGE (LH/RH) @\$118.70	BENT	237.40	237.40
1	BONNET MOULDING	NOT NECESSARY	41.40	-
1	BONNET LOCK	BENT	127.30	127.30
1	BONNET INSULATOR	NOT NECESSARY	230.10	-
1	BONNET INSULATOR CLIPS	NOT NECESSARY	15.00	-
1	RADIATOR GRILLE EMBLEM	CUT	88.00	88.00
1	RADIATOR GRILLE	BROKEN	1,409.10	1,409.10
2	FLAP ASSY ACTIVE AIR UPPER (LH/RH) @\$824.60	BROKEN	1,649.20	1,649.20
1	SPEAKER ASSY -VESS	NOT NECESSARY	554.40	-
1	UNIT ASSY -SMART CRU (RADAR SENSOR)	BRACKET BENT	3,061.40	3,061.40
1	FLAP ASSY ACTIVE WIRE	NOT NECESSARY	765.30	-
1	FRONT NUMBER PLATE GARNISH	NOT NECESSARY	188.00	-
1	FRONT BUMPER COVER	TORN	481.10	481.10
1	FRONT BUMPER TOP COVER	BROKEN	476.30	476.30
1	FRONT BUMPER SPONGE	TORN	186.90	186.90
1	FRONT BUMPER REINFORCEMENT	DENTED	1,136.70	1,136.70
2	FRONT BUMPER REINFORCEMENT ABSORBER (LH/RH) @\$186.50	NOT NECESSARY	373.00	-
1	FRONT BUMPER TOWING COVER	MTG DEFORMED	29.00	29.00
1	FRONT BUMPER MOULDING CENTRE UPPER	CUT / DEFORMED	368.50	368.50
1	FRONT BUMPER MOULDING	NOT NECESSARY	93.60	-
1	FRONT BUMPER LOWER STIFFNER	NOT NECESSARY	285.10	-
1	FRONT BUMPER LOWER GRILLE	MTG BROKEN	365.30	365.30
1	FRONT BUMPER LOWER GRILLE MOULDING	NOT NECESSARY	127.60	-
1	FRONT BUMPER LIP	NOT NECESSARY	35.10	-
2	FRONT BUMPER BRACKET TOP (LH/RH) @\$35.00	NOT NECESSARY	70.00	-
2	FRONT BUMPER BRACKET (LH/RH) @\$28.00	BROKEN	56.00	56.00
2	FRONT BUMPER RETAINER MOUNTING (LH/RH) @\$65.30	NOT NECESSARY	130.60	-
10	FRONT BUMPER CLIPS	NECESSARY	25.00	25.00

Report Ref No. CD/CTI24100224/Dpa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	FRONT BUMPER GRILLE (LH/RH) @\$186.90	SERVICEABLE	373.80	-
2	FRONT BUMPER AIR DUCT (LH/RH) @\$153.80	NOT NECESSARY	307.60	-
1	DAY LIGHT ,LH	NOT NECESSARY	642.50	-
1	DAY LIGHT ,RH	MTG BROKEN	642.50	642.50
1	DAY LIGHT WIRE	NOT NECESSARY	585.50	-
1	BUZZER ASSY PIEZO (LH)	NOT NECESSARY	388.00	-
1	HEADLAMP SUPPORT PANEL ASSY	BROKEN	1,139.30	1,139.30
2	HEADLAMP (LH/RH) @\$3987.30	MTG BROKEN	7,974.60	7,974.60
2	HORN UNIT (LH/RH) @\$72.80	NOT NECESSARY	145.60	-
1	HORN WIRE	NOT NECESSARY	386.70	-
1	RADIATOR INVERTER	BENT	884.80	884.80
1	RADIATOR	BENT	710.50	710.50
1	RADIATOR FAN BLOWER MOTOR ASSY	NOT NECESSARY	1,459.60	-
2	RADIATOR AIR GUARD (LH/RH) @\$76.40	NOT NECESSARY	152.80	-
2	RADIATOR AIR GUARD UPR (LH/RH) @\$127.50	NOT NECESSARY	255.00	-
2	FRONT FENDER (LH/RH) @\$490.70	TO REPAIR SEE LABOUR	981.40	-
2	FRONT FENDER APRON PANEL (LH/RH) @\$756.20	NOT NECESSARY	1,512.40	-
2	FRONT FENDER APRON PANEL UPPER (LH/RH) @\$329.00	NOT NECESSARY	658.00	-
2	FRONT FENDER SHIELD (LH/RH) @\$164.70	NOT NECESSARY	329.40	-
1	AIRCON CONDENSER	BENT	663.60	663.60
1	WIPER CONTAINER ASSY	NOT NECESSARY	385.40	-
	LESS 20% DISCOUNT		-7,087.84	-4,342.50
			28,351.36	17,370.00
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT NUMBER PLATE (SN) }	BROKEN	25.00	45.00
1	FRONT NO PLATE TRIM COVER (SN) }	DEFORMED	30.00	-
1	COOLANT (SN)	NOT NECESSARY	45.00	-
2	EMBLEM -BLUE DRIVE (LH/RH) @\$26.60 (SN)	SERVICEABLE	53.20	-
			153.20	45.00

Report Ref No. CD/CTI24100224/Dpa3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	PANEL BEATING.INCLUSIVE OF THE REPAIR OF BONNET AND FRONT FENDER (LH/RH).		1,600.00	800.00
	SPRAY PAINTING CHARGE.		1,400.00	800.00
	WIRING CHARGE.		100.00	30.00
	TUFF KOTE.		100.00	20.00
	TOWING CHARGE.	NOT NECESSARY	80.00	-
	REMOVE/REFIX RADIATOR .		90.00	50.00
	REMOVE/REFIX AIRCON & REFILL GAS.		130.00	80.00
	DIAGNOSTIC & RESETTING TO ERASE FAULT CODE. }		550.00	150.00
	DIAGNOSTIC & RESETTING ADAS OPTICAL SENSOR .}		550.00	-
			4,600.00	1,930.00
	GRAND TOTAL		33,104.56	19,345.00
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			15,400.00

Report Ref No. CD/CTI24100224/Dpa3q2(N)

ANG BRYAN TANI

Automotive Assessor / Investigator


DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z

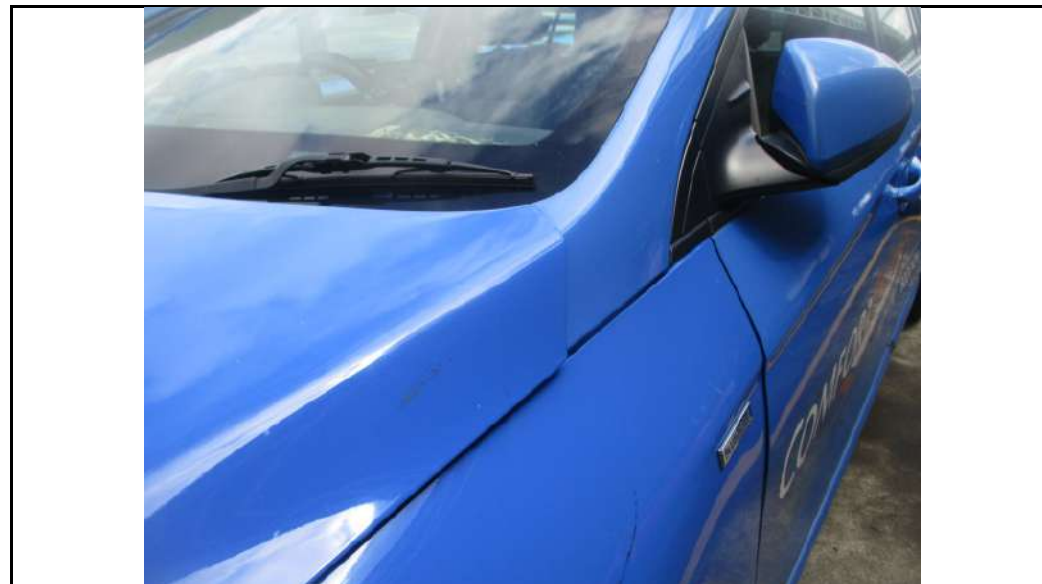

PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 4 of 16)

PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z




PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z




PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z

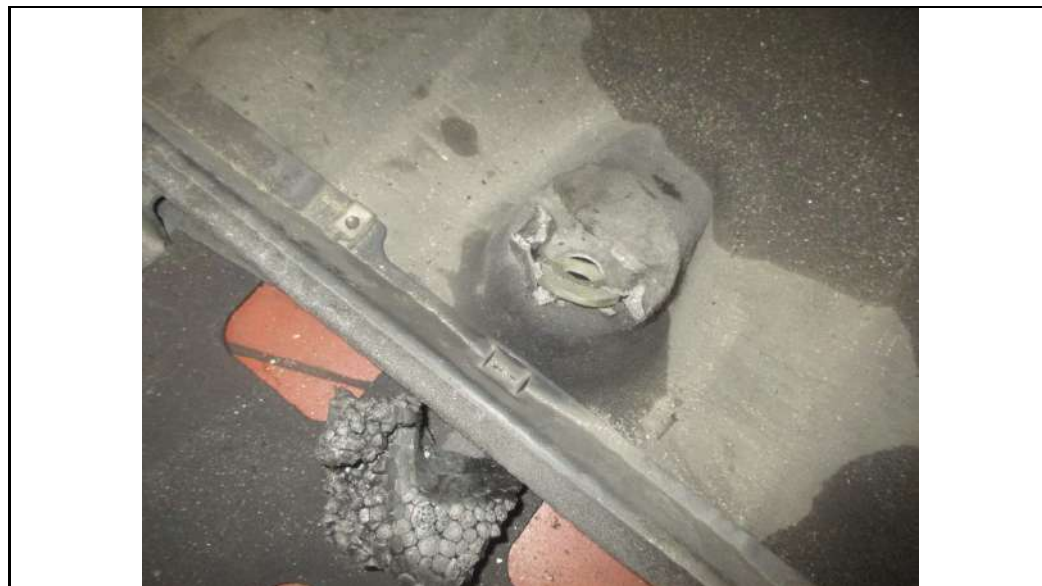

PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z

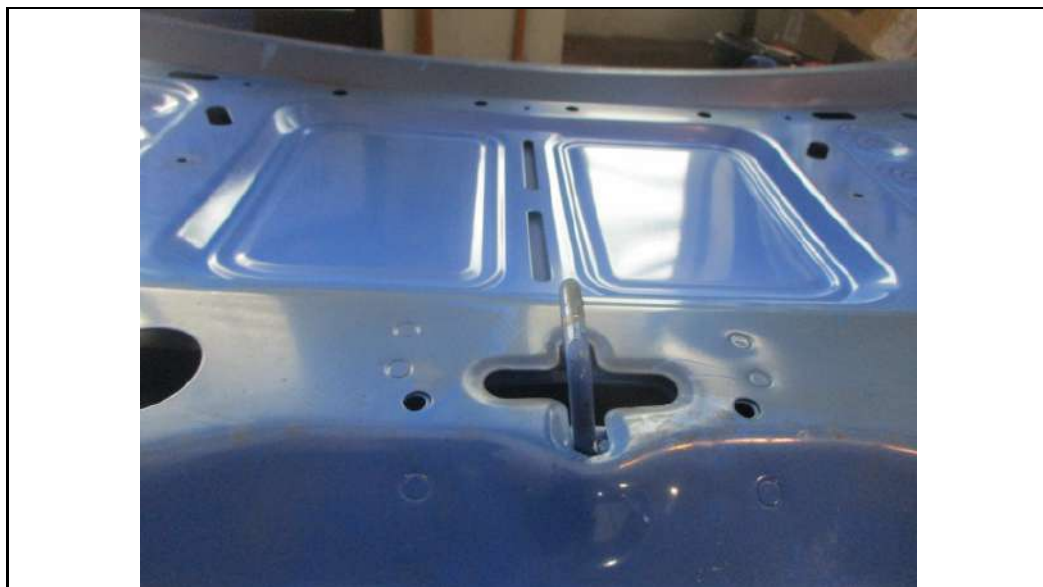

PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z



PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SHC 1012Z

