PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com, Mobile: 90610543

ACCIDENT VEHICLE INSPECTION REPORT

 Report no
 : 359M1024.SSH

 Vehicle no
 : SJD3383K

1 REFERENCE

Date of inspection : 11 October 2024
Requested by : Sierra Facade Pte Ltd

c/o Blk 3023A Ubi Road 1

#01-63

Singapore 408717

Type of survey : Independent

Repairer : Sin Seng Hong Spray Painting & Services

Blk 3023A Ubi Road 1, #01-63 Singapore 408717

Date of accident : 10 October 2024

2 VEHICLE DATA

Make/model : MERCEDES BENZ B200
Chassis no : WDD2452332J220971
Engine no : 26696030346678
Date of registration : 26 December 2007

Engine capacity : 2035 cc
Odometer Reading : 146026 km
Colour : Maroon

3 STATIC CONDITION CHECK

Steering : Serviceable
Foot brakes : Serviceable
Hand brakes : Serviceable
Paintwork : Good
General Condition : Good

4 TIRE CONDITION CHECK RH/MAKE LH/MAKE SIZE

Front tread : 5 mm/Westlake 5 mm/Westlake 215/45ZR17
Rear tread : 5 mm/Continental 5 mm/Continental 215/45ZR17

5 BRIEF DESCRIPTION OF DAMAGE

Rear windscreen glas shattered, rear boot lid dented/bent/distorted, rear bumper dented/squashed/ rear end panel, etc. Please see para. 8 of this report for more details.

6 REMARKS

This inspection is carried out on a "WITHOUT PREJUDICE" basis and we have not authorized any repairs.

7 RECOMMENDATION

Cost of repairs : \$7,100.00 (lump sum)

No. of days taken : <u>Three (3)</u>

8 ASSESSMENT OF DAMAGE AND COSTS

 Report no:
 359M1024.SSH

 Vehicle no:
 SJD3383K

<u>A</u>	SPARE PARTS		Assessed		Repairer's	Revised
	<u>Description</u>	<u>Qty</u>	Condition		<u>Amount</u>	<u>Amount</u>
	Rear windscreen glass	1	shattered		1,995.00	1,995.00
	Rear boot lid	1	dented/bent/distorted		2,135.00	2,135.00
	Rear boot lid lock assy	1	bent/distorted		215.00	215.00
	Rear boot lid 'B200' emblem	1	necessary		84.00	84.00
	Rear boot lid Mercedes benz logo	1	necessary		55.00	55.00
	Rear boot lid outer chrome garnish	1	cracked		310.00	310.00
	Rear boot lid glass inner side garnish LH/RH	2	bent/cut/deformed		430.00	430.00
	Rear boot weatherstrip	1	to reuse		205.00	0.00
	LH tail light assy	1	cracked		420.00	420.00
	Rear bumper	1	dented/sqaushed/deformed		1,162.00	1,162.00
	Rear bumper reinforcement	1	dented/bent/distorted		510.00	510.00
	Rear bumper side retainer LH	1	broken		65.00	65.00
	Rear bumper side retainer RH	1	necessary		65.00	65.00
	Rear bumper clip	10	necessary		30.00	30.00
	Rear end panel	1	to repair	_	1,100.00	0.00
			Subtotal of the above		8,781.00	7,476.00
			Discount 10%/	10%	878.10	747.60
	(Special nett)					
	Rear windscreen gum	1	necessary		80.00	80.00
	Rear windscreen glass inner seal	1	necessary		50.00	50.00
	Rear windscreen glass spacers/clips set	1	necessary		60.00	60.00
	Reevrse sensor set	1	dented/shorted	_	280.00	280.00
			Total cost of parts:	-	8,372.90	7,198.40
В	LABOUR		rotal cost of partor	=	3,07,2.00	7,200110
_	To remove and replace, to cut and weld, to panel beat and straighten damaged parts and body panels.					500.00
			1,000.00			
	To putty and spray paint the affected portion and parts					750.00
	To apply anti-rust undercoating.				120.00	60.00
	To remove broken glass and shard and install		200.00	150.00		
	To remove and replace reverse sensors and cl	90.00	60.00			
	To check wiring.				60.00	45.00
	Total cost of labour:			=	2,220.00	1,565.00
			Total cost of repair:	-	10,592.90	8,763.40

 Report no:
 359M1024.SSH

 Vehicle no:
 SJD3383K

9 CONCLUSION

The revised or adjusted cost of repairs to restore the vehicle is

\$8,763.40

(a) The recommended cost of repair based on lump sum repairs would be

\$7,100.00

(b) The estimated number of days for the repairs would be

(1st Reinspection conducted on 15 October 2024) (Post Repair Inspection conducted on 15 October 2024) Three (3)

Note: Lump Sum Repair Basis

Prepared by:

Liaw Leong San

Licensed Automotive Appraiser

PRO-OPTION SERVICES

Mailing address: Blk 189B Rivervale Drive, #04-1004, Singapore 542189

Email: mirage1195@gmail.com, Mobile: 90610543

Sierra Facade Pte Ltd c/o Blk 3023A Ubi Road 1 #01-63 Singapore 408717

INVOICE

Invoice no:	POS0359/24	
Date:	17 October 2024	
Report no:	359M1024.SSH	
Vehicle :	SJD3383K	

No	Item Description	Qty	Unit Price	Total Amount (\$)
01	Item Description Being charges for the inspection of the accident vehicle, transport and photographs.		Unit Price	Total Amount (\$) 726.00
SGD(\$):	Seven Hundred and Twenty-six only		Grand Total:	726.00

PRO-OPTION SERVICES
3
Authorised Signature









Page 1 of 26

Report No: 359M1024.SSH

Vehicle no: SJD3383K









Page 2 of 26









Page 3 of 26









Page 4 of 26



Page 5 of 26









Page 6 of 26