



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2504288

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 08/07/2025
Reference CD/CTI24100373/Aua3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SGS 1188C
Insured Veh. SNM 6967L
Claim No. SNM24D205910
Policy No. DMHCSNA0003412400
Accident Date 18/10/2024
Inspection Date 18/10/2024

Description	Total
Survey Inspection	280.00
Resurvey Inspection	
Digital Photographs	
Transportation	
Subtotal	280.00
GST (9%)	25.20
Grand Total	305.20

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to 'LKK Auto Consultants Pte Ltd'

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CD/CTI24100373/Aua3q2(N)	
			Date: 08/07/2025	
			Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SNM 6967L	Veh. Inspected	SGS 1188C
	Policy No.	DMHCSNA0003412400	Coverage (\$)	0.00
	Claim No.	SNM24D205910	Excess (\$)	0.00
	Assign From		Assign Date	18/10/2024
2. Vehicle Particulars & Condition				
	Make & Model	B.M.W. 740LI	c.c	2998
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	WBA7E22000G651237	Colour	BLACK
	Odometer	183027 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	SPORTS RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	275/40 R19	PIRELLI	6 mm
	L/H Front Tyre	275/40 R19	PIRELLI	6 mm
	R/H Rear Tyre	275/40 R19	PIRELLI	6 mm
	L/H Rear Tyre	275/40 R19	PIRELLI	6 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	18/10/2024	Inspection Date	18/10/2024
	Survey held at	ADVANCE AUTO GARAGE 1 KAKI BUKIT AVENUE 6, #01-73 KAKI BUKIT AUTOBAY BLK D, SINGAPORE 417883		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SGS 1188C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	FRONT FENDER	TO REPAIR SEE LABOUR	1,089.00	-
1	FRONT FENDER INNER SHIELD	NOT NECESSARY	288.00	-
1	FRONT DOOR	DENTED	2,539.00	2,539.00
1	FRONT DOOR LOCK	NOT NECESSARY	498.00	-
1	FRONT DOOR WEATHERSTRIPE	NECESSARY	320.00	320.00
1	FRONT DOOR LOWER PROTECTOR	NECESSARY	198.00	198.00
1	FRONT DOOR WING MIRROR	DAMAGED	1,241.00	1,241.00
1	FRONT DOOR WING MIRROR COVER	DAMAGED	119.00	119.00
1	FRONT DOOR WING MIRROR (SIGNAL LAMP)	NOT NECESSARY	132.00	-
1	FRONT DOOR WING MIRROR GLASS	NOT NECESSARY	585.00	-
1	REAR DOOR	PUNCTURE	2,698.00	2,698.00
1	REAR DOOR LOCK	NOT NECESSARY	489.00	-
1	REAR DOOR WEATHERSTRIPE	NECESSARY	341.00	341.00
1	REAR DOOR LOWER PROTECTOR	NECESSARY	190.00	190.00
1	ROCKER PANEL OUTER SKIRTING	DEFORMED	890.00	890.00
1	ROCKER PANEL OUTER SKIRTING BRACKET	CRACKED	165.00	165.00
1	REAR FENDER	TO REPAIR SEE LABOUR	3,391.00	-
1	REAR WINDSCREEN C/W MOULDING	NOT NECESSARY	1,840.00	-
1	REAR BUMPER	TORN	1,858.00	1,858.00
1	REAR BUMPER SIDE HOLDER	NOT NECESSARY	169.00	-
1	REAR SHOCK ABSORBER	NOT NECESSARY	6,852.00	-
1	REAR LOWER ARM	NOT NECESSARY	896.00	-
1	REAR CONTROL ARM	NOT NECESSARY	865.00	-
1	REAR KNUCKLE ARM	NOT NECESSARY	1,755.00	-
1	REAR WHEEL HUB	NOT NECESSARY	385.00	-
1	REAR WHEEL HUB BEARING	NOT NECESSARY	288.00	-
	LESS 5% DISCOUNT		-1,504.05	-
	LESS 10% DISCOUNT		-	-1,055.90
			28,576.95	9,503.10

Report Ref No. CD/CTI24100373/Aua3q2(N)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	REAR WHEEL RIM (SN)	CUT	1,850.00	600.00
	LESS 5% DISCOUNT		-92.50	-
			1,757.50	600.00
	<u>SPECIAL NETT ITEMS</u>			
1	SET FRONT FENDER INNER SHIELD CLIPS (SN)	NOT NECESSARY	30.00	-
1	SET ROCKER PANEL OUTER SKIRTING CLIPS (SN)	NECESSARY	50.00	50.00
1	REAR WINDSCREEN SEALANT (SN)	NOT NECESSARY	60.00	-
1	REAR TYRE (SN)	NOT NECESSARY	450.00	-
1	SET REAR BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
			640.00	100.00
	<u>LABOUR</u>			
	PANEL BEATING ,REMOVE AND REFIT PARTS.INCLUSIVE OF THE REPAIR OF REAR FENDER AND FRONT FENDER.		1,600.00	800.00
	SPRAY PAINTING TO AFFECTED AREA.		1,600.00	1,000.00
	WIRING CHECK .		100.00	30.00
	TO APPLY TUFF COAT.		150.00	40.00
	TO REMOVE REVERSE SENSOR .		100.00	50.00
	TO TRANSFER FRONT & REAR DOOR FITTINGS .		300.00	120.00
	TO REMOVE REAR WINDSCREEN.	NOT NECESSARY	180.00	-
	TO REMOVE UPHOLSTERY .	NOT NECESSARY	150.00	-
	TO DISMANTLE REAR UNDERCARRIAGE.	NOT NECESSARY	380.00	-
	TO PERFORM WHEEL ALIGNMENT.		150.00	80.00
	TO PERFORM DIAGNOSTIC TEST.		250.00	120.00
			4,960.00	2,240.00
GRAND TOTAL			35,934.45	12,443.10

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			9,900.00
---	--	--	-----------------

Report Ref No. CD/CTI24100373/Aua3q2(N)

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.




LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 1 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C

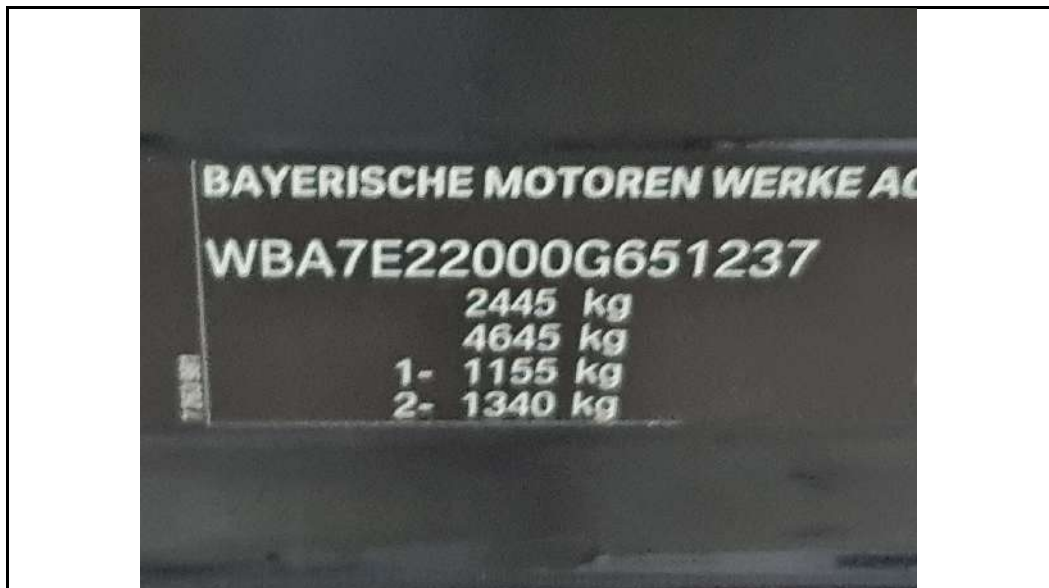



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 2 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 4 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 9 of 12)


PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C

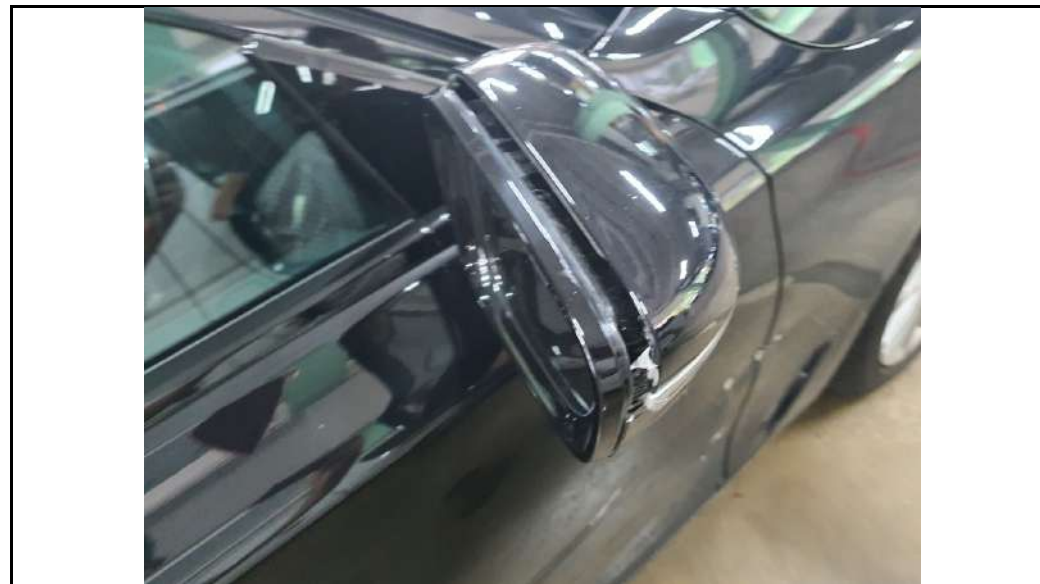



LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 12 of 12)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C

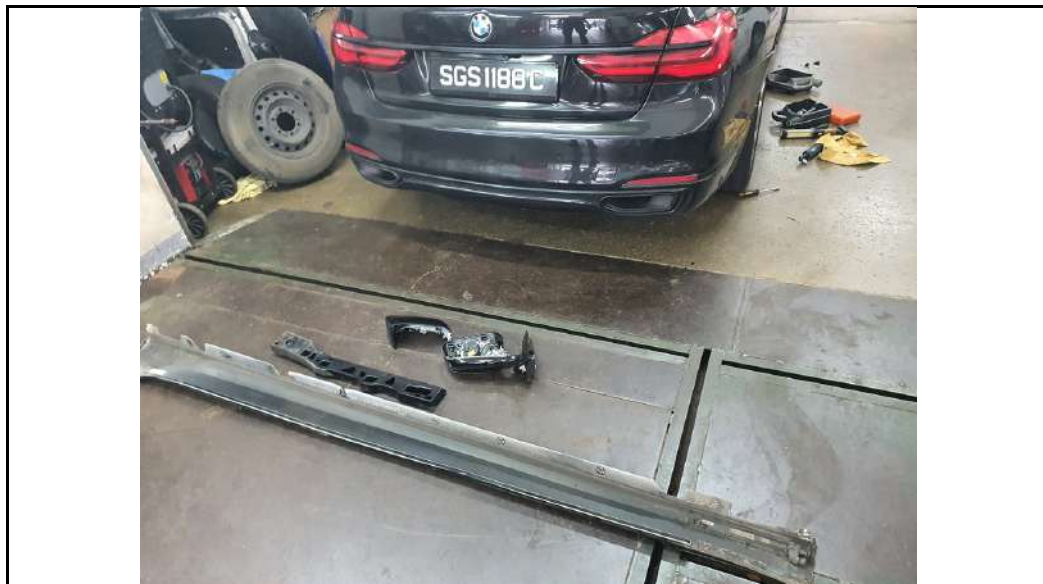

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315


Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 7 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C

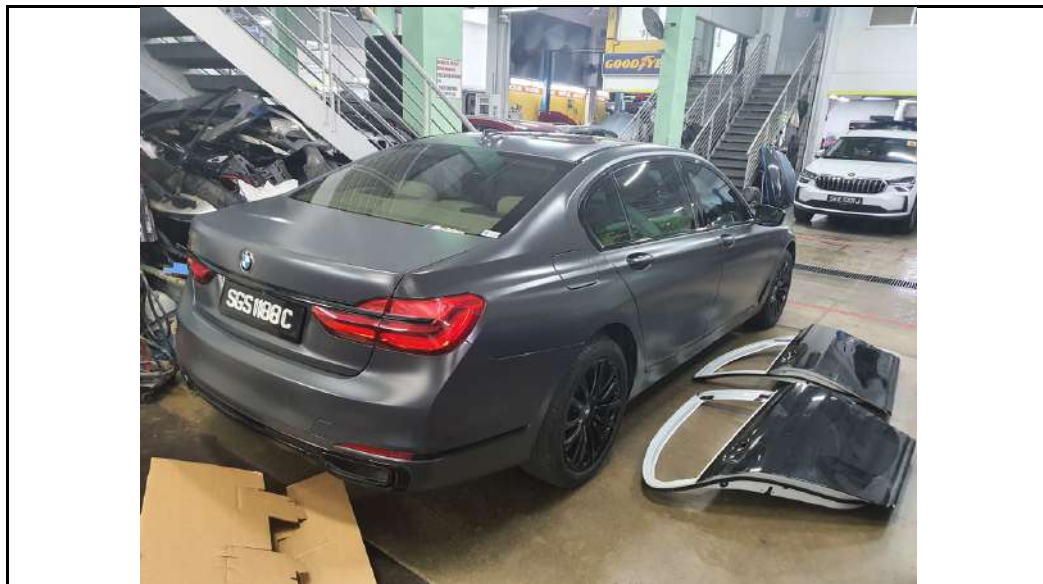



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 2 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C



PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 4 of 4)

PHOTOGRAPHS FOR VEHICLE NO. : SGS 1188C

