

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/ICS24100479/EVP3M4**Date:** 06/11/2024**REFERENCE**

Handling Insurer: ECICS Limited Policy No:
Claimant Vehicle No : SHD3070L **Insured Vehicle No :** YQ4767J
Date of Loss: 22/10/2024 Nature of Claim: TP Claim No: DMCV2400236H/02/CT

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SHD3070L**
Make & Model: BYD E6 (ME-2), (A) Engine No: HIDDEN
Reg. Date: 31/05/2022 (Man. Year: 2022) Chassis No: LC0CE4DC2N0011542
Colour: Blue Odometer: 212265 km
Engine Capacity: 0 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/55R17 Rear Tyre Size: 215/55R17
Front Left Side: DURATURN 6 mm Rear Left Side: DURATURN 6 mm
Front Right Side: DURATURN 6 mm Rear Right Side: DURATURN 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	2,856.80	468.00	2,388.80	83.62
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,450.00	900.00	550.00	37.93
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,306.80	1,368.00	2,938.80	68.24
+ GST 9.00/9.00% (S\$)	387.61	123.12	264.49	68.24
Nett Amount (S\$)	4,694.41	1,491.12	3,203.29	68.24

INSPECTION

Date of Assignment: 25/10/2024
Date Inspected: 25/10/2024 Inspected At: COMFORTDELGRO ENGINEERING PTE LTD (LOYANG)
59 LOYANG DRIVE
SINGAPORE 508969
Estimated Period of Repair: 2.0 days

Adjuster: CHEN TSUE YEE**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 06 Nov 2024)
Parts:	M1-MPV	BYD E6 (ME-2) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHD3070L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT HATCH ASSEMBLY	Repair	1,976.00 FL	*- FL
2	1		*FRONT GRILLE ASSEMBLY	Cracked	585.00 FL	*585.00 FL
3	1		*FRONT BUMPER BODY ASSY	Not Necessary	1,010.00 FL	*- FL
						F=Franchise part. L=ListItemDisc.
					Sub Total (S\$)	3,571.00 585.00
					- List Item Discount on L Items 20.00/20.00% (S\$)	714.20 117.00
					Total Parts (S\$)	2,856.80 468.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	500.00	450.00
2	SPRAY PAINTING CHARGE	New	950.00	450.00
Gross Labour Cost (S\$)			1,450.00	900.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >