

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CD/III24060243/RMA3Q2

Date: 03/09/2024

REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D20MFL0004773_03

Claimant Vehicle No : SBS6323E Insured Vehicle No : PZ166D

Date of Loss: 25/06/2024 Nature of Claim: TP Claim No: MFL2024D0007557

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SBS6323E

Make & Model: MERCEDES-BENZ CITARO O530, 6.4 D (A) Engine No: 90292600943259

Reg. Date: 02/11/2012 (Man. Year: 2012) Chassis No: WEB62808323123803

Colour: Green Odometer: 721772 km

Engine Capacity: 6374 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 275/70 R22.5 Rear Tyre Size: 275/70 R22.5 (D)

Front Left Side: Bridgestone 8 mm Rear Left Side: Bridgestone 8/8 mm

Front Right Side: Bridgestone 8 mm Rear Right Side: Bridgestone 8/8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	7,827.44	7,827.44	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	7,780.00	3,880.00	3,900.00	50.13
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	15,607.44	11,707.44	3,900.00	24.99
+ GST 9.00/9.00% (S\$)	1,404.67	1,053.67	351.00	24.99
Nett Amount (S\$)	17,012.11	12,761.11	4,251.00	24.99
+ Loss of Use (6.0 x S\$250.00/day) (S\$)		1,500.00		
Nett Liability (S\$)		14,261.11		

INSPECTION

Date of Assignment: 26/06/2024

Date Inspected: 26/06/2024 Inspected At: Tower Transit Singapore Pte Ltd (HQ)
21 Bulim Drive, Bulim Bus Depot
Singapore 648170

Estimated Period of Repair: 5.0 days

Adjuster: MOHD RASUL

Manager: Daphne Lee Mooi Ngiuk

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 29 Jul 2024)	
Parts:	N/A	MERCEDES-BENZ CITARO O530 6.4 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SBS6323E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT WINDSHIELD GLASS	Broken	2,970.00 F	*2,970.00 F
2	1		*FRONT FLAP	Cracked	1,892.46 F	*1,892.46 F
3	1		*WIPER LINKAGE	Bent	1,255.32 F	*1,255.32 F
4	1		*OS/RH HEADLAMP	Cracked	643.54 F	*643.54 F
5	1		*COMPANY SIGN LOGO CITARO	Necessary	272.12 F	*272.12 F
6	1		*OS SIGNAL LIGHT	Cracked	114.84 F	*114.84 F
7	1		*OS EXTENSION COVERING	Cracked	470.16 F	*470.16 F
8	1		*TOWER TRANSIT LOGO	Necessary	33.00 F	*33.00 F
9	1		*SIKAFLEX BLACK	Necessary	176.00 F	*176.00 F
				Total Parts (S\$)	7,827.44	7,827.44

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE & REPLACE: DISMANTLE AND REPLACE ITM NO :1-8 }	New	5,200.00	2,600.00
2	TO REMOVE & INSTALL PARTS SO TO PERFORM REPAIR WORKS : FORNT BUMPER ,FRONT FLAP }	New	1,300.00	0.00
3	SPRAY PAINTING : FRONT BUMPER ,FRONT FLAP	New	1,280.00	1,280.00
Gross Labour Cost (\$\$)			7,780.00	3,880.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >