

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

ECICS Limited
10 Eunos Road 8, #09-04A Singapore Post Centre
Singapore 408600

Our File No: CS/ICS24060246/TQP3M4
Date: 02/10/2024

REFERENCE

Insured/Claimant: SIM AI LING Policy No: MPC24A00047000
Date of Loss: 11/06/2024 Nature of Claim: OD Claim No: DMPC2400731H/ST

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SJL1155Z
Make & Model: MAZDA CX-5, 2.0 PREMIUM EU6 (A) Engine No: PE31160850
Reg. Date: 26/01/2018 (Man. Year: 2017) Chassis No: JM6KF2W7AJ0146390
Colour: Grey Odometer: 105118 km
Engine Capacity: 1998 cc
Market Value/New Car Price: S\$78,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/45R19 Rear Tyre Size: 245/45R19
Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm
Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,154.00	5,940.00	5,214.00	46.75
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,940.00	1,010.00	2,930.00	74.37
Paintwork Labour	440.00	400.00	40.00	9.09
Towing	80.00	0.00	80.00	100.00
Calculated Gross Total (S\$)	15,614.00	7,350.00	8,264.00	52.93
Approved Total (Overridden) (S\$)		5,850.00		
- Excess (S\$)	500.00	0.00	500.00	100.00
(S\$)	15,114.00	5,850.00	9,264.00	61.29
+ GST 9.00/9.00% (S\$)	1,360.27	526.50	833.77	61.29
Nett Amount (S\$)	16,474.27	6,376.50	10,097.77	61.29

INSPECTION

Date of Assignment: 25/06/2024 Present Location: Convergence Automotive Pte Ltd (HQ)
CONVERGENCE AUTOMOTIVE PTE LTD
Date Inspected: 25/06/2024 Inspected At: 39 WOODLANDS CLOSE
#01-24 MEGA@WOODLANDS
SINGAPORE 737856
Estimated Period of Repair: 7.0 days

Adjuster: MOHD TAUFIKH BIN HAMID

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 02 Oct 2024)
Parts:	M1-SUV	MAZDA CX-5 2.0 PREMIUM EU6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJL1155Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*RR BUMPER (WCP)	Repair	650.00 F	*- F
2	1		*RR TAILGATE (WCP)	Not Necessary	1,200.00 F	*- F
3	1		*LOWER ARM (WCP)	Bent	280.00 F	*200.00 F
4	1		*KNUCKLE ARM (WCP)	Bent	180.00 F	*180.00 F
5	1		*WHEEL BEARING (WCP)	Bent	240.00 F	*150.00 F
6	1		*RACK END (WCP)	Bent	80.00 F	*80.00 F
7	1		*ABSORBER LINKAGE (WCP)	Bent	45.00 F	*45.00 F
8	1		*TIE ROD END (WCP)	Bent	80.00 F	*50.00 F
9	2		*AIR BAG (WCP)	Activated	3,600.00 F	*2,600.00 F
10	2		*AIR BAG ECU (WCP)	Activated	1,500.00 F	*900.00 F
11	1		*RIM (WCP)	Dented	200.00 F	*200.00 F
Supplementary #1						
12	2		*ABSORBER (WCP)	Bent	380.00 F	*190.00 F
13	2		*ABSORBER MOUNTING (WCP)	Bent	220.00 F	*110.00 F
14	2		*ABSORBER STOPPER (WCP)	Necessary	80.00 F	*40.00 F
15	1		*FENDER INNER SHIELD RR LH FRT (WCP)	Deformed	85.00 F	*85.00 F
16	1		*FENDER INNER SHIELD RR LH BACK (WCP)	Deformed	30.00 F	*30.00 F
17	1		*RR LH LOWER CONTROL ARM (WCP)	Bent	150.00 F	*100.00 F
18	1		*RR LH LOWER LATERAL LINK CONTROL ARM (WCP)	Bent	100.00 F	*80.00 F
19	1		*TAIL LAMP LH (WCP)	Cracked	650.00 F	*250.00 F
20	1		*RR LH WHEEL ARCH MOULDING (WCP)	Distorted	110.00 F	*110.00 F
21	1		*RIM (WCP)	Repeated	280.00 F	*- F

F=Franchise part.

Sub Total (\$\$)	10,140.00	5,400.00
+ Margin on L,N Items 10.00/10.00% (\$\$)	1,014.00	540.00
Total Parts (\$\$)	11,154.00	5,940.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	SPRAY PAINT	New	440.00	400.00
<u>Labour Items</u>				
2	VEHICLE REPAIR COST	New	2,240.00	600.00
3	WIRING + CODING	New	1,500.00	250.00
4	ALIGNMENT	New	100.00	80.00
<u>Supplementary #1</u>				
<u>Labour Items</u>				
5	ALIGNMENT	New	100.00	80.00
Gross Labour Cost (\$\$)			4,380.00	1,410.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >