



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

MS FIRST CAPITAL INSURANCE LTD

INV No. AC2503257

16 RAFFLES QUAY
#42-01 HONG LEONG BUILDING
SINGAPORE 048581
ATTN:JOANNE YONG

INV Date 26/05/2025
Reference CD/FCI24110082/Uma3q2
Code FCI2

PROFESSIONAL SERVICE FEE

Vehicle No. FBJ 761K
Insured Veh. SHC 2166G
Claim No. D24009132MFCT/CTPL/TPD 2
Policy No. D-24101861MFCT
Accident Date 13/10/2024
Inspection Date 06/11/2024

Description	Total
Third Party Express Settlement	300.00
Subtotal	300.00
GST (9%)	27.00
Grand Total	327.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDINGSINGAPORE 048581 ATTN:JOANNE YONG			Ref: CD/FCI24110082/Uma3q2(N) Date: 26/05/2025 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHC 2166G	Veh. Inspected	FBJ 761K
	Policy No.	D-24101861MFCT	Coverage (\$)	0.00
	Claim No.	D24009132MFCT/CTPL/TPD 2	Excess (\$)	0.00
	Assign From	JOANNE YONG	Assign Date	06/11/2024
2. Vehicle Particulars & Condition				
	Make & Model	SYM COMBIZ 125	c.c	125
	Engine No.	HIDDEN	Year of Reg.	2013
	Chassis No.	RFGAPA301DS001312	Colour	GREY
	Odometer	25578 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	FAIR		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	120-70-10	MICHELIN	5 mm
	L/H Front Tyre			mm
	R/H Rear Tyre	120-70-10	MICHELIN	5 mm
	L/H Rear Tyre			mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S & N/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	13/10/2024	Inspection Date	06/11/2024
	Survey held at	KIVILE ENTERPRISE BLK 3007 #01-408 UBI ROAD 1 SINGAPORE 408701 (MOTORCYCLE ONLY)		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. FBJ 761K

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	HANDLE BAR	BENT	155.00	155.00
1	SET MIRROR	CUT	95.00	95.00
1	SET LEVER	CUT	88.00	88.00
1	SET COVER	CRACKED	780.00	780.00
1	HEADLIGHT	SERVICEABLE	360.00	-
1	FRONT GARNISH	CUT	165.00	165.00
1	FRONT PANEL	CRACKED	165.00	165.00
1	SEAT BAR	TO REPAIR SEE LABOUR	125.00	-
1	AIR BOX	CUT	125.00	125.00
1	HP HOLDER	CUT	65.00	65.00
1	HELMET	TO REPAIR SEE LABOUR	60.00	-
1	STEERING CONE	NOT NECESSARY	180.00	-
	LESS 10% DISCOUNT		-	-163.80
			2,363.00	1,474.20
	<u>LABOUR</u>			
	FORK ALIGNMENT.		360.00	50.00
	LABOUR.INCLUSIVE OF THE REPAIR OF SEAT BAR AND HELMET.		450.00	300.00
	TOWING.		60.00	60.00
			870.00	410.00
GRAND TOTAL			3,233.00	1,884.20
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				1,500.00

Report Ref No. CD/FC124110082/Uma3q2(N)

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.

PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K



PHOTOGRAPHS FOR VEHICLE NO. : FBJ 761K

