



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO GBK 6237M

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	FRONT RH SIDE PANEL	CRACKED	\$451.70	\$451.70
1	FRONT RH HEADLAMP	MTG CRACKED	\$438.40	\$438.40
1	FRONT BUMPER	BENT	\$602.90	\$602.90
1	FRONT BUMPER SIDE RETAINER	MISSING	\$47.80	\$47.80
1	FRONT RH WHEEL COVER	DENTED	\$162.70	\$162.70
1	FRONT SHOCK ABSORBER RH	BENT	\$288.50	\$288.50
1	FRONT SHOCK ABSORBER MOUNTING RH	BENT	\$68.20	\$68.20
1	FRONT LOWER ARM RH	BENT	\$231.20	\$231.20
1	FRONT DRIVER SHAFT RH	TO REPAIR SEE LABOUR	\$996.10	\$0.00
1	FRONT STEERING RACK	TO REPAIR SEE LABOUR	\$1,801.50	\$0.00
1	FRONT ANTI ROLL BAR	SERVICEABLE	\$394.20	\$0.00
1	FRONT ANTI ROLL BAR LINKAGE RH	SERVICEABLE	\$40.80	\$0.00
1	CROSSMEMBER	SERVICEABLE	\$355.30	\$0.00
1	FRONT FENDER	BENT	\$617.50	\$617.50
1	FRONT FENDER INNER SHILED	SERVICEABLE	\$144.40	\$0.00
	<b>LESS 10.00% DISCOUNT</b>		(\$664.12)	(\$290.89)
			<b>\$5,977.08</b>	<b>\$2,618.01</b>

Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	RIM (LOCAL PURCHASE) (SN)	DENTED	\$1,368.00	\$60.00
1	SET FRONT BUMPER CLIPS (SN)	NECESSARY	\$50.00	\$20.00
1	SET FRONT FENDER INNER SHIELD RH CLIPS (SN)	NECESSARY	\$50.00	\$20.00
1	TYRE (\$250) (80%) (SN)	PUNCTURE	\$350.00	\$200.00
			<b>\$1,818.00</b>	<b>\$300.00</b>

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	SPRAY PAINT ON ALL AFFECTED AREA		\$1,000.00	\$350.00
	LABOUR REMOVE/REFIX ACCIDENT DAMAGE PARTS TO KNOCK, JACK, CUT WELD AND REALIGN ACCIDENT AFFECTED AREA. INCLUSIVE OF THE REPAIR OF FRONT DRIVER SHAFT RH AND FRONT STEERING RACK		\$1,000.00	\$500.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

Labour			
Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
TO CHECK WIRING SYSTEM & LIGHT	NOT NECESSARY	\$100.00	\$20.00
TO APPLY ANTI RUST TREATMENT		\$120.00	\$0.00
TO REMOVE/REPLACE/REFIX/ FRONT RH & TYRE & RIM, UNDERCARRIAGE REPLACEMENT	NOT NECESSARY	\$380.00	\$200.00
TO CHECK & ADJUST WHEEL ALIGNMENT		\$100.00	\$0.00
		\$2,700.00	\$1,070.00
<b>GRAND TOTAL</b>		<b>\$10,495.08</b>	<b>\$3,988.01</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>			<b>\$3,150.00</b>
Report Ref No: CS/LIP24110175/Kqh3m4			

**MARKET VALUE: \$53,000.00 (EST)-LTA REIMBURSEMENT VALUE: \$13,164.00=NETT VALUE: \$39,836.00**

## KSC

KENNETH KONG SENG CHEONG

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.