

VEHICLE DAMAGE INSPECTION REPORT

ECICS Limited
10 Eunost Road 8, #09-04A Singapore Post Centre
Singapore 408600

Our File No: CS/ICS24110186/KVP3M4
Date: 30/04/2025

REFERENCE

Insured/Claimant: MUHAMMED FAIROL BIN ABDULLAH Policy No: MPU24B00022900
Date of Loss: 29/10/2024 Nature of Claim: OD Claim No: DMPU2400066H/ST/LLA

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SNL4789C
Make & Model: TOYOTA NOAH HYBRID, 1.8 (A) Engine No: 2ZR2V20768
Reg. Date: 15/08/2023 (Man. Year: 2023) Chassis No: ZWR900091172
Colour: Metallic Pearl White Odometer: 136442 km
Engine Capacity: 1797 cc
Market Value/New Car Price: S\$175,000.00
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/55 ZR17 Rear Tyre Size: 215/55 ZR17
Front Left Side: FLEULANT 8 mm Rear Left Side: FLEULANT 9 mm
Front Right Side: FLEULANT 8 mm Rear Right Side: FLEULANT 9 mm
The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	54,340.00	45,244.00	9,096.00	16.74
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,150.00	3,450.00	2,700.00	43.90
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	60,490.00	48,694.00	11,796.00	19.50
- Excess (S\$)	0.00	2,000.00	-2,000.00	
(S\$)	60,490.00	46,694.00	13,796.00	22.81
+ GST 9.00/9.00% (S\$)	5,444.10	4,202.46	1,241.64	22.81
Nett Amount (S\$)	65,934.10	50,896.46	15,037.64	22.81

INSPECTION

Date of Assignment: 09/12/2024 Present Location: Vin's Motor Pte Ltd (Sin Ming)
VIN'S MOTOR PTE LTD (SIN MING)
Date Inspected: 09/12/2024 Inspected At: 160 SIN MING DRIVE
#03-03 SIN MING AUTO CITY
SINGAPORE 575722
Estimated Period of Repair: 14.0 days

Adjuster: KENNETH KONG

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 29 Apr 2025)
Parts:	M1-MPV	TOYOTA NOAH HYBRID 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SNL4789C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*FRONT BONNET (ORDER) (WCP)	Bent	850.00 F	*850.00 F
2	1	NA	*BONNET RH HINGE (WCP)	Bent	50.00 F	*50.00 F
3	1	NA	*BONNET LH HINGE (WCP)	Bent	50.00 F	*50.00 F
4	1	NA	*BONNET INSULATOR (WCP)	Missing	170.00 F	*170.00 F
5	1	NA	*BONNET MOULDING (WCP)	Missing	190.00 F	*190.00 F
6	1	NA	*BONNET LOCK (WCP)	Bent	70.00 F	*70.00 F
7	1	NA	*BONNET LOCK CABLE (WCP)	Jammed	40.00 F	*40.00 F
8	1	NA	*BONNET STAND (ORDER) (WCP)	Repair	30.00 F	*- F
9	1	NA	*BONNET STAND CLIP (ORDER) (WCP)	Missing	20.00 F	*20.00 F
10	1	NA	*RH HEADLAMP (WCP)	Broken	1,300.00 F	*1,300.00 F
11	1	NA	*LH HEADLAMP (WCP)	Broken	1,300.00 F	*1,300.00 F
12	1	NA	*FRONT GRILLE ASSY (WCP)	Cracked	1,100.00 F	*1,100.00 F
13	1	NA	*FRONT GRILLE EMBLEM (WCP)	Missing	50.00 F	*50.00 F
14	1	NA	*FRONT RADAR (ORDER) (WCP)	Dented	620.00 F	*620.00 F
15	1	NA	*FRONT LH BUMPER (WCP)	Mtg Cracked	250.00 F	*250.00 F
16	1	NA	*FRONT RH BUMPER (WCP)	Cracked	250.00 F	*250.00 F
17	1	NA	*FRONT BUMPER RH FOG LAMP (WCP)	Mtg Cracked	240.00 F	*240.00 F
18	1	NA	*FRONT BUMPER LH FOG LAMP (WCP)	Mtg Cracked	240.00 F	*240.00 F
19	1	NA	*FRONT BUMPER TOWING COVER (WCP)	Missing	30.00 F	*30.00 F
20	1	NA	*FRONT RH BUMPER TOP SUPPORT BRACKET (WCP)	Distorted	70.00 F	*70.00 F
21	1	NA	*FRONT LH BUMPER TOP SUPPORT BRACKET (WCP)	Distorted	70.00 F	*70.00 F
22	1	NA	*FRONT BUMPER SPONGE (ORDER) (WCP)	Cracked	70.00 F	*70.00 F
23	1	NA	*FRONT BUMPER REINFORCEMENT (ORDER) (WCP)	Bent	290.00 F	*290.00 F
24	1	NA	*FRONT BUMPER REINFORCEMENT RH BRACKET (ORDER) (WCP)	Bent	140.00 F	*140.00 F
25	1	NA	*FRONT BUMPER REINFORCEMENT LH BRACKET (ORDER) (WCP)	Bent	140.00 F	*140.00 F
26	1	NA	*FRONT BUMPER LOWER BEAM (WCP)	Repair	200.00 F	*- F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
27	1	NA	*FRONT BUMPER LOWER BEAM RH BRACKET (WCP)	Repair	70.00 F	*- F
28	1	NA	*FRONT BUMPER LOWER BEAM LH BRACKET (WCP)	Repair	70.00 F	*- F
29	1	NA	*FRONT BUMPER LOWER BEAM SPONGE (WCP)	Cracked	70.00 F	*70.00 F
30	1	NA	*FRONT BUMPER UNDER COVER (WCP)	Cracked	150.00 F	*150.00 F
31	10	NA	*FRONT BUMPER CLIPS (WCP)	Necessary	20.00 F	*20.00 F
32	1	NA	*FRONT BUMPER LOWER SPOILER (ORDER) (WCP)	Cracked	450.00 F	*450.00 F
33	1	NA	*FRONT BUMPER PARKING SENSOR 4PCS (WCP)	Dented (3Pcs Only)	720.00 F	*540.00 F
34	1	NA	*FRONT PARKING SENSOR WIRE HARNESS (WCP)	Torn	150.00 F	*150.00 F
35	1	NA	*FRONT SUPPORT TOP PANEL (WCP)	Bent	280.00 F	*280.00 F
36	1	NA	*FRONT SUPPORT RH SIDE PANEL (WCP)	Bent	270.00 F	*270.00 F
37	1	NA	*FRONT SUPPORT LH SIDE PANEL (WCP)	Bent	270.00 F	*270.00 F
38	1	NA	*FRONT SUPPORT LOWER PANEL (WCP)	Bent	260.00 F	*260.00 F
39	1	NA	*BRACE PANEL (WCP)	Bent	80.00 F	*80.00 F
40	1	NA	*AIRCON CONDENSOR (ORDER) (ORI) (WCP)	Puncture	800.00 F	*800.00 F
41	1	NA	*AIRCON DISCHARGE PIPE (WCP)	Dented	280.00 F	*280.00 F
42	1	NA	*RADIATOR (ORDER) (ORI) (WCP)	Puncture	920.00 F	*920.00 F
43	1	NA	*RADIATOR TOP HOSE (WCP)	Cut	40.00 F	*40.00 F
44	1	NA	*RADIATOR LOWER HOSE (ORDER) (WCP)	Cut	40.00 F	*40.00 F
45	1	NA	*RADIATOR RH SIDE GUIDE (WCP)	Cracked	80.00 F	*80.00 F
46	1	NA	*RADIATOR LH SIDE GUIDE (WCP)	Cracked	80.00 F	*80.00 F
47	1	NA	*RADIATOR FAN MOTOR ASSY (ORDER) (WCP)	Cracked	750.00 F	*750.00 F
48	1	NA	*RADIATOR NECK FILLER (WCP)	Serviceable	40.00 F	*- F
49	1	NA	*RADIATOR TOP BUSH (WCP)	Necessary	20.00 F	*20.00 F
50	1	NA	*RADIATOR LOWER BUSH (WCP)	Serviceable	20.00 F	*- F
51	1	NA	*RADIATOR SPARE TANK (ORDER) (WCP)	Dented	130.00 F	*130.00 F
52	1	NA	*WIPER TANK (ORDER) (WCP)	Dented	100.00 F	*100.00 F
53	1	NA	*WIPER TANK NECK (WCP)	Dented	60.00 F	*60.00 F
54	1	NA	*WIPER TANK MOTOR (WCP)	Serviceable	140.00 F	*- F
55	1	NA	*HORN (WCP)	Dented	60.00 F	*60.00 F
56	1	NA	*VEHICLE APPROACHING SPEAKER ASSEMBLY (WCP)	Cracked	130.00 F	*130.00 F
57	1	NA	*RESONATOR (ORDER) (WCP)	Cracked	120.00 F	*120.00 F
58	1	NA	*RESONATOR INTAKE HOSE (WCP)	Dented	130.00 F	*130.00 F
59	1	NA	*RESONATOR AIR DUCT (WCP)	Dented	60.00 F	*60.00 F
60	1	NA	*AIR CLEANER BOX (ORDER) (WCP)	Cracked	450.00 F	*450.00 F
61	1	NA	*AIR CLEANER BOX HOSE (ORDER) (WCP)	Cracked	60.00 F	*60.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
62	1	NA	*AIR CLEANER BOX SUPPORT BRACKET (WCP)	Distorted	50.00 F	*50.00 F
63	1	NA	*INTAKE MANIFOLD (ORDER) (WCP)	Cracked	350.00 F	*350.00 F
64	1	NA	*INTAKE MANIFOLD HEAT SHIELD (WCP)	Serviceable	140.00 F	*- F
65	1	NA	*AIRCON COMPRESSOR (ORDER) (WCP)	Dented/Jammed	2,800.00 F	*2,800.00 F
66	1	NA	*FUSE BOX @ LH (ORDER) (WCP)	Cracked	140.00 F	*140.00 F
67	1	NA	*FUSE BOX LOWER COVER (WCP)	Cracked	130.00 F	*130.00 F
68	1	NA	*BATTERY TRAY (WCP)	Cracked	140.00 F	*140.00 F
69	1	NA	*BATTERY TRAY BRACKET (WCP)	Repair	70.00 F	*- F
70	1	NA	*HYBRID INVERTER ASSY (W/ CONVERTER) (ORDER) (WCP)	Serviceable	4,500.00 F	*- F
71	1	NA	*RH ENGINE MOUNTING (ORDER) (WCP)	Cracked	420.00 F	*420.00 F
72	1	NA	*RH ENGINE MOUNTING BRACKET (WCP)	Serviceable	280.00 F	*- F
73	1	NA	*LH ENGINE MOUNTING (WCP)	Serviceable	130.00 F	*- F
74	1	NA	*GEARBOX MOUNTING (ORDER) (WCP)	Serviceable	260.00 F	*- F
75	1	NA	*FRONT RH FENDER (ORDER) (WCP)	Buckled	400.00 F	*400.00 F
76	1	NA	*FRONT LH FENDER (ORDER) (WCP)	Buckled	400.00 F	*400.00 F
77	1	NA	*FRONT RH FENDER INNER SHIELD (WCP)	Cracked	170.00 F	*170.00 F
78	1	NA	*FRONT LH FENDER INNER SHIELD (WCP)	Cracked	170.00 F	*170.00 F
79	20	NA	*FRONT FENDER INNER SHIELD CLIPS (WCP)	Necessary	40.00 F	*40.00 F
80	1	NA	*FRONT RH FENDER GLASS (ORDER) (WCP)	Serviceable	240.00 F	*- F
81	1	NA	*FRONT LH FENDER GLASS (ORDER) (WCP)	Serviceable	240.00 F	*- F
82	1	NA	*FRONT RH FENDER GAP INSULATOR (WCP)	Necessary	110.00 F	*110.00 F
83	1	NA	*FRONT LH FENDER GAP INSULATOR (WCP)	Serviceable	110.00 F	*- F
84	1	NA	*FRONT WINDSCREEN GLASS (ORDER) (WCP)	Cracked	850.00 F	*900.00 F
85	1	NA	*FRONT WINDSCREEN GLASS RH MOULDING (ORDER) (WCP)	Cut	90.00 F	*90.00 F
86	1	NA	*FRONT WINDSCREEN GLASS LH MOULDING (ORDER) (WCP)	Serviceable	90.00 F	*- F
87	1	NA	*WIPER GARNISH (WCP)	Dented	380.00 F	*380.00 F
88	1	NA	*WIPER GARNISH RH SIDE COVER (WCP)	Missing	40.00 F	*40.00 F
89	1	NA	*WIPER GARNISH LH SIDE COVER (WCP)	Missing	40.00 F	*40.00 F
90	1	NA	*DASHBOARD (ORDER) (WCP)	Cracked	900.00 F	*900.00 F
91	1	NA	*STEERING WHEEL AIR BAG (ORDER) (WCP)	Burst	1,800.00 F	*1,800.00 F
92	1	NA	*PASSENGER AIRBAG (ORDER) (WCP)	Burst	2,200.00 F	*2,200.00 F
93	1	NA	*RH ROOF AIRBAG (ORDER) (WCP)	Burst	2,100.00 F	*2,100.00 F
94	1	NA	*LH ROOF AIRBAG (ORDER) (WCP)	Burst	2,100.00 F	*2,100.00 F
95	1	NA	*ROOF LINING (ORDER) (WCP)	Deformed	2,800.00 F	*2,800.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
96	1	NA	*FRONT RH SEAT BELT (ORDER) (WCP)	Jammed	800.00 F	*800.00 F
97	1	NA	*FRONT LH SEAT BELT (ORDER) (WCP)	Jammed	800.00 F	*800.00 F
98	1	NA	*AIRBAG ECU (ORDER) (WCP)	Necessary	1,700.00 F	*1,700.00 F
99	2	NA	*AIRBAG SENSOR (WCP)	Necessary	340.00 F	*340.00 F
100	1	NA	*FRONT NO. PLATE	Missing	40.00 FS	*40.00 FS
101	1	NA	*FENDER GLASS GUM	Not Necessary	60.00 FS	*- FS
102	1	NA	*WINDSCREEN GUM	Necessary	80.00 FS	*40.00 FS
103	1	NA	*COOLANT	Necessary	80.00 FS	*40.00 FS
104	1	NA	*BATTERY (50%) (SN)	Dented	180.00 FS	*90.00 FS

Supplementary #1

105	1	NA	*FRONT BUMPER RH FOG LAMP COVER (WCP)	Cracked	280.00 F	*280.00 F
106	1	NA	*FRONT BUMPER LH FOG LAMP COVER (WCP)	Cracked	280.00 F	*280.00 F
107	1	NA	*RESONATOR @LOWER (WCP)	Cracked	140.00 F	*140.00 F
108	1	NA	*ENGINE UNDER COVER (WCP)	Cracked	280.00 F	*280.00 F
109	1	NA	*ELECTRIC WATER PUMP (WCP)	Dented	270.00 F	*270.00 F
110	1	NA	*FUSE BOX UPPER COVER #1 (WCP)	Dented	80.00 F	*80.00 F
111	1	NA	*FUSE BOX UPPER COVER #2 (WCP)	Dented	90.00 F	*90.00 F
112	1	NA	*RADIATOR LOWER GUIDE (WCP)	Cracked	80.00 F	*80.00 F
113	1	NA	*ENGINE UNDER COVER @LH (WCP)	Cracked	70.00 F	*70.00 F
114	1	NA	*INVERTER COOLING HOSE #1 (WCP)	Cut	60.00 F	*60.00 F
115	1	NA	*INVERTER COOLING HOSE #2 (WCP)	Cut	150.00 F	*150.00 F
116	1	NA	*INVERTER TANK (WCP)	Dented	160.00 F	*160.00 F
117	1	NA	*INVERTER TANK HOSE (WCP)	Cut	60.00 F	*60.00 F
118	1	NA	*FRONT WINDSCREEN TOP MOULDING (WCP)	Necessary	40.00 F	*40.00 F
119	1	NA	*HYBRID CONVERTOR +/- CABLE (WCP)	Cracked	480.00 F	*480.00 F
120	1	NA	*AIRCON SUCTION PIPE (WCP)	Bent	250.00 F	*250.00 F
121	1	NA	*AIRCON RECEIVER PIPE (WCP)	Bent	390.00 F	*390.00 F
122	1	NA	*THROTTLE BODY (WCP)	Dented	920.00 F	*920.00 F
123	1	NA	*FRONT SUPPORT PANEL TOP COVER (WCP)	Cracked	100.00 F	*100.00 F

Supplementary #2

124	1		*TAILGATE RH POWER GATE ABSORBER (WCP) (Puncture)	Not Consistent with the impact	650.00 F	*- F
125	1		*TAILGATE LH POWER GATE ABSORBER (WCP) (Puncture)	Not Consistent with the impact	650.00 F	*- F

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	49,440.00	41,150.00
+ Margin on L,N Items 10.00/10.00% (\$\$)	4,900.00	4,094.00
Total Parts (\$\$)	54,340.00	45,244.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REPLACE FENDER GLASS	New	120.00	0.00
2	TO REFILL AIRCON GAS	New	150.00	100.00
3	TO REMOVE AND REPLACE FRONT WINDSCREEN	New	180.00	120.00
4	TO REMOVE AND REPLACE ROOF LINING	New	280.00	120.00
5	TO RESET AIRBAG SYSTEM	New	280.00	200.00
6	TO RESET HEADLAMP SYSTEM	New	280.00	160.00
7	TO REMOVE AND REPLACE DASHBOARD	New	380.00	250.00
8	TO RESET RADAR SYSTEM	New	380.00	150.00
9	TO REMOVE AND REFIX ENGINE	New	500.00	250.00
10	TO REPAIR DAMAGES	New	1,800.00	900.00
11	TO SPRAY PAINTING	New	1,800.00	1,200.00
Gross Labour Cost (\$\$)			6,150.00	3,450.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >