

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CD/AIG24060266/APA3Q2**Date:** 28/03/2025REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100482187
Claimant Vehicle No :	SMY2038T	Insured Vehicle No :	SLF8475L
Date of Loss:	21/06/2024	Nature of Claim:	TP
		Claim No:	6488471223SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMY2038T		
Make & Model:	MERCEDES-BENZ A200, 1.3 (A)	Engine No:	28291480496371
Reg. Date:	23/02/2021 (Man. Year: 2020)	Chassis No:	W1K1771872J274955
Colour:	Black	Odometer:	31847 km
Engine Capacity:	1332 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R17	Rear Tyre Size:	205/55 R17
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	36,335.90	15,304.30	21,031.60	57.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,400.00	2,200.00	4,200.00	65.63
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	42,735.90	17,504.30	25,231.60	59.04
Approved Total (Overridden) (S\$)		14,000.00		
(S\$)	42,735.90	14,000.00	28,735.90	67.24
+ GST 9.00/9.00% (S\$)	3,846.23	1,260.00	2,586.23	67.24
Nett Amount (S\$)	46,582.13	15,260.00	31,322.13	67.24
+ Car Rental (8.0 x S\$100.00/day) (S\$)		800.00		
+ Doc/Search Fee (S\$)		58.25		
+ Other Costs (S\$)		50.00		
Nett Liability (S\$)		16,168.25		
Global Sum Settlement (S\$)		16,150.00		

INSPECTION

Date of Assignment:	24/06/2024	JL Perfect Autowork Pte Ltd (HQ)
Date Inspected:	24/06/2024 Inspected At:	8 Kaki Bukit Avenue 4, #08-09 Premier@Kaki Bukit
Estimated Period of Repair:	8.0 days	Singapore 415875

Adjuster: ADRIAN LING**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Distorted	2,055.00 FL	*1,541.00 FL
2	1		*FRONT BUMPER LOGO	Necessary	105.00 FL	*105.00 FL
3	2		*FRONT BUMPER SIDE GRILLE	Not Necessary	352.00 FL	*- FL
4	1		*FRONT BUMPER RADAR SENSOR	Cracked	5,866.00 FL	*1,722.00 FL
5	1		*FRONT BUMPER RADAR SENSOR HOLDER	Cracked	486.00 FL	*245.00 FL
6	1		*FRONT BUMPER RADAR SENSOR WIRE HARNESS	Not Necessary	482.00 FL	*- FL
7	1		*FRONT BUMPER UPPER BEAM	Cracked	256.00 FL	*256.00 FL
8	2		*FRONT BUMPER UPPER BEAM SIDE SUPPORT	Not Necessary	184.00 FL	*- FL
9	1		*FRONT BUMPER LOWER GRILLE	Cut	385.00 FL	*385.00 FL
10	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	568.00 FL	*- FL
11	2		*FRONT BUMPER REINFORCEMENT ABSORB PANEL	Not Necessary	650.00 FL	*- FL
12	2		*FRONT BUMPER IMPACT SENSOR	Not Necessary	580.00 FL	*- FL
13	1		*FRONT BUMPER SPONGE	Cracked	193.00 FL	*193.00 FL
14	1		*FRONT BUMPER TOP RUBBER	Not Necessary	78.00 FL	*- FL
15	1		*FRONT BUMPER BOTTOM COVER GARNISH	Cracked	388.00 FL	*388.00 FL
16	1		*FRONT NUMBER PLATE GARNISH	Cracked	239.00 FL	*239.00 FL
17	2		*FRONT HEADLAMP (LED)	Cut	7,126.00 FL	*7,126.00 FL
18	2		*FRONT HEADLAMP RING GARNISH	Not Necessary	578.00 FL	*- FL
19	2		*FRONT HEADLAMP LOWER BRACKET	Not Necessary	196.00 FL	*- FL
20	1		*FRONT GRILLE WITH CHROME	Cracked	1,682.00 FL	*1,205.00 FL
21	1		*FRONT GRILLE LOGO	Not Necessary	198.00 FL	*- FL
22	1		*BONNET	Repair	2,390.00 FL	*- FL
23	2		*BONNET HINGE	Not Necessary	496.00 FL	*- FL
24	1		*BONNET BOTTOM LOCK	Not Necessary	168.00 FL	*- FL
25	4		*BONNET STOPPER	Not Necessary	132.00 FL	*- FL
26	1		*FRONT RADIATOR TOP PANEL	Cracked	1,394.00 FL	*885.00 FL
27	1		*FRONT SUPPORT BRACKET	Not Necessary	233.00 FL	*- FL
28	1		*FRONT RADIATOR TOP PANEL GARNISH	Not Necessary	78.00 FL	*- FL
29	2		*FRONT RADIATOR SUPPORT STAND PANEL	Not Necessary	1,074.00 FL	*- FL
30	1		*FRONT AIR GUARD (UPPER)	Not Necessary	215.00 FL	*- FL
31	1		*FRONT AIR GUARD (LOWER)	Not Necessary	192.00 FL	*- FL
32	1		*FRONT UPPER WIND SHUTTLE (AUTOR)	Cracked	865.00 FL	*865.00 FL
33	1		*FRONT LOWER WIND SHUTTLE (AUTOR)	Cracked	632.00 FL	*632.00 FL
34	1		*RADIATOR	Not Necessary	1,655.00 FL	*- FL
35	4		*RADIATOR MOUNTING	Not Necessary	272.00 FL	*- FL
36	1		*AIRCON CONDENSER	Not Necessary	1,527.00 FL	*- FL
37	1		*AIRCON PIPE	Not Necessary	486.00 FL	*- FL
38	1		*INTERCOOLER	Cracked	1,140.00 FL	*1,140.00 FL
39	2		*INTERCOOLER PIPE	Not Necessary	516.00 FL	*- FL
40	2		*HORN	Not Necessary	558.00 FL	*- FL
41	1		*OUTSIDE TEMPERATURE SENSOR	Not Necessary	147.00 FL	*- FL
42	2		*FRONT FENDER	Not Necessary	2,438.00 FL	*- FL
43	2		*FRONT FENDER COWLING (FRONT)	Not Necessary	396.00 FL	*- FL
44	1		*FRONT NUMBER PLATE	Not Necessary	50.00 FS	*- FS
45	1		*SET FRONT BUMPER CLIP	Necessary	120.00 FS	*30.00 FS
46	1		*SET FRONT BUMPER SIDE GRILLE CLIP	Not Necessary	50.00 FS	*- FS
47	1		*SET FRONT BUMPER BOTTOM COVER GARNISH CLIP	Necessary	50.00 FS	*30.00 FS
48	1		*SET FRONT NUMBER PLATE GARNISH CLIP	Necessary	50.00 FS	*10.00 FS
49	1		*SET SUPPORT PANEL UNDER COVER GARNISH CLIP	Not Necessary	50.00 FS	*- FS
50	1		*SET FRONT FENDER COWLING (FRONT) CLIP	Not Necessary	50.00 FS	*- FS
51	1		*SET FRONT FENDER COWLING (BACK) CLIP	Not Necessary	50.00 FS	*- FS
52	1		*COOLANT	Not Necessary	180.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) **40,301.00** **16,997.00**
- List Item Discount on L Items 10.00/10.00% (\$\$) **3,965.10** **1,692.70**

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
					Total Parts (S\$)	36,335.90 15,304.30

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING ,REMOVING AND REPLACING PARTS	New	1,800.00	700.00
2	SPRAY PAINTING TO AFFECTED AREA	New	1,600.00	600.00
3	TUFF COAT	New	250.00	30.00
4	REFOCUS HEADLAMP BEAM	New	80.00	0.00
5	WIRING CHECK	New	650.00	30.00
6	REMOVE AND REFIX RADAR SENSOR AND REPROGRAMMING	New	850.00	480.00
7	REMOVE AND REFIX AIR COOLER	New	120.00	60.00
8	REMOVE AND REFIX AIRCON CONDENSOR AND REFILL AIRCON GAS	New	120.00	60.00
9	REMOVE AND REFIX RADIATOR AND CONDUCT PRESSURE TEST	New	80.00	60.00
10	TO CHECK DIAGNOSTICS OF VEHICLE MANAGEMENT/ CONTROL UNITS ,RESET MEMORIES TO SPECIFICATION ETC	New	850.00	180.00
Gross Labour Cost (\$\$)			6,400.00	2,200.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >