

ASS. REC. BY:

REF:

MS61

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

20k

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

04 days

Res.: Yes or No

Lum Sum:

20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SNK 3028C

Yr Regn:

08, 15

Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

MC A180

c.c.

1595

Colour

n. Blue

A/C: Insured / Std / NI / NA

Sp. Reading

69882

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WDD1760422J384793

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / STD / STD A/Rim or

Tyre Size:

F:

225/40ZR18

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

16/11/24

D.O.I.

19/11/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1 / Evt not ready

25/11 / 11pm @ 3350h Curlew

Date/Time, File Pass to?

☐

: Prel. Report

1)

Date/Time, File Return to?

☐

: Final Report

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation

S + RS. \$

Fees

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

TOTAL

Not Notified
 L1 Sy @ 3350h
 Repair After Rain
 4 days

Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Vehicle Number : SNK 3028C

Acc: 16.11.24

S/N Parts Description

- 1 Rear tailgate emblem
- 2 Tailgate assy
- 3 Rear bumper
- 4 Rear bumper reinforcement
- 5 Rear bumper inner bracket
- 6 Rear bumper lower garnish
- 7 Rear bumper lower garnish mldg
- 8 Rear bumper innergarnish
- 9 Rear end panel
- 10 Rear end panel top garnish
- 11 Rear exhaust chrome cover LH

Unit Price Amt

na \$80 ✓
 R \$1,645 X
 Bu \$1,409.00 ✓
 R \$568.00 ✓
 CM \$135.00 ✓
 Od / m \$485.00 ✓
 R \$186.00 ✓
 CM \$208.00 ✓
 R \$990.10 X
 Su \$185.10 X
 R \$325.00 ✓

109

Labour

- 1 To remove and refit damaged parts \$900.00 600
- 2 To spray paint on affected parts \$1,000.00 450
- 3 To remove and refit rear reverse sensor \$120.00 60
- 4 To remove and refit rear garnishes \$120.00 50
- 5 Tuff coat on affected parts na \$100.00 X
- 6 To check wiring \$50.00 15

\$2,290.00

Page 1

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: