

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CD/III24110579/TPA3Q2
Date: 27/03/2025

REFERENCE

Handling Insurer: India International Insurance Pte Ltd Policy No: D20MFL0003256_04
Claimant Vehicle No : FBH9130H Insured Vehicle No : PC5918P
Date of Loss: 22/11/2024 Nature of Claim: TP Claim No: MFL2024D0014023

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: FBH9130H
Make & Model: YAMAHA FZ16ST, 153cc (M) Engine No: 45SB010265
Reg. Date: 15/11/2013 (Man. Year: 2013) Chassis No: ME145S0B6D2010302
Colour: Blue Odometer: 0 km
Engine Capacity: 153 cc
Market Value/New Car Price: N/A
Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 100/80 R17 Rear Tyre Size: 140/60 R17
Front Left Side: Pirelli 5 mm Rear Left Side: Pirelli 5 mm
Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,431.00	3,852.90	578.10	13.05
Miscellaneous Items	0.00	0.00	0.00	
Labour	850.00	500.00	350.00	41.18
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	5,281.00	4,352.90	928.10	17.57
Approved Total (Overridden) (S\$)		3,450.00		
Nett Amount (S\$)	5,281.00	3,450.00	1,831.00	34.67
+ Loss of Use (5.0 x S\$25.00/day) (S\$)		125.00		
+ Other Costs (S\$)		80.00		
Nett Liability (S\$)		3,655.00		

INSPECTION

Date of Assignment: 28/11/2024
Date Inspected: 28/11/2024 Inspected At: Pang Scooter Service (HQ)
BLK 1006 BUKIT MERAH LANE 2 #01-06
Singapore 159762
Estimated Period of Repair: 5.0 days

Adjuster: MOHD TAUFIKH BIN HAMID Manager: CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 21 Mar 2025)	
Parts:	N/A	YAMAHA FZ16ST 153cc (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBH9130H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*HANDLE BAR	Bent	85.00 F	*85.00 FL
2	1		*R/H HANDLE BRACKET END	Cut	25.00 F	*25.00 FL
3	1		*R/H MIRROR	Missing	45.00 F	*45.00 FL
4	1		*UNDER BRACKET	Bent	230.00 F	*230.00 FL
5	1		*SET STEERING CONE	Necessary	120.00 F	*120.00 FL
6	2		*FORK INNER TUBE	Bent	460.00 F	*460.00 FL
7	2		*FORK OIL	Necessary	80.00 F	*80.00 FL
8	1		*F BRAKE DISC	Bent	195.00 F	*195.00 FL
9	1		*F WHEEL RIM	Bent	398.00 F	*398.00 FL
10	1		*F WHEEL SHAFT	Bent	48.00 F	*48.00 FL
11	1		*MUFFLER ASSEMBLY	Dented	680.00 F	*680.00 FL
12	1		*MUFFLER GASKET	Necessary	25.00 F	*25.00 FL
13	1		*L/H TAIL COVER	Cracked	130.00 F	*130.00 FL
14	1		*R/H TAIL COVER	Cracked	130.00 F	*130.00 FL
15	1		*CENTER TAIL COVER	Missing	50.00 F	*50.00 FL
16	1		*TOP REAR COVER FENDER	Cracked	98.00 F	*98.00 FL
17	1		*REAR FENDER	Cracked	98.00 F	*98.00 FL
18	1		*(N) PLATE FENDER	Not Necessary	65.00 F	*- FL
19	1		*CHAIN GUARD	Not Necessary	85.00 F	*- FL
20	1		*SWIM ARM ASSEMBLY	Bent	390.00 F	*390.00 FL
21	1		*SET SWIM ARM BUSH KIT	Distorted	150.00 F	*150.00 FL
22	1		*SWIM SHAFT	Bent	45.00 F	*45.00 FL
23	1		*REAR WHEEL SHAFT	Bent	48.00 F	*48.00 FL
24	1		*REAR WHEEL RIM	Bent	398.00 F	*398.00 FL
25	1		*WHEEL BEARING	Distorted	80.00 F	*80.00 FL
26	1		*TAIL LIGHT ASSEMBLY	Cracked	98.00 F	*98.00 FL
27	1		*REAR (N) PLATE	Bent	25.00 F	*25.00 FL
28	1		*REAR SEAT ASSEMBLY	Bent	150.00 F	*150.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$\$)	4,431.00	4,281.00
- List Item Discount on L Items 0.00/10.00% (\$\$)	0.00	428.10
Total Parts (\$\$)	4,431.00	3,852.90

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PRESS BODY FRAME	New	350.00	300.00
2	LABOUR	New	500.00	200.00
Gross Labour Cost (S\$)			850.00	500.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >