Jin Auto Services Pte Ltd #01-410/412, 14 Defu Lane 10 539195

Insurer Reference: GBL7941B Repairer Reference: GBL7941B

Date calculated: 26/11/2024 4:28 PM

Full Report Registration: GBL7941B Printed: 26/11/2024 4:29 PM

Summary Information

Claim

Location:

Singapore (SG)

Work Provider:

China Taiping Insurance (Singapore) Pte Ltd

Printed by:

Claim Reference:

JOUIS SEOW GBL7941B

Currency: Date of Incident: Hire Car Start:

Hire Car End:

SGD 21/11/24

Estimated Repair Time:

Actual Repair Days:

Vehicle Details

Vehicle

Manufacturer:

Model: Sub Model:

Model Sheet Number:

Registration:

VIN number:

Odometer:

Model Specs

10-SEATS TWO COAT METALLIC TOYOTA

HIACE

BASE MODEL 70 84 01

GBL7941B TRH2000353029

54448

WHEELBASE 3110MM

PREPARE OFF VEHICLE

L/SLIDING DOOR

VAN

LKK Auto Consultants hence notify

the Repairer of the following:

To resurvey before/after spray painting

To display damaged part(s), during resurvey

Parts prices are subject to confirmation

Third party survey is on a "Without Prejudice" basis

No illegal modification(s) is allowed

Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Not fullored news 27/11/24 Thephe behiever. PIP \$ 2909.05 H day.


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All Underbody

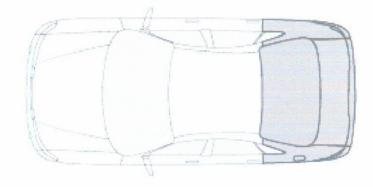

Tyres Condition

Tyre Brand

Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right

Condition

mm

mm

mm

mm

mm

Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour

	Time Base 10 WU/h	Price = 42.	00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	R + R REAR CENTRE CARPET RETAINER	2.0	8.40
NO NUMBER	RENEW REAR END PANEL INCLUDES: R + R BUMPER, TAILGATE SEAL, LOCK STRIKER PLATE AND SPARE WHEEL CARRIER	46.0	193.20
B390	RENEW TAILGATE INCLUDES: R + R TAILGATE AND NECESSARY ATTACHED PARTS DOES NOT INCLUDE: R + R REAR WINDOW	30.0	126.00
G040	R + R TAILGATE REAR SCREEN	23.0	96.60
B407	R + R LEFT TAILLAMP	1.0	4.20
B407	R + R RIGHT TAILLAMP	1.0	4.20
NO NUMBER	R + R L/R BUMPER CORNER	3.0	12.60
NO NUMBER	R + R R/R BUMPER CORNER	3.0	12.60
511201 ZAX	R + R SPARE WHEEL CARRIER	3.0	12.60

Labour Cost Panel / Mechanical Labour	Hrs 11.20	112.0	470.40
Total of Labour			470.40

	_	
-	=	 -
		-
-		

Paint Work	SYSTEM AZT	Time Basis 10 WU/h	
Code	Description - TWO COAT METALLIC	WU Price SG	
	REAR PANEL NEW PART PAINTING	15.0	
	REAR BUMPER NEW PART PAINT K1G/P	17.0	
	L/R BUMPER CORNER REPAIR PAINT PLASTIC	9.0	
	R/R BUMPER CORNER REPAIR PAINT PLASTIC	9.0	
	BOOTLID/TAILGATE REPAIR PAINTING >50%	42.0	

Paint Material Per Part

Code	Description	Price SGD
2711	REAR PANEL NEW PART PAINTING	14.30
2581	REAR BUMPER NEW PART PAINT K1G/P	63.00
2591	L/R BUMPER CORNER REPAIR PAINT PLASTIC	5.67
2592	R/R BUMPER CORNER REPAIR PAINT PLASTIC	5.67
2931	BOOTLID/TAILGATE REPAIR PAINTING >50%	70.31

Labour Cost - Paint		Hrs	WU	Price SGD
Factor	42.00 SGD/h			
Time Paint			92.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.80	8.0	33.60
Total	10 WU/h	12.50	125.0	525.00

Material Cost - Paint	Price SGD
New Part Painting	14.30
New Part Painting - Plastic K1G/PUR	63.00
Repair Painting	70.31
Repair Painting Plastic	11.34
Material-constant Metal Preparation	28.60
Material-constant Plastic	12.70
Total	200.25

Spare Parts

				prices as at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
2411	REAR SCREEN BOND K	IT PZ49I 00C1131		NS 0.00 X
2581	REAR BUMPER	52159 26470	Original	7:1 - 400.00
2591	L/R BUMPER CORNER	52166 26030A0	Original	11X 80.00X
2592	R/R BUMPER CORNER	52165 26030A0	Original	42 X 80.00 X
2702	REAR NUMBER PLATE	KNPL6	Original	Dione 30.00
2711	REAR PANEL	57069 26180	Original	R 350.00×
2931	BOOTLID/TAILGATE	67005 26A31	Original	850.00
2944	BOOT/TAILGATE SEAL	67881 26103	Original	7~/ 150.00/

Code	Description	Part Number	Part Source	Price SGD
2973	REAR LOCK CATCH	69430 95100	Original	11 × 55.00 X
3015	BADGE TOYOTA	90975 02064	Original KIV	ser × 50.00 X
3020	BADGE HIACE	75441 26281	Original K	Ten × 30.00 ×
3281	L/R LAMP	81561 26200	Original	771 150.00 X
3282	R/R LAMP	81551 26201	Original	7 N 150.00×
4986	REAR CARPET MOULDING	67935 26190	Original	770 120.00×
9690	SPARE WHEEL SUPPO	RT 51903 26661	Original	11 × 160.00 ×
f: OEM Parts n: Non-OEM Parts u: Used parts	Savings 7-1/9 Subtotal	sale lock ?	De # 40	0.00 2,655.00
7				2,655.00
Extras	Rae	r burper "inmer ctop	port \$170 best /	
Code	Description			Price SGD
1000	REVERSE CAMERA REVER	SE CAMERA		MM 180.00*X
1001	RR BUMPER REVERSE SEI	NSOR	200	malfuetion 250.00*
1002	WIRING WIRING			2-0 - 50.00*
1003	70KM/H STICKER			10.00*
1004	6 PAX STICKER			Les 10.00*
	Total Extras			500.00

Final Calculation

	SGD	SGD
Parts	2,655.00	
Total Parts		2,655.00
Labour Time Base 10 WU/h		
Total 112.0 WU X 42.00 SGD/h	470.40	
Total of Labour		470.40
Total Of Extras		500.00
Paint Work Time Base 10 WU/h		
Labour Cost 125.0 WU X 42.00 SGD/h	525.00	
Material Cost	200.25	
Total Paint Including Material		725.25
Repair Cost Excludes GST		4,350.65
GST (+9.00%)		391.56
Repair Cost Included GST		4,742.21

Comments

* - USER SUPPLIED DATA NN - NO MANUFACTURERS CODE EXISTS) - WU PARTIAL INCL IN OTHER POSITIONS

Jin Auto Services Pte Ltd #01-410/412, 14 Defu Lane 10 539195

Insurer Reference: GBL7941B Repairer Reference: GBL7941B

Date calculated: 24/12/2024 5:24 PM

Full Report Registration: GBL7941B

Printed: 24/12/2024 5:25 PM

Summary Information

Claim

Location:

Singapore (SG)

Work Provider:

China Taiping Insurance

(Singapore) Pte Ltd

Printed by:

Claim Reference:

JOUIS SEOW GBL7941B

Currency: Date of Incident: SGD 21/11/24

Estimated Repair Time: Actual Repair Days: 6

Hire Car Start: Hire Car End:

Vehicle Details

Vehicle

Manufacturer: Model:

TOYOTA HIACE

Sub Model: Model Sheet Number: BASE MODEL 70 84 01 GBL7941B

Registration: VIN number:

TRH2000353029 54448

Odometer:

Model Specs

10-SEATS

TWO COAT METALLIC

WHEELBASE 3110MM

PREPARE OFF VEHICLE

L/SLIDING DOOR

VAN


Vehicle Condition

Vehicle Status

Pre-Accident Damage: Date of Inspection:

Damage Areas

All		
Underl	oody	

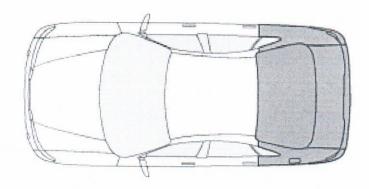

Tyres Condition

Tyre Brand

Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right

Condition

mm

mm

mm

mm

ma ma

Middle), mm

Spare Tyre Brand

Tread (Spare), mm

Labour

ee var	Time Base 10 WU/h	Price = 42.	.00 SGD/h
Code	Description	WU	Price SGD
NO NUMBER	R + R REAR CENTRE CARPET RETAINER	2.0	8.40
B390	RENEW TAILGATE INCLUDES: R + R TAILGATE AND NECESSARY ATTACHED PARTS DOES NOT INCLUDE: R + R REAR WINDOW	30.0	126.00
G040	R + R TAILGATE REAR SCREEN	23.0	96.60
520051	RENEW REAR BUMPER INCLUDES: REAR BUMPER AND REQUIRED ATTACHED PARTS R + R	3.0	12.60
B407	R + R LEFT TAILLAMP	1.0	4.20
B407	R + R RIGHT TAILLAMP	1.0	4.20
642101	R + R TAILGATE SEAL	2.0	8.40
642371	REMOVE AND REFIT REAR LOCK CATCH	4.0	16.80
511201 ZAX	R + R SPARE WHEEL CARRIER	3.0	12.60
2711	REAR PANEL REPAIR	15.0*	63.00

	Labour Cost Panel / Mechanical Labour		Hrs 8.40	WU 84.0	352.80
	Total of Labour				352.80
Paint					
Paint Work	SYSTEM AZT		Ti	me Basis	s 10 WU/h
Code	Description - TWO COAT METALLIC			wu	Price SGD
	REAR PANEL NEW PART PAINTING			15.0	
	REAR BUMPER NEW PART PAINT K1G/P			17.0	
	L/R BUMPER CORNER REPAIR PAINT PLASTIC			9.0	
	R/R BUMPER CORNER REPAIR PAINT PLASTI			9.0	
	BOOTLID/TAILGATE REPAIR PAINTING >50%			42.0	
Paint Mater	ial Per Part				
Code	Description				Price SGD
2711	REAR PANEL NEW PART PAINTING				14.30
2581	REAR BUMPER NEW PART PAINT K1G/P				63.00
2591	L/R BUMPER CORNER REPAIR PAINT PLASTIC				5.67
2592	R/R BUMPER CORNER REPAIR PAINT PLASTIC			5.67	
2931	BOOTLID/TAILGATE REPAIR PAINTING >50%)			70.31
	Labour Cost - Paint		Hrs	wu	Price SGD
	Factor	42.00 SGD/h			
	Time Paint			92.0	
	Preparation Main Work Metal		2.50	25.0	105.00
	Preparation Comp. Work Plastic Total	10 14/11 /1-	0.80	8.0	33.60
	Total	10 WU/h	12.50	125.0	525.00
	Material Cost - Paint				Price SGD
	New Part Painting				14.30
	Now Part Painting Plactic K1C/DID				

Spare Parts

				at 2015-06-01/01
Code	Description	Part Number	Part Source	Price SGD
2411	REAR SCREEN BOND KI	T PZ49I 00C1131		0.00
2581	REAR BUMPER	52159 26470*	Original	400.00
2702	REAR NUMBER PLATE	KNPL6	Original	30.00
2931	BOOTLID/TAILGATE	67005 26A31*	Original	850.00
2944	BOOT/TAILGATE SEAL	67881 26103	Original	150.00
2977	BOOT/TAILGATE LOCK	69350 26122	Supplementary	150.00
1001	RR BUMPER	REVERSE SENSOR		200.00
1005	tailgate lock	lock cover	Supplementary	40.00

New Part Painting - Plastic K1G/PUR

Material-constant Metal Preparation

Repair Painting

Total

Repair Painting Plastic

Material-constant Plastic

63.00

70.31

11.34

28.60

12.70

200.25

Code Description Part Number step panel Part Source Price SGD 170.00 f: OEM Parts n: Non-OEM Parts u: Used parts Savings Subtotal Subtotal Discount(+10.00%) 0.00 1,990.00 1,990.00 1,990.00 1,791.00 Extras Total 1,791.00	Code	Description			Price SGD
1006 Bumper inner step panel Original 170.00 f: OEM Parts n: Non-OEM Parts u: Used parts Subtotal Discount(+10.00%) Tatal	A TOWN CONTRACTOR OF THE PARTY				
1006 Bumper inner step panel Original 170.00 f: OEM Parts n: Non-OEM Parts Subtotal 1,990.00		Total			1,791.00
1006 Price SGD	n: Non-OEM Parts	Subtotal	ınt(+10.00%)		1,990.00
rate Namber Falt Source Price SGD	1006	Bumper inner	step panel	Original	170.00
		The state of the s	Part Number	Part Source	Price SGD

Code	Description	Price SGD
1002	WIRING WIRING	20.00*
1003	70KM/H STICKER	10.00*
1004	6 PAX STICKER	10.00*
	Total Extras	40.00

Final Calculation

	SGD	SGD
Parts	1,990.00	
Total Discount(+10.00%)	-199.00	
Total Parts		1,791.00
Labour Time Base 10 WU/h		
Total 84.0 WU X 42.00 SGD/h	352.80	
Total of Labour	332.00	352.80
		332.60
Total Of Extras		40.00
Paint Work Time Base 10 WU/h		
Labour Cost 125.0 WU X 42.00 SGD/h	525.00	
Material Cost	200.25	
Total Paint Including Material	200.20	725.25
Repair Cost Excludes GST		2,909.05
GST (+9.00%)		261.81
Repair Cost Included GST		3,170.86

Comments

* - USER SUPPLIED DATA

NN - NO MANUFACTURERS CODE EXISTS

) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.