

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/ICS24120053/KNH3M4**Date:** 16/12/2024REFERENCE

Handling Insurer: ECICS Limited

Policy No:

Claimant Vehicle No :

SLF3731E

Insured Vehicle No :

SMR2951T

Date of Loss:

28/11/2024

Nature of Claim:

TP

Claim No:

DMPC2401678H/02/CT

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:

SLF3731E

Make & Model:

HONDA CIVIC, 2.0 TYPE-R (M)

Engine No:

K20A5803392

Reg. Date:

13/11/2008 (Man. Year: 2008)

Chassis No:

FD21203283

Colour:

White

Odometer:

345064 km

Engine Capacity:

1998 cc

Market Value/New Car Price: N/A

Sum Insured (S\$):

Market Value/New Car PriceCONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:

Steering (Serviceable):

Yes

Footbrake (Serviceable):

Yes

Handbrake (Serviceable):

Yes

Engine Modification:

No

Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:

245/40R17

Rear Tyre Size:

245/40R17

Front Left Side:

Bridgestone 6 mm

Rear Left Side:

Dunlop 4 mm

Front Right Side:

Bridgestone 6 mm

Rear Right Side:

Dunlop 4 mm

*The above values represent the remaining tyre treads depth*COST OF CLAIMS

	Repairer's	Adjuster's	Difference	Diff %
Parts	5,379.40	3,092.08	2,287.32	42.52
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,770.00	1,020.00	750.00	42.37
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	7,149.40	4,112.08	3,037.32	42.48
Approved Total (Overridden) (S\$)		3,250.00		
(S\$)	7,149.40	3,250.00	3,899.40	54.54
+ GST 9.00/9.00% (S\$)	643.45	292.50	350.95	54.54
Nett Amount (S\$)	7,792.85	3,542.50	4,250.35	54.54

INSPECTION

Date of Assignment:

04/12/2024

Date Inspected:

04/12/2024

Inspected At:

THIAM HENG HUAT PTE LTD
176 SIN MING DRIVE
#05-14 SINGAPORE 575721

Estimated Period of Repair:

4.0 days

Adjuster: KENNETH KONG**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 16 Dec 2024)
Parts:	144	HONDA CIVIC 2.0 TYPE-R (M) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLF3731E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT FENDER RH	Repair	837.60 F	*- FL
2	1		*FRONT FENDER INNER SHIELD RH	Torn	191.80 F	*191.80 FL
3	1		*FRONT FENDER INNER SHIELD CLIPS RH	Necessary	60.00 F	*60.00 FL
4	1		*HEADLAMP RH	Mtg Cracked	1,100.00 F	*1,100.00 FL
5	1		*HEADLAMP BRACKET RH	Distorted	79.90 F	*79.90 FL
6	1		*FRONT GRILLE	Mtg Cracked	401.50 F	*401.50 FL
7	1		*FRONT GRILLE CLIPS	Necessary	50.00 F	*50.00 FL
8	1		*FRONT BUMPER ASSY	Buckled/Mtg Cracked	1,101.40 F	*1,101.40 FL
9	1		*FRONT BUMPER RETAINER	Distorted (1Pc Only)	136.00 F	*68.00 FL
			2PCS			
10	1		*FRONT BUMPER LOWER GRILLE	Serviceable	187.00 F	*- FL
11	1		*FRONT BUMPER LOWER COVER	Serviceable	138.20 F	*- FL
12	1		*FRONT BUMPER REINFORCEMENT	Repair	386.00 F	*- FL
13	1		*FRONT BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
14	1		*FRONT NO. PLATE	Serviceable	60.00 FS	*- FS
15	1		*FRONT BUMPER LOWER SPOILER	Cracked	600.00 FS	*600.00 FS
Sub Total (\$\$)					5,379.40	3,702.60
- List Item Discount on L Items 0.00/20.00% (\$\$)					0.00	610.52
Total Parts (\$\$)					5,379.40	3,092.08

F=Franchise part. S=SpcNett. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REFIT DAMAGED PARTS, CUT/WELD DAMAGED AREAS	New	800.00	400.00
2	TO SPRAY PAINT ON AFFECTED AREAS	New	800.00	600.00
3	CHECK WIRING	New	50.00	20.00
4	TUFF COATING	New	120.00	0.00
Gross Labour Cost (\$\$)			1,770.00	1,020.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >