

00/china

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun Industrial Park

A

768761

Insurer Reference: SND8649P

Repairer Reference: SND8649P

Date calculated: 04/12/2024 12:29 PM

Full Report

Registration: SND8649P

Printed: 04/12/2024 12:29 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	SND8649P	Date of Incident:	28/11/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	HYUNDAI		
Model:	AVANTE (CN7)		
Sub Model:	ELITE S/R		
Model Sheet Number:	30 1L 26		
Registration:	SND8649P		
VIN number:			
Odometer:			
Model Specs			
RADAR FRONT	FRONT PARKING SYSTEM	1.6 LTR 66 KW	TYRES 225/45 R17..W
TWO COAT METALLIC	PREPARE OFF VEHICLE		

Not Authorized
Repair by part
Ex TRA
5 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Insurer Reference: SND8649P
Repairer Reference: SND8649P
Date calculated: 04/12/2024 12:29 PM

Full Report
Registration: SND8649P
Printed: 04/12/2024 12:29 PM

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

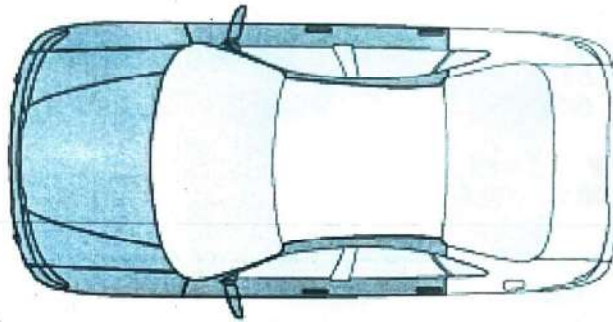

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
18600A00	ADD WORK FOR H-LAMP LEVEL CONTROL		3.0	12.60
NO NUMBER	R + R FRONT PANEL		16.0	67.20
96401A0A	CALIBRATE FRONT RADAR		3.0	12.60
86512R00	RENEW FRONT BUMPER		9.0	37.80
	INCLUDES: R + R FRONT BUMPER, GRILLE AND NECESSARY ATTACHED PARTS			
NO NUMBER	ADD/WORK FOR SEALING BONNET		3.0	12.60
79110R0B)	R + R BOTH BONNET HINGES		5.0	21.00
66400R00	RENEW BONNET		8.0	33.60
	INCLUDES: R + R AND ADJUST BONNET			
86150R00	R + R COWL PANEL COVER		3.0	12.60
92000R0B)	R + R BOTH HEADLAMPS CPL		2.0	8.40
66300R0B	RENEW BOTH FRONT WINGS		17.0	71.40
	(BUMPER REMOVED)			
	INCLUDES: BOTH FRONT WINGS R + R AND REQUIRED ATTACHED PARTS ASSEMBLE			
28100R00	R + R AIR CLEANER CPL		3.0	12.60

Insurer Reference: SND8649P
 Repairer Reference: SND8649P
 Date calculated: 04/12/2024 12:29 PM

Full Report
 Registration: SND8649P
 Printed: 04/12/2024 12:29 PM

Code	Description	WU	Price SGD
25300R1H)	R + R RADIATOR	21.0	88.20
09760A00	DRAIN + REFILL AIR CONDITIONING	5.0	21.00
23001A00	DRAIN/REFILL COOLING SYSTEM	5.0	21.00
NO NUMBER	R + R L/F WHEEL	1.0	4.20
NO NUMBER	R + R R/F WHEEL	1.0	4.20
96600R0A	R + R HORN (ADD/WORK)	2.0	8.40
96401RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	12.60
1121	L/F W-HOUSE REINF REPAIR	10.0*	7 42.00
1122	R/F W-HOUSE REINF REPAIR	10.0*	7 42.00
1001	RESET RADAR SYSTEM REPAIR	30.0*	7 126.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		16.00	160.0
Total of Labour			672.00

Paint

Code	Description - TWO COAT METALLIC	WU	Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	5.0	
	BONNET NEW PART PAINTING	26.0	
	L/F WING NEW PART PAINTING	8.0	
	R/F WING NEW PART PAINTING	8.0	
	FRONT BUMPER NEW PART PAINT K1R	12.0	
	UPPER GRILLE TRIM NEW PART PAINT K1R	3.0	
	FRT BUMPER PROT CVR SURFACE PAINT PLAST.	4.0	
	UPP BUMPER MOULDING SURFACE PAINT PLAST.	4.0	
	L/F W-HOUSE REINF SURFACE PAINT	5.0	
	R/F W-HOUSE REINF SURFACE PAINT	5.0	
	L/UPP A-PILLAR PR SURFACE PAINT	4.0	
	R/UPP A-PILLAR PR SURFACE PAINT	4.0	

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	5.48
0471	BONNET NEW PART PAINTING	87.72
0741	L/F WING NEW PART PAINTING	12.38
0742	R/F WING NEW PART PAINTING	12.38
0283	FRONT BUMPER NEW PART PAINT K1R	55.10
0413	UPPER GRILLE TRIM NEW PART PAINT K1R	2.46
0295	FRT BUMPER PROT CVR SURFACE PAINT PLAST.	3.66
0313	UPP BUMPER MOULDING SURFACE PAINT PLAST.	6.22
1121	L/F W-HOUSE REINF SURFACE PAINT	4.98
1122	R/F W-HOUSE REINF SURFACE PAINT	4.98
2235	L/UPP A-PILLAR PR SURFACE PAINT	3.24
2236	R/UPP A-PILLAR PR SURFACE PAINT	3.24

Insurer Reference: SND8649P
 Repairer Reference: SND8649P
 Date calculated: 04/12/2024 12:29 PM

Full Report
 Registration: SND8649P
 Printed: 04/12/2024 12:29 PM

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			
Time Paint		88.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	118.0	495.60

Material Cost - Paint

	Price SGD
New Part Painting	112.48
New Part Painting - Plastic K1R	57.56
Surface-/Blend Paint	21.92
Surface Painting Plastic	9.88
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	239.44

Spare Parts

				prices as at 2001-01-01	Price SGD
Code	Description	Part Number	Part Source		
4465	AIR CON CONDENSER	97606AA010	Original		200.00 ?
0471	BONNET	66400AA000	Original	Bu	680.00 ✓
0492	BONNET LOCK	81130AA900	Original		55.00 ?
0283	FRONT BUMPER	86510AABA0	Original	Bu	260.00 ✓
0315	FRONT IMPACT DAMPER	86520AAAA0	Original		68.00 ?
0431	FRONT MANUFACT	86311AAAA0	Original	na	30.00 ✓
	BADGE				
1295	FRONT RADAR SENSOR	99110AA500	Original	CM	750.00 ?
0340	FRT BUMPER SUPPORT	64900BY500	Original		220.00 ✓
0260	FRT NO PLATE REINF	86519AAAA0	Original	na	18.00 ✓
0410	GRILLE	86350AAAB0CA	Original	CM	450.00 ✓
0475	L/BONNET HINGE	66910AA000	Original	n	35.00 X
0355	L/F UPP BUMPER BRKT	865E1AAAA0	Original		16.00 ?
0741	L/F WING	66310AA500	Original	n	380.00 X
0561	LEFT HEADLAMP ASSY	92101AA620	Original	CM	1,350.00 ✓
0476	R/BONNET HINGE	66920AA000	Original	n	35.00 X
0356	R/F UPP BUMPER BRKT	865E2AAAA0	Original		16.00 ?
0742	R/F WING	66320AA500	Original	n	380.00 X
7761	RADIATOR	253E0BY100	Original		280.00 ?
0562	RIGHT HEADLAMP ASSY	92102AA620	Original	CM	1,350.00 ✓
0409	UP/CVR RADIAT GRILLE	86391AAAA0	Original	CM	75.00 ✓
1009	UPPER FRONT PANEL	64101AA500	Original	CM	350.00 ✓
0413	UPPER GRILLE TRIM	86370AAAA0	Original	CM	130.00 ✓

f: OEM Parts
 n: Non-OEM Parts
 u: Used parts

Savings	0.00
Subtotal	7,128.00
Fixed Sundry Parts Price	100.00
Total	7,228.00

Extras

Code	Description	Price SGD
1000	1UNIT COOLANT	na 25.00* ✓
1002	SUPPLY A/CON GAS	50.00* ✓

Insurer Reference: SND8649P
Repairer Reference: SND8649P
Date calculated: 04/12/2024 12:29 PM

Full Report
Registration: SND8649P
Printed: 04/12/2024 12:29 PM

Code	Description	Price SGD
	Total Extras	75.00

Final Calculation

	SGD	SGD
Parts	7,128.00	
Fixed Sundry Parts Price	100.00	
Total Parts		7,228.00
Labour Time Base 10 WU/h		
Total 160.0 WU X 42.00 SGD/h	672.00	
Total of Labour		672.00
Total Of Extras		75.00
Paint Work Time Base 10 WU/h		
Labour Cost 118.0 WU X 42.00 SGD/h	495.60	
Material Cost	239.44	
Total Paint Including Material		735.04
Repair Cost Excludes GST		8,710.04
GST (+9.00%)		783.90
Repair Cost Included GST		9,493.94

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.