

ASS. REC. BY: TajREF: CS/SMR24/2075/TW43

ASSIGNMENT

Lot 2026/07

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

☒	☐
N/S	O/S
☐	☐

Bal. or Market Value: \$15K

IDAC Accident Report _____

Consistent? : Yes or No

GIA / PR Seen: _____

Consistent? : Yes or No

Est. Repairs: _____

days

Res.: Yes or No

Lum Sum: _____

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____

Person Contacted: _____

Veh No: XD553R Yr Regn: 2004 08

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: 15737 CXZ50Kc.c. 12068Colour: white

A/C: Insured / Std / NI / NA

Sp. Reading: 10709

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JVALCXZ50K67000-90Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: SP / S/Rim / STD A/Rim orTyre Size: F: 295/80R22.5R: ~ ~

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mm

D.O.A. _____

D.O.I. 6/3/25Survey held at thru the ch mo for

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Frt w/s

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prel. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Report Format: _____

Lump Sum / L.B.J. / ?

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)☐

: Interview (\$ _____)

☐

: Tech. Invs (\$ _____)

☐

: Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

\$ + RS \$ _____

Phone _____

Others _____

TOTAL



發福摩多車房 HUAT HOCK MOTOR WORKSHOP

BLOCK 3012, BEDOK NORTH AVE 4, #01-2054,
BEDOK INDUSTRIAL PARK E, SINGAPORE 489978

Tel / Fax: 6445 2934

Hq: 816 6988

BUSINESS REG NO. 375654000

Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Carplate: XD553R
Chassis No: JALCXZ50K67000090
Accident Date: 29/11/2024
Make & Model: ISUZU CXZ50K

No.	Item	Price	Signature: ☒ / ☐	Remarks
1	Front Bumper	\$ 1,560.20		x R
2	Front Bumper Bracket LH	\$ 365.10		x nn
3	Front Bumper Bracket RH	\$ 365.10		x nn
4	Front Bumper Top Garnish LH	\$ 385.10		x nn
5	Front Bumper Center Garnish	\$ 398.60		x nn
6	Front Bumper Top Garnish RH	\$ 385.10		x nn
7	Front Headlamp LH	\$ 982.90		x nn
8	Front Step-up Board LH garnish	\$ 355.60		cut
9	Front Side Mirror Bracket LH	\$ 712.90		cut
10	Front Side Mirror Arm LH	\$ 339.20		bt
11	Front Side Mirror LH	\$ 159.20		cut
12				1566.90
13				15% - 1331.86
14				
15				
No.	All Necessary Work	Price	☒ / ☐	Remarks
1	Rewiring to facilitate repairs and check electrical wiring	\$ 120.00		x 7 x
2	Respraying of undercoating	\$ 180.00		x } nn
3	To apply anti-rust treatment on affected parts	\$ 200.00		x }
4				
5				
6				
7	Labour to remove and replace damaged parts, including refitting and repositioning of replaced parts	\$ 800.00		450
8	Spray painting materials and respray of all affected and replaced parts necessary for paintwork	\$ 800.00		450 450
	Estimated No. of days for repairs and respray of all necessary	8 days		900

Tan Jiah 97495749/6256356/
wp/ 6/3/25 21540 03 days
tanjiah@lkhauto.com

1331.86
900
2231.86
4581750
03 days