

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters
Blk 2 Rivervale Link, #09-02 Singapore 545040
Mobile: 9007 5234
Email: constant_as@yahoo.com.sg
RCB No. 53138015K

C10/120614

INVOICE

To: Jacsin Pte Ltd
c/o Blk 3, Pioneer Road North
#01-24
Singapore 628457

Date : 22/06/2023
Invoice No : IV23-06028/CAS

Particulars	Amount
Fee For Services Rendered In Respect Of: Surveying, Adjusting, and Re-inspection Of Accident Damaged Vehicle XE 5533K (Inclusive Of Photographs And Transport Charges) Our reference : CAS/23-06/028	\$556.00
Total	\$556.00

E. & O.E

Constant Appraiser Services



Cheque Should Be Crossed And Made Payment To 'Constant Appraiser Services'

Constant Appraiser Services

Qualified Automobile Accident Damage Appraisers/Loss Adjusters

Blk 2 Rivervale Link, #09-02 Singapore 545040

Mobile: 9007 5234

Email: constant_as@yahoo.com.sg

RCB No. 53138015K

Automobile Inspection Report

To: Jacsin Pte Ltd c/o Blk 3, Pioneer Road North #01-24 Singapore 628457	Date : 22/06/2023 Reference No : CAS/23-06/028																				
<u>General Information</u> Registration No. : XE 5533K Accident Date : 01/06/2023																					
<u>Particulars of Damaged Vehicle</u> <table><tr><td>Colour</td><td>: White</td><td>Make & Model</td><td>: Mitsubishi FV51JJD4RDEA</td></tr><tr><td>Engine Capacity</td><td>: 12882 cc</td><td>Pre-Accident Condition</td><td>: Good</td></tr><tr><td>Mileage (KM)</td><td>: 918133</td><td>Engine No.</td><td>: 6M70428627</td></tr><tr><td>Chassis No.</td><td>: FV51JJA00407</td><td>Steering</td><td>: In Order</td></tr><tr><td>Registration Date</td><td>: 19/12/2008</td><td>Brake</td><td>: In Order</td></tr></table>		Colour	: White	Make & Model	: Mitsubishi FV51JJD4RDEA	Engine Capacity	: 12882 cc	Pre-Accident Condition	: Good	Mileage (KM)	: 918133	Engine No.	: 6M70428627	Chassis No.	: FV51JJA00407	Steering	: In Order	Registration Date	: 19/12/2008	Brake	: In Order
Colour	: White	Make & Model	: Mitsubishi FV51JJD4RDEA																		
Engine Capacity	: 12882 cc	Pre-Accident Condition	: Good																		
Mileage (KM)	: 918133	Engine No.	: 6M70428627																		
Chassis No.	: FV51JJA00407	Steering	: In Order																		
Registration Date	: 19/12/2008	Brake	: In Order																		
<u>Tyre Condition</u> <table><thead><tr><th></th><th>Size</th><th>Make</th><th>Balance</th></tr></thead><tbody><tr><td>R/H Front Tyre</td><td>12R22.5</td><td>INNING</td><td>50%</td></tr><tr><td>L/H Front Tyre</td><td>12R22.5</td><td>INNING</td><td>50%</td></tr><tr><td>R/H Rear Tyre</td><td>12R22.5 X 4</td><td>INNING</td><td>50%</td></tr><tr><td>L/H Rear Tyre</td><td>12R22.5 X 4</td><td>INNING</td><td>50%</td></tr></tbody></table>			Size	Make	Balance	R/H Front Tyre	12R22.5	INNING	50%	L/H Front Tyre	12R22.5	INNING	50%	R/H Rear Tyre	12R22.5 X 4	INNING	50%	L/H Rear Tyre	12R22.5 X 4	INNING	50%
	Size	Make	Balance																		
R/H Front Tyre	12R22.5	INNING	50%																		
L/H Front Tyre	12R22.5	INNING	50%																		
R/H Rear Tyre	12R22.5 X 4	INNING	50%																		
L/H Rear Tyre	12R22.5 X 4	INNING	50%																		
<u>Inspection</u> Repairer : Carport Auto Service Blk 3, Pioneer Road North, #01-24, Singapore 628457																					
<u>Adjustment And Recommendation Cost Of Repair</u> Repairer's Estimate : \$5,958.03 Revised Amount : \$4,200.00 Less Excess : - Nett Total : \$4,200.00																					
<u>Remarks</u> (A) Survey was done on 12/06/2023 (B) Re-survey was done on 14/06/2023 (C) Re-survey after repair was done on 20/06/2023 (D) The survey was conducted entirely on WITHOUT PREJUDICE basis. (E) We have NOT given any instruction to authorize the repair of the vehicle.																					

NOTE: The revised estimate was made from a visual inspection. Should there be any discrepancy or unseen damage/item in this survey, kindly notified the company within 7 (seven) days from the date hereof. Otherwise, the revised amount shall be deem to be valid.

Constant Appraiser Services

Vehicle No : XE 5533K

Our ref : CAS/23-06/028

Adjustment On Repair Costs And Replacement Of Parts:

S/No	Qty	Descriptions	Assessed Condition	Estimate by Workshop (\$)	Revised Amount (\$)
		<u>PARTS REPLACEMENT – LIST ITEMS</u>			
1	1pc	Front bumper	Dented/Twisted	2,493.97	2,493.97
2	1pc	Front bumper lamp LH	Broken	278.67	278.67
3	1pc	Front bumper lamp garnish LH	Broken	105.11	105.11
4	1pc	Front bumper bracket LH	Bent	257.89	257.89
5	1pc	Front bumper end trim LH	Twisted/Deformed	67.40	67.40
6	1pc	Headlamp LH	Broken	727.54	727.54
7	1pc	Headlamp garnish LH	Broken	174.20	174.20
8	1pc	Headlamp stay LH	Dented/Twisted	959.26	959.26
				5,064.04	5,064.04
		Less 25%		(1,266.01)	(1,266.01)
			Sub total	3,798.03	3,798.03
		<u>LABOUR & MISC. CHARGES</u>			
1		Labour to repair & replace front damaged parts		1,000.00	750.00
2		Spray paint on front affected area		1,000.00	600.00
3		Check wiring & refocus headlamp		60.00	20.00
4		Tuff kote		100.00	40.00
			Grand total	5,958.03	5,208.03
Recommended cost of lump sum repair (To its pre-accident condition)					4,200.00

Adjustment/Recommendations

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

The repairer has agreed to undertake the job at a lump sum of **\$4,200.00** on a contractual basis. Under normal circumstances, the repair period would be about **5 (Five)** working days.

Yours faithfully,

Constant Appraiser Services


Lim Yong Tian (Sebastian)

Licensed Appraiser

Adv. Dip. In Mechanical Engineering (AUS)

MSAAA





















