

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/TMI24120299/NQP3E2
Date: 26/02/2025REFERENCE

Handling Insurer:	Tokio Marine Insurance Singapore Ltd	Policy No:	MQ003323
Claimant Vehicle No :	SHC786E	Insured Vehicle No :	SLS2888A
Date of Loss:	19/12/2024	Nature of Claim:	TP
		Claim No:	M2407414

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHC786E	Engine No:	HIDDEN
Make & Model:	BYD E6 (ME-2), (A)	Chassis No:	LC0CE4DCXN0066059
Reg. Date:	31/08/2022 (Man. Year: 2022)	Odometer:	196566 km
Colour:	Yellow		
Engine Capacity:	0 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Good	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:	Good

CONDITION OF TYRES

Front Tyre Size:	215/55 R17	Rear Tyre Size:	215/55 R17
Front Left Side:	Mozzo 5 mm	Rear Left Side:	Mozzo 8 mm
Front Right Side:	Mozzo 5 mm	Rear Right Side:	Mozzo 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,205.00	2,339.60	865.40	27.00
Miscellaneous Items	12.00	12.00	0.00	0.00
Labour	1,610.00	930.00	680.00	42.24
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,827.00	3,281.60	1,545.40	32.02
+ GST 9.00/9.00% (S\$)	434.43	295.34	139.09	32.02
Nett Amount (S\$)	5,261.43	3,576.94	1,684.49	32.02

INSPECTION

Date of Assignment:	20/12/2024	Present Location:	ComfortDelGro Engineering Pte Ltd (Loyang)
Date Inspected:	19/12/2024	Inspected At:	ComfortDelGro Engineering Pte Ltd (Loyang) 59 Loyang Drive Singapore 508969
Estimated Period of Repair:	2.0 days		

Adjuster: Muhammad Nazril Bin Abdullah**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 26 Feb 2025)
Parts:	M1-MPV	BYD E6 (ME-2) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SHC786E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Cracked	1,814.00 FL	*1,814.00 FL
2	1		*REAR BUMPER LOWER COVER	Cracked	998.00 FL	*998.00 FL
3	1		*REAR BUMPER REINFORCEMENT	Repair	528.75 FL	*- FL
4	1		*REAR BUMPER REVERSE LAMP	Serviceable	280.00 FL	*- FL
5	1		*REAR BUMPER RETAINER LH/RH	Serviceable	48.00 FL	*- FL
6	1		*REVERSE SENSOR X 4	Serviceable	180.00 FS	*- FS
7	1		*REAR BUMPER MAT	Necessary	50.00 FS	*50.00 FS
Supplementary #1						
8	1		*REAR BUMPER LINE RH STCKER	Necessary	40.00 FS	*40.00 FS
					Sub Total (\$\$)	3,938.75 2,902.00
					- List Item Discount on L Items 20.00/20.00% (\$\$)	733.75 562.40
					Total Parts (\$\$)	3,205.00 2,339.60

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	OD/TP Case (Insurer)	12.00	12.00
Sub Total (\$)			12.00	12.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	PANEL BEATING	New	900.00	450.00
2	SPRAY PAINTING	New	650.00	450.00
3	REMOVE/REFIX REVERSE SENSOR	New	60.00	30.00
Gross Labour Cost (\$)			1,610.00	930.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >