



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS FIRST CAPITAL INSURANCE LTD 16 RAFFLES QUAY #42-01 HONG LEONG BUILDINGSINGAPORE 048581			Ref: CD/FCI24120408/Kpa3q2(N) Date: 21/02/2025 Code: FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SH 9955T	Veh. Inspected	SLE 524L
	Policy No.	D-24101861MFCT	Coverage (\$)	0.00
	Claim No.	D25000047MFCT	Excess (\$)	0.00
	Assign From	KAREN TAN	Assign Date	27/12/2024
2. Vehicle Particulars & Condition				
	Make & Model	HONDA VEZEL (A)	c.c	1496
	Engine No.	HIDDEN	Year of Reg.	2016
	Chassis No.	RU11112703	Colour	METALLIC BLACK
	Odometer	332870 KM	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/60 R16	YOKOHAMA	8 mm
	L/H Front Tyre	215/60 R16	YOKOHAMA	8 mm
	R/H Rear Tyre	215/60 R16	YOKOHAMA	8 mm
	L/H Rear Tyre	215/60 R16	YOKOHAMA	8 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	25/12/2024	Inspection Date	30/12/2024
	Survey held at	YEW TEE AUTOMOBILE TECH PL BLK 25 KAKI BUKIT ROAD 4 #01-61 SYNERGY @ KAKI BUKIT SINGAPORE 417800		
5a. Remarks				
	A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		5 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLE 524L

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<u>REPLACEMENT OF PARTS</u>				
1	FRONT BUMPER	MTG CRACKED	982.70	762.70
1	FRONT BUMPER SIDE RETAINER LH	CRACKED	80.00	80.00
1	FRONT BUMPER SIDE RETAINER RH	SERVICEABLE	80.00	-
1	FRONT HEADLAMP LH	CRACKED	1,950.00	1,950.00
1	FRONT HEADLAMP LOWER BRACKET LH	SERVICEABLE	88.00	-
1	FRONT BONNET	BENT	1,150.00	992.30
1	FRONT BONNET HINGE LH	TO REPAIR SEE LABOUR	150.00	-
1	FRONT FENDER LH	BENT	680.00	582.00
1	FRONT FENDER INNER SHIELD LH	DISTORTED	260.00	132.00
1	FRONT FENDER WHEEL ARCH LH	CUT	271.00	195.00
1	FRONT DOOR LH	BENT	1,250.00	980.00
1	FRONT DOOR OUTER HANDLE CHROME LH	DENTED	260.00	260.00
1	FRONT DOOR OUTER HANDLE CHROME CAP LH	DENTED	80.00	80.00
1	FRONT DOOR LOCK LH	TO REPAIR SEE LABOUR	338.00	-
1	FRONT DOOR GLASS OUTER MOULDING LH	CUT	150.00	150.00
1	FRONT SIDE MIRROR LH	CRACKED	880.00	780.00
1	FRONT SIDE MIRROR COVER LH	CRACKED	230.00	95.00
1	FRONT SIDE MIRROR GLASS LH	CRACKED	120.00	120.00
1	REAR DOOR LH	TO REPAIR SEE LABOUR	1,270.00	-
1	FRONT BUMPER LOWER (ADDITIONAL)	DENTED / CUT	580.00	321.70
	LESS 20% DISCOUNT		-2,169.94	-1,496.14
			8,679.76	5,984.56
<u>SPECIAL NETT ITEMS</u>				
10	FRONT BUMPER CLIPS (SN)	NECESSARY	35.00	35.00
10	FRONT FENDER INNER SHIELD CLIPS LH (SN)	NECESSARY	25.00	25.00
10	FRONT FENDER WHEEL ARCH CLIPS LH (SN)	NECESSARY	25.00	25.00
10	FRONT BONNET INSULATION CLIPS (SN)	NOT NECESSARY	35.00	-
1	FRONT DOOR STICKER BLACK CENTER (SN)	NECESSARY	80.00	80.00
1	FRONT DOOR STICKER BLACK UPPER (SN)	NOT NECESSARY	80.00	-
			280.00	165.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TO DISCONNECT AND RECONNECT CHECK ELECTRICAL WIRING HARNESS WIRE, SOCKETS ,REPLACE DAMAGED PARTS.		60.00	20.00
	TO DISMANTLE AND REFIT FRONT DOOR GLASS .}		100.00	60.00
	TO TRANSFER DOOR .}		200.00	-
	TO RESET POWER WINDOW .	NOT NECESSARY	120.00	-
	TO REMOVE & REPLACE THE ABOVE DAMAGED PARTS ,STRAIGHTEN KNOCK OUT REALIGN & REPAIR INCLUDING CUT & WELD BODY PANELS .TO READJUST TO THE ORIGINAL POSITION USING POWER TOOLS.INCLUSIVE OF THE REPAIR OF FRONT BONNET HINGE LH ,FRONT DOOR LOCK LH AND REAR DOOR LH.		1,800.00	600.00
	TO SPRAY PAINTING ON THE REPLACED & REPAIR PARTS ,PREPARE SPRAY SUCH AS MASKING ,FINAL POLISING & WAXING ARE ALSO AVAILABLE.		1,600.00	1,000.00
			3,880.00	1,680.00
	GRAND TOTAL		12,839.76	7,829.56

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,250.00
---	--	--	-----------------

Report Ref No. CD/FCI24120408/Kpa3q2(N)

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 1 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 2 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 3 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 4 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933


TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 5 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L



PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L

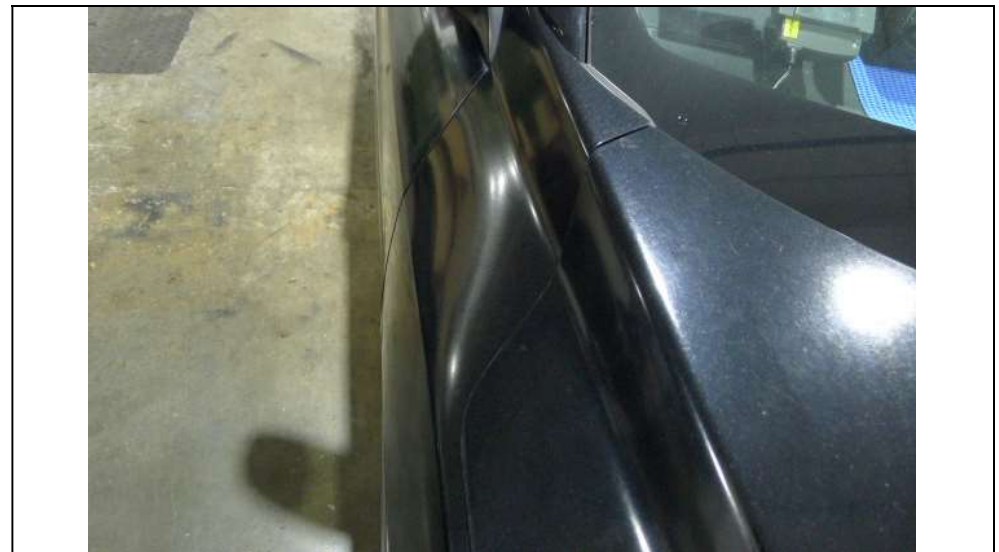



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

INSPECTION PHOTOS (Page 7 of 7)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

REINSPECTION PHOTOS (Page 1 of 1)

PHOTOGRAPHS FOR VEHICLE NO. : SLE 524L

