



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO SJK 2356J

REPLACEMENT OF PARTS				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	HEADLIGHT (L/H)	CUT	\$738.20	\$525.00
1	FOG LIGHT (L/H)	NOT NECESSARY	\$463.70	\$0.00
1	FOG LIGHT GARNISH	CUT	\$146.60	\$146.60
1	MOULDING (CHROME) (FOG LIGHT)	MISSING	\$160.25	\$160.25
1	FENDER (L/H/F)	BUCKLED	\$951.80	\$487.00
1	FENDER INNER GARNISH (L/H/F)	TORN	\$249.35	\$138.00
10	FENDER INNER GARNISH CLIP @\$12.80	NECESSARY	\$128.00	\$30.00
1	EMBLEM "VVTI"	NECESSARY	\$50.10	\$50.10
1	FRONT BUMPER	DEFORMED	\$810.20	\$545.00
10	BUMPER CLIP @\$13.35	NECESSARY	\$133.50	\$30.00
1	BUMPER SIDE RETAINER (L/H/F)	CRACKED	\$98.50	\$35.00
1	FRONT BUMPER REINFORCEMENT	NOT NECESSARY	\$398.00	\$0.00
1	SUPPORT PANEL (L/H) (TOP)	NOT NECESSARY	\$144.87	\$0.00
1	SHOCK ABSORBER (L/H/F)	NOT NECESSARY	\$351.22	\$0.00
1	SHOCK ABSORBER MOUNTING (L/H/F)	NOT NECESSARY	\$229.35	\$0.00
1	LOWER ARM (L/H/F)	BENT	\$577.45	\$364.00
1	STEERING KNUCKLE (FRONT) (L/H)	DAMAGED	\$622.35	\$442.00
1	FRONT WHEEL BEARING	DAMAGED	\$294.10	\$294.10
	<b>LESS 25.00% DISCOUNT</b>		(\$1,636.89)	(\$811.76)
			\$4,910.65	\$2,435.29
Special Nett				
Qty	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
1	SPORTS RIM (SN)	CUT	\$300.00	\$300.00
1	TYRE (SN)	NOT NECESSARY	\$180.00	\$0.00
			\$480.00	\$300.00
Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	PANEL BEAT & REPAIR FRONT DAMAGE		\$800.00	\$500.00
	TO PUTTY AND RE-SPRAY AFFECTED PORTION		\$900.00	\$600.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,  
Singapore 408933  
TEL: 6256 3561 FAX: 6256 4315  
Reg. No: 199607198R GST Reg. No.  
19-9607198-R

Labour				
	Description of Parts	Condition	Workshop Estimate (\$)	Our Adjusted (\$)
	TO CHECK WIRING SYSTEM, FOCUS LIGHTINGS		\$60.00	\$30.00
	TO PROVIDE UNDER TURFCODE		\$120.00	\$30.00
	TO CHECK UNDERCARRIAGE AND REPLACE DAMAGED PARTS		\$300.00	\$180.00
	TO COMPUTERISE ADJUST WHEEL ALIGNMENT		\$100.00	\$80.00
			\$2,280.00	\$1,420.00
GRAND TOTAL			\$7,670.65	\$4,155.29
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			\$3,300.00
Report Ref No: CS/FCI24070115/Aqp3				

MARKET VALUE: \$45,000.00 (EST)-LTA REIMBURSEMENT VALUE: \$12,911.00=NETT VALUE: \$32,089.00

**LWP**

ADRIAN LING WAI PING

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of reposibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.