



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SNR 4751D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER	TO REPAIR SEE LABOUR	1,699.79	-
1	BUMPER RETAINER LH	NOT NECESSARY	99.87	-
10	BUMPER CLIPS	NOT NECESSARY	66.00	-
1	FRONT FENDER LH	BUCKLED	800.21	800.21
1	FRONT FENDER COWLING LH	CUT	233.96	233.96
1	FRONT LH DOOR	BENT	2,000.55	2,000.55
1	FRONT LH DOOR LOCK	NOT NECESSARY	688.33	-
2	FRONT LH DOOR HINGES	BENT	361.60	361.60
1	FRONT LH DOOR STOPPER	NECESSARY	60.67	60.67
1	FRONT LH DOOR WEATHERSTRIPE	NECESSARY	249.99	249.99
1	FRONT LH DOOR BODY WEATHERSTRIPE	NOT NECESSARY	388.96	-
1	FRONT LH DOOR INSULATOR	NOT NECESSARY	233.54	-
1	FRONT LH DOOR MOULDING	DEFORMED	250.75	250.75
1	FRONT LH WINGMIRROR ASSY	BROKEN	1,400.54	1,028.76
1	FRONT LH DOOR 1/4 GLASS MOULDING	DEFORMED	388.55	388.55
1	BRAKE CALIPER LH	NOT NECESSARY	599.79	-
1	KNUCKLE LH	BENT	688.54	631.60
1	LOWER ARM LH	BENT	400.54	400.54
1	BALL JOINT LH	BENT	199.54	199.54
	LESS 10% DISCOUNT		-1,081.17	-660.67
			9,730.55	5,946.05
<b><u>LABOUR</u></b>				
	TO REMOVE & REPLACE FRONT BUMPER, HEADLAMP, FENDER, FRONT LH DOOR AND TO PANEL BEAT AND ALIGN FRONT CHASSIS FRAME. INCLUSIVE OF THE REPAIR OF FRONT BUMPER.		2,000.00	600.00
	TO PUTTY & SPRAY FRONT BUMPER, FENDER, FRONT LH DOOR & OTHER AFFECTED AREA.		1,000.00	600.00
	TO CHECK & RECTIFY WIRING & FOCUS HEADLAMPS.		80.00	30.00
	TO TRANSFER MECHANISM PARTS AND GLASSES TO NEW DOOR.		200.00	100.00

Report Ref No. CS/LIP24070143/Unh3e2(N)



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REMOVE & REPLACE UNDERCARRIAGE PARTS @ LOWER ARM, KNUCKLE....	NOT NECESSARY	380.00	150.00
	COMPUTERISE WHEEL ALIGNMENT.		60.00	-
	TUFF KOTE.		350.00	80.00
			4,070.00	1,560.00
GRAND TOTAL			13,800.55	7,506.05

RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,000.00
--	--	--	----------

Report Ref No. CS/LIP24070143/Unh3e2(N)

MARKET VALUE: \$24,000.00 (EST)-LTA REIMBURSEMENT VALUE: \$14,927.00=NETT VALUE: \$9,073.00

CHUA KANG SENG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.