

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/ICS24070247/KVP3E2**Date:** 08/08/2024REFERENCE

Handling Insurer: ECICS Limited Policy No:

Claimant Vehicle No : GBG5010C **Insured Vehicle No :** SLN9940L

Date of Loss: 12/07/2024 Nature of Claim: TP Claim No: DMPC2400881H/02/CT

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **GBG5010C**

Make & Model: VOLKSWAGEN CADDY TDI, 2.0 D (M) Engine No: DFS219720

Reg. Date: 22/08/2017 (Man. Year: 2017) Chassis No: WV1ZZZ2KZXH162112

Colour: Red Odometer: 143905 km

Engine Capacity: 1968 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/65 R15 Rear Tyre Size: 195/65 R15

Front Left Side: Michelin 9 mm Rear Left Side: Michelin 9 mm

Front Right Side: Michelin 9 mm Rear Right Side: Michelin 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,583.68	3,583.68	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	940.00	800.00	140.00	14.89
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,523.68	4,383.68	140.00	3.09
+ GST 9.00/9.00% (S\$)	407.13	394.53	12.60	3.09
Nett Amount (S\$)	4,930.81	4,778.21	152.60	3.09

INSPECTION

Date of Assignment: 17/07/2024

Date Inspected: 19/07/2024 Inspected At: Lai Huat (Meng Kee) Motor Pte Ltd (Sin Ming)
160 Sin Ming Drive #04-01, Sin Ming AutoCity
Singapore 575722

Estimated Period of Repair: 3.0 days

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

Reference

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Total Parts (S\$)	3,583.68	3,583.68
--------------------------	-----------------	-----------------

https://singapore.merimen.com/claims/index.cfm?fusebox=MTRadjuster&fuseaction=gen_printprt&caseid=1436023&extid=458143&CFID=322351&CF... 2/3

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	COMPUTERISED WHEEL ALIGNMENT	New	60.00	0.00
2	TO KNOCK DENTS ON FRONT FENDER BRACKET LH AND RENEW PARTS	New	400.00	360.00
3	TO SPRAY PAINT	New	400.00	360.00
4	TO CHECK / CLEAR FAULT CODES AFTER REPAIR	New	80.00	80.00
Gross Labour Cost (S\$)			940.00	800.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >