

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORTECICS Limited
10 Eunus Road 8, #09-04A Singapore Post Centre
Singapore 408600**Our File No:** CS/ICS24070272/KQP3E2
Date: 15/08/2024REFERENCEInsured/Claimant: CHAN HUI CHONG,JOSEPH (CHEN HUIZHONG) Policy No: MPC24A00044600
Date of Loss: 15/07/2024 Nature of Claim: OD Claim No: DMPC2400891H/STDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SLP7935E**
Make & Model: MAZDA 3, 1.5 L 4-DOOR SEDAN SP.6EAT (A) Engine No: P520334832
Reg. Date: 27/01/2016 (Man. Year: 2015) Chassis No: JM6BM42A8G0326560
Colour: Metallic Red Odometer: 144413 km
Engine Capacity: 1496 cc
Market Value/New Car Price: S\$25,000.00
Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEYGeneral Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:CONDITION OF TYRESFront Tyre Size: 225/45Z R17 Rear Tyre Size: 225/45Z R17
Front Left Side: Michelin 4 mm Rear Left Side: Michelin 5 mm
Front Right Side: Michelin 4 mm Rear Right Side: Michelin 5 mm*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,146.00	2,508.00	638.00	20.28
Miscellaneous Items	0.00	0.00	0.00	
Labour	860.00	420.00	440.00	51.16
Paintwork Labour	680.00	400.00	280.00	41.18
Towing	0.00	0.00	0.00	
Gross Total (S\$)	4,686.00	3,328.00	1,358.00	28.98
+ GST 9.00/9.00% (S\$)	421.74	299.52	122.22	28.98
Nett Amount (S\$)	5,107.74	3,627.52	1,480.22	28.98

INSPECTIONDate of Assignment: 17/07/2024 Present Location: Vin's Motor Pte Ltd (Sin Ming)
Date Inspected: 17/07/2024 Inspected At: 160 Sin Ming Drive #08-09 Sin Ming Autocity
Estimated Period of Repair: 4.0 days Repairer: Vin's Motor Pte Ltd**Adjuster:** KENNETH KONG**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 15 Aug 2024)
Parts:	143	MAZDA 3 1.5 L 4-DOOR SEDAN SP.6EAT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLP7935E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*RH HEADLAMP (WCP)	Broken	1,300.00 F	*1,300.00 F
2	1		*FRONT BUMPER (WCP)	Buckled/Dented	480.00 F	*480.00 F
3	1		*FRONT BUMPER RH NOZZIE GUN (WCP)	Cracked	140.00 F	*140.00 F
4	1		*FRONT BUMPER RH NOZZIE GUN COVER (WCP)	Missing	60.00 F	*60.00 F
5	1		*FRONT BUMPER RH SIGNAL LIGHT (WCP)	Serviceable	90.00 F	-
6	1		*FRONT BUMPER RH FOG LAMP (WCP)	Serviceable	200.00 F	-
7	1		*FRONT BUMPER RH FOG LAMP COVER (WCP)	Cut	30.00 F	*30.00 F
8	1		*FRONT BUMPER RH SIDE RETAINER (WCP)	Distorted	10.00 F	*10.00 F
9	1		*FRONT BUMPER REINFORCEMENT (WCP)	Repair	270.00 F	-
10	10		*FRONT BUMPER CLIPS (WCP)	Necessary	20.00 F	*20.00 F
11	1		*WIPER TANK (WCP)	Dented	60.00 F	*60.00 F
12	1		*WIPER TANK CAP (MISSING)(WCP)	Not Consistent With The Impact	20.00 F	-
13	1		*FRONT RH FENDER (WCP)	Buckled	180.00 F	*180.00 F

F=Franchise part.

Sub Total (\$)	2,860.00	2,280.00
+ Margin on L,N Items 10.00/10.00% (\$)	286.00	228.00
Total Parts (\$)	3,146.00	2,508.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	TO SPRAY PAINTING	New	680.00	400.00
<u>Labour Items</u>				
2	TO RESET HEADLAMP SYSTEM	New	280.00	20.00
3	TO REPAIR DAMAGES	New	580.00	400.00
Gross Labour Cost (S\$)			1,540.00	820.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >