



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

| | | |
|-----------------------------------|-------|---------------------|
| MS MS FIRST CAPITAL INSURANCE LTD | Ref: | CS/FCI24070375/Uqp3 |
| 16 RAFFLES QUAY | Date: | 12/08/2024 |
| #42-01 HONG LEONG BUILDING | Code: | FCI2 |
| SINGAPORE 048581 | | |

1. Policy Particulars :- THIRD PARTY CLAIM

| | | | |
|--------------|----------------|----------------|------------|
| Insured Veh. | SHC 7903M | Veh. Inspected | SKH 864B |
| Policy No. | D-24101860MFCT | Coverage | 0 |
| Claim No. | D24006417MFCT | Excess | \$0.00 |
| Assign From | BETTY | Assign Date | 23/07/2024 |

2. Vehicle Details

| | | | |
|-----------------|-------------------------|--------------|------------|
| Make & Model | MERCEDES BENZ C 180 (A) | C.C | 1595 |
| Engine No. | 27491030017337 | Year of Reg. | 01/11/2012 |
| Chassis No. | WDD2040312A771958 | Colour | SILVER |
| Odometer | 122172 KM | Steering | IN ORDER |
| Brakes | IN ORDER | General | GOOD |
| Modification(s) | RIMS: SPORTS RIM | | |

3. Conditions of Tyres

| | Size | Make | Balance (mm) |
|----------------|-----------|----------|--------------|
| R/H Front Tyre | 225/40R18 | GOODYEAR | 6 |
| L/H Front Tyre | 225/40R18 | GOODYEAR | 6 |
| R/H Rear Tyre | 225/40R18 | GOODYEAR | 6 |
| L/H Rear Tyre | 225/40R18 | GOODYEAR | 6 |

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION.

DAMAGES SEE DETAILS.

5. General Information

| | | | |
|----------------|--|-----------------|------------|
| Accident Date | 20/07/2024 | Inspection Date | 25/07/2024 |
| Survey held at | AUTOBAY PTE LTD NO. 1 KAKI BUKIT AVE 6 #02-11 SINGAPORE 417883 | | |

5a. Remarks

A) DAMAGES CONSISTENT TO ACCIDENT REPORT.
B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: 4 Working Days