

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park  
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/ICS24060071/RNH3E2  
**Date:** 01/08/2024REFERENCE

Handling Insurer:	ECICS Limited	Policy No:	
<b>Claimant Vehicle No :</b>	SMJ3012P	<b>Insured Vehicle No :</b>	SJL1155Z
Date of Loss:	11/06/2024	Nature of Claim:	TP
		Claim No:	DMPC2400731H/ST

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>SMJ3012P</b>		
Make & Model:	AUDI A3 SPORTBACK, 999cc TFSI S TRONIC (LED) (A)	Engine No:	CHZC38944
Reg. Date:	23/03/2020 (Man. Year: 2019)	Chassis No:	WAUZZZ8V6LA049703
Colour:	White	Odometer:	71357 km
Engine Capacity:	999 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/55 R16	Rear Tyre Size:	205/55 R16
Front Left Side:	Pirelli 6 mm	Rear Left Side:	Pirelli 6 mm
Front Right Side:	Pirelli 6 mm	Rear Right Side:	Pirelli 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	45,634.00	24,054.80	21,579.20	47.29
Miscellaneous Items	0.00	0.00	0.00	
Labour	24,590.00	16,240.00	8,350.00	33.96
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Gross Total (\$\$)</b>	<b>70,224.00</b>	<b>40,294.80</b>	<b>29,929.20</b>	<b>42.62</b>
<b>+ GST 9.00/9.00% (\$\$)</b>	<b>6,320.16</b>	<b>3,626.53</b>	<b>2,693.63</b>	<b>42.62</b>
<b>Nett Amount (\$\$)</b>	<b>76,544.16</b>	<b>43,921.33</b>	<b>32,622.83</b>	<b>42.62</b>

INSPECTION

Date of Assignment:	12/06/2024		
Date Inspected:	13/06/2024	Inspected At:	24 Benoi Sector Repairer: Premium Automobiles Pte Ltd
Estimated Period of Repair:	11.0 days		

**Adjuster:** MOHD RASUL**Manager:** HUEY YON*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	MRM-SG	Version: 1.0 (Last Synchronised: 01 Aug 2024)
<b>Parts:</b>	144	AUDI A3 SPORTBACK 999cc TFSI S TRONIC (LED) (A) (Catalogue:Merimen Singapore 1.0)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SMJ3012P)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Torn	2,411.00 FS	*2,411.00 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	209.00 FS	*- FS
3	1		*FRONT BUMPER GUIDE SECTION - LH	Missing	49.00 FS	*48.20 FS
4	1		*FRONT BUMPER GRILLE - CENTER	Cracked	201.00 FS	*201.00 FS
5	1		*FRONT BUMPER CLOSING ELEMENT - LOWER CENTRE	Cracked	373.00 FS	*373.00 FS
6	1		*FRONT BUMPER CLOSING ELEMENT - LH	Missing	357.00 FS	*357.00 FS
7	1		*RADIATOR GRILLE	Cracked	1,784.00 FS	*1,784.00 FS
8	1		*RADIATOR GRILLE CLOSING ELEMENT	Cracked	235.00 FS	*234.50 FS
9	1		*CAUTION SIGN STICKER	Necessary	25.00 FS	*24.30 FS
10	1		*AIR CONDITIONER STICKER	Necessary	10.00 FS	*9.40 FS
11	1		*FRONT BUMPER AIR GUIDE GRILLE - LH	Cracked	236.00 FS	*235.50 FS
12	1		*FRONT BUMPER REINFORCEMENT BEAM COVER	Cracked	153.00 FS	*153.00 FS
13	1		*FRONT BUMPER FOAM FILLER PIECE	Cracked	237.00 FS	*237.00 FS
14	1		*FRONT BUMPER SIDE REINFORCEMENT BEAM	Bent	1,055.00 FS	*1,055.00 FS
15	1		*OUTSIDE TEMPERATURE SENSOR BRACKET	Necessary	30.00 FS	*30.00 FS
16	1		*HEADLIGHT - LH	Broken	6,647.00 FS	*6,647.00 FS
17	1		*HEADLIGHT POWER MODULE - LH	Shorted	904.00 FS	*903.50 FS
18	1		*HEADLIGHT CONTROL UNIT	Shorted	664.00 FS	*663.50 FS
19	1		*HEADLIGHT HEAT SINK - LH	Shorted	924.00 FS	*923.50 FS
20	1		*LIFT CYLINDER - LH	Cracked	170.00 FS	*170.00 FS
21	1		*LIFT CYLINDER HOSE	Cut	86.00 FS	*85.70 FS
22	1		*BONNET	Bent	3,418.00 FS	*3,418.00 FS
23	1		*BONNET ATTACHMENT PARTS	Not Necessary	184.00 FS	*- FS
24	2		*BONNET HINGE - LH / RH	Bent	150.00 FS	*74.40 FS
25	1		*BONNET SIDE SEAL COVER - LH	Cracked	53.00 FS	*52.90 FS
26	1		*BONNET STOP BUFFER	Necessary	8.00 FS	*8.00 FS
27	1		*BONNET GAS FILLED STRUT	Serviceable	123.00 FS	*- FS
28	1		*BONNET EDGE PROTECTION	Necessary	35.00 FS	*34.80 FS
29	1		*BONNET CATCH HOOK	Bent	116.00 FS	*116.00 FS
30	1		*BONNET STRIKER - LH / RH	N/S Bent / O/S Not Necessary	274.00 FS	*137.00 FS
31	1		*BONNET CATCH HOOK	Serviceable	79.00 FS	*- FS
32	1		*BONNET LOCK WITH MICRO - SWITCH - LH / RH	N/S NotWorking/O/SNotNecessary	491.00 FS	*245.50 FS
33	1		*BONNET RELEASE CABLE COVER	Serviceable	12.00 FS	*- FS
34	1		*BONNET BOWDEN CABLE - CENTER	Serviceable	71.00 FS	*- FS
35	1		*BONNET HINGE SOUND ABSORBER	Serviceable	275.00 FS	*- FS
36	1		*FRONT PLENUM CHAMBER COVER	Serviceable	296.00 FS	*- FS
37	1		*FRONT FENDER - LH	Buckled	1,016.00 FS	*1,016.00 FS
38	1		*FRONT FENDER ATTACHMENT PARTS	Not Necessary	85.00 FS	*- FS
39	1		*FRONT FENDER BRACKET - LH REAR	Bent	45.00 FS	*44.10 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	1		*FRONT FENDER BRACKET - LH CENTER	Bent	74.00 FS	*73.30 FS
41	1		*FRONT FENDER RIVET	Necessary	34.00 FS	*33.60 FS
42	1		(8PCS) *FRONT FENDER INSULATION - LH	Serviceable	54.00 FS	*- FS
43	1		*FRONT FENDER CLOSING ELEMENT - LH	Cracked	42.00 FS	*41.10 FS
44	1		*FRONT FENDER SEAL - LH	Not Necessary	43.00 FS	*- FS
45	1		*FRONT FENDER BRACE	Bent	122.00 FS	*121.50 FS
46	1		*FRONT FENDER CLOSING ELEMENT - LH	Cracked	76.00 FS	*76.00 FS
47	1		*FRONT WHEEL HOUSING LINER - LH	Deformed	204.00 FS	*203.50 FS
48	1		*FRONT WHEEL HOUSING LINER ATTACHMENT PARTS	Not Necessary	67.00 FS	*- FS
49	1		*A-PILLAR CONNECTING PLATE - LH INNER	Serviceable	261.00 FS	*- FS
50	1		*LOCK CARRIER CLOSING ELEMENT - LH FRONT	Serviceable	106.00 FS	*- FS
51	1		*LOCK CARRIER	Cracked	908.00 FS	*907.50 FS
52	1		*RADIATOR AIR GUIDE - LH	Cracked	59.00 FS	*58.60 FS
53	1		*RADIATOR AIR GUIDE - RH	Serviceable	86.00 FS	*- FS
54	1		*RADIATOR AIR GUIDE SEAL - RH OUTER	Serviceable	10.00 FS	*- FS
55	1		*RADIATOR AIR GUIDE - UPPER CENTRE	Serviceable	21.00 FS	*- FS
56	1		*A/C CONDENSER WITH FLUID RESERVOIR	Serviceable	846.00 FS	*- FS
57	1		*A/C CONDENSER SEAL RING	Not Necessary	16.00 FS	*- FS
58	1		*A/C CONDENSER SEAL RING	Not Necessary	15.00 FS	*- FS
59	1		*ADDITIONAL RADIATOR	Serviceable	987.00 FS	*- FS
60	2		*RADIATOR BRACKET - LH / RH UPPER	Serviceable	94.00 FS	*- FS
61	2		*RADIATOR BUSH - LH / RH LOWER	Serviceable	24.00 FS	*- FS
62	1		*RADIATOR	Serviceable	1,177.00 FS	*- FS
63	6		*READY-MIX COOLANT	Necessary	332.00 FS	*331.80 FS
64	1		*RADIATOR FAN WITH FAN RING	Not Necessary	1,681.00 FS	*- FS
65	1		*WASH WATER RESERVOIR	Deformed	238.00 FS	*237.50 FS
66	1		*FRONT WINDSCREEN WASHER SYSTEM PUMP	Serviceable	147.00 FS	*- FS
67	1		*FRONT WINDSCREEN WASHER SYSTEM PUMP SEAL	Not Necessary	4.00 FS	*- FS
68	1		*FRONT WINDSCREEN WASHER SYSTEM PUMP ELBOW FITTING	Serviceable	16.00 FS	*- FS
69	1		*FRONT WINDOW SLOT SEAL CHROME TRIM STRIP - LH	Serviceable	335.00 FS	*- FS
70	1		*FRONT LOWER CONTROL ARM - LH	Not Necessary	422.00 FS	*- FS
71	1		*FRONT STABILIZER	Not Necessary	479.00 FS	*- FS
72	1		*FRONT WHEEL BEARING HOUSING	Not Necessary	669.00 FS	*- FS
73	1		*FRONT WHEELHUB WITH BEARING	Not Necessary	554.00 FS	*- FS
74	1		*FRONT GUIDE JOINT	Not Necessary	145.00 FS	*- FS
75	1		*FRONT COUPLING ROD	Not Necessary	112.00 FS	*- FS
76	1		*FRONT DRIVE SHAFT WITH CONSTANT VELOCITY JOINTS - LH	Not Necessary	1,615.00 FS	*- FS
77	1		*FRONT GAS SHOCK ABSORBER	Not Necessary	301.00 FS	*- FS
78	1		*FRONT STEERING GEAR	Not Necessary	6,113.00 FS	*- FS
79	1		*SET FRONT STEERING BOX REPAIR	Not Necessary	28.00 FS	*- FS
80	1		*FRONT STEERING GEAR GREASE	Not Necessary	54.00 FS	*- FS
81	1		*FRONT TRACK ROD	Not Necessary	110.00 FS	*- FS
82	1		*FRONT TIE ROD END - LH	Not Necessary	138.00 FS	*- FS
83	1		*FRONT ASSEMBLY CARRIER	Not Necessary	1,309.00 FS	*- FS
84	1		*SET BONDED RUBBER BUSHES	Not Necessary	127.00 FS	*- FS
85	1		*FRONT NUMBER PLATE	Not Necessary	60.00 FS	*- FS
86	1		*METAL FILTER POWDER	Not Necessary	280.00 FS	*- FS
87	1		*ACRYLIC SEALANT	Not Necessary	180.00 FS	*- FS
88	1		*STONE CHIP	Not Necessary	180.00 FS	*- FS
89	1		*CAVITY WAX	Not Necessary	140.00 FS	*- FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
90	1		*SUNDRIES	Necessary	800.00 FS	*39.10 FS
91	1		*NOTICE FOR VEHICLES WITH AUXILIARY HEATER	Serviceable	9.00 FS	*- FS
92	1		*HORN HIGH TONE - LH	Cracked	239.00 FS	*238.50 FS

F=Franchise part. S=SpcNett.

**Total Parts (\$)** 45,634.00 24,054.80

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	280.00
2	TO REMOVE AND RENEW AIRCON CONDENSER, RADIATOR AND ADDITIONAL RADIATOR, CHECK ELECTRICAL FANS AND CONTROL UNIT	New	1,800.00	1,800.00
3	TO CARRY OUT VACUUM AND REGAS FOR R134	New	600.00	600.00
4	TO REMOVE AND TRANSFER LHS WING MIRROR TO FACILITATE DOOR PAINTING	New	450.00	450.00
5	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, LHS FRONT FENDER AND LHS HEADLIGHT. TO RENEW FRONT LOCK CARRIER AND ALIGN TO POSITION. TO CUT OUT AND WELD LHS FRONT FENDER SUPPORT. TO REPAIR LHS A-PILLAR, LHS FRONT FENDER AND LHS SILL PANEL. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	10,800.00	6,300.00
6	TO RESPRAY FRONT BUMPER, BONNET, LHS FRONT FENDER, LHS FRONT DOOR, LHS A-PILLAR, LHS SILL PANEL AND LHS FRONT FENDER SUPPORT	New	6,300.00	6,050.00
7	TO REMOVE AND REINSTALL FRONT SUSPENSION. INSPECT FOR DAMAGES AND RENEW ACCORDINGLY	New	3,600.00	0.00
8	TO CARRY OUT COMPUTERISED WHEEL ALIGNMENT	New	280.00	280.00
9	TO CARRY OUT DIAGNOSTIC CHECK	New	480.00	480.00
<b>Gross Labour Cost (\$)</b>			<b>24,590.00</b>	<b>16,240.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >