



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Tax Invoice

STRIDES PREMIER AUTOMOTIVE SERVICES PL.
60 WOODLANDS INDUSTRIAL PARK E4
SINGAPORE 757705

INV No. : SAC2400437

INV Date : 29-08-2024

Reference CS3/SMR24080038/Eqp3m4

Code SMR

PROFESSIONAL SERVICE FEE

Vehicle No. FBN 444E

Insured Veh. SMB 1396L

Claim No. BUS/07/24/7021

Policy No.

Accident Date 26/07/2024

Inspection Date 02/08/2024

Description	Amount
Pre-Repair Survey	128.00
Sub-Total	128.00
GST (9%)	11.52
Grand Total	139.52

We shall be glad if you could forward the payment at your earliest convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

SML



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park,
Singapore 408933
TEL: 6256 3561 FAX: 6256 4315
Reg. No: 199607198R GST Reg. No.
19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
MS STRIDES PREMIER AUTOMOTIVE SERVICES PL. 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		Ref: Date: Code:	CS3/SMR24080038/Eqp3m4 29/08/2024 SMR	
1. Policy Particulars :- PRE-REPAIR SURVEY				
	Insured Veh.	SMB 1396L	Veh. Inspected	FBN 444E
	Policy No.	-	Coverage	0
	Claim No.	BUS/07/24/7021	Excess	\$0.00
	Assign From	HUA YEN	Assign Date	02/08/2024
2. Vehicle Details				
	Make & Model	YAMAHA SNIPER T150	C.C	150
	Engine No.	G3E6E0370078	Year of Reg.	25/06/2018
	Chassis No.	MH3UG0740J0094025	Colour	BLACK
	Odometer	48904 KM	Steering	IN ORDER
	Brakes	IN ORDER	General	FAIR
	Modification(s)	RIMS: SPORTS RIM		
3. Conditions of Tyres				
		Size	Make	Balance (mm)
	R/H Front Tyre	80/90-17	DIABLO	5
	L/H Front Tyre			
	R/H Rear Tyre	120/70-17	DIABLO	5
L/H Rear Tyre				
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION, O/S AND N/S BODY.				
5. General Information				
	Accident Date	26/07/2024	Inspection Date	02/08/2024 (17:04)
	Survey held at	RIGHT CLICK AUTOWORKS PTE LTD 7 SOON LEE STREET, #01-27, ISPACE, SINGAPORE 627608		
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE. C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS. D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$3,000-\$3,500				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR: 3 Working Days				

CTY

CHEN TSUE YEE

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.


PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

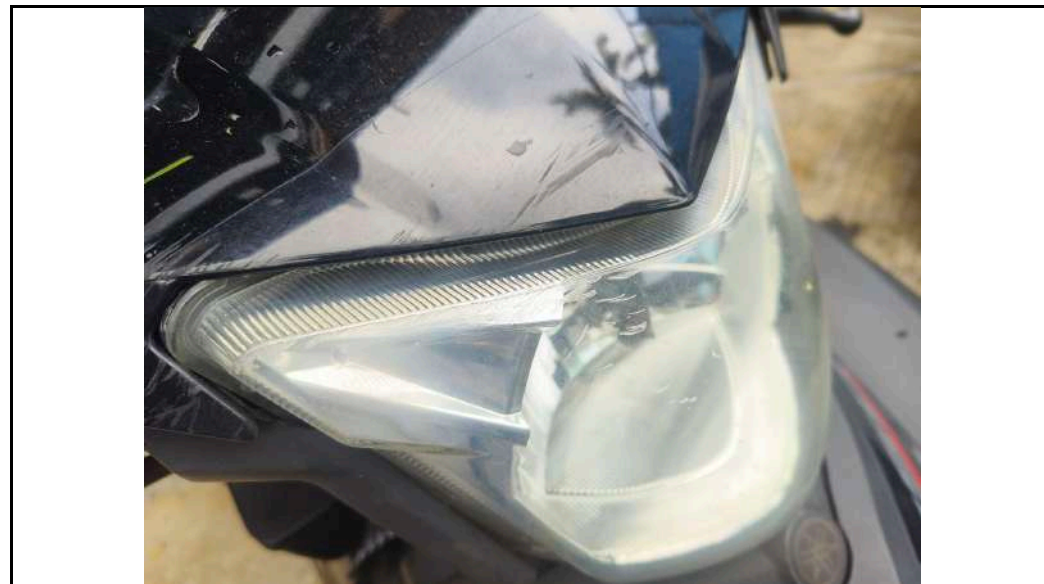

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E




PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

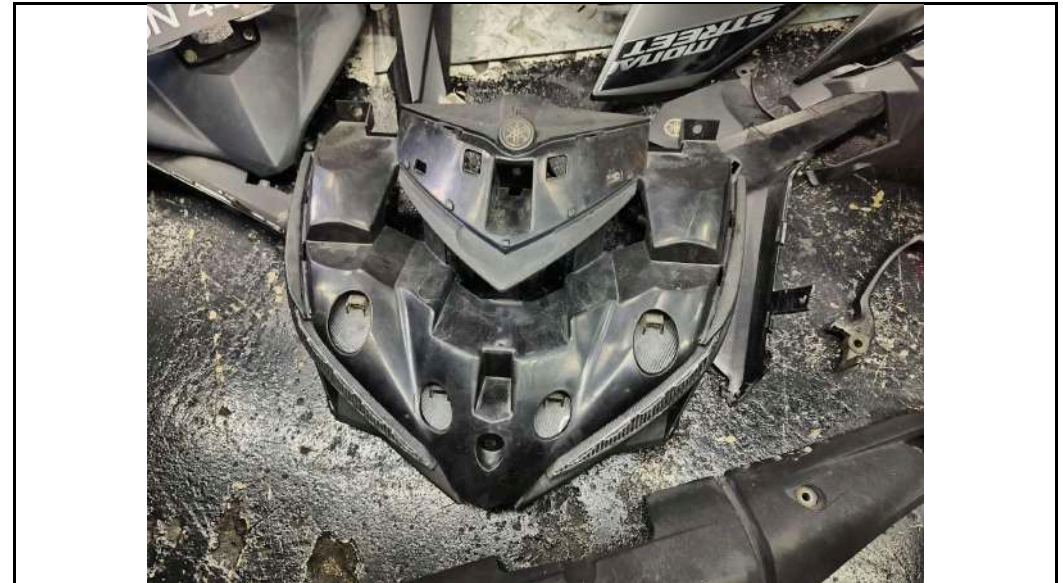

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E




PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E





PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E




PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

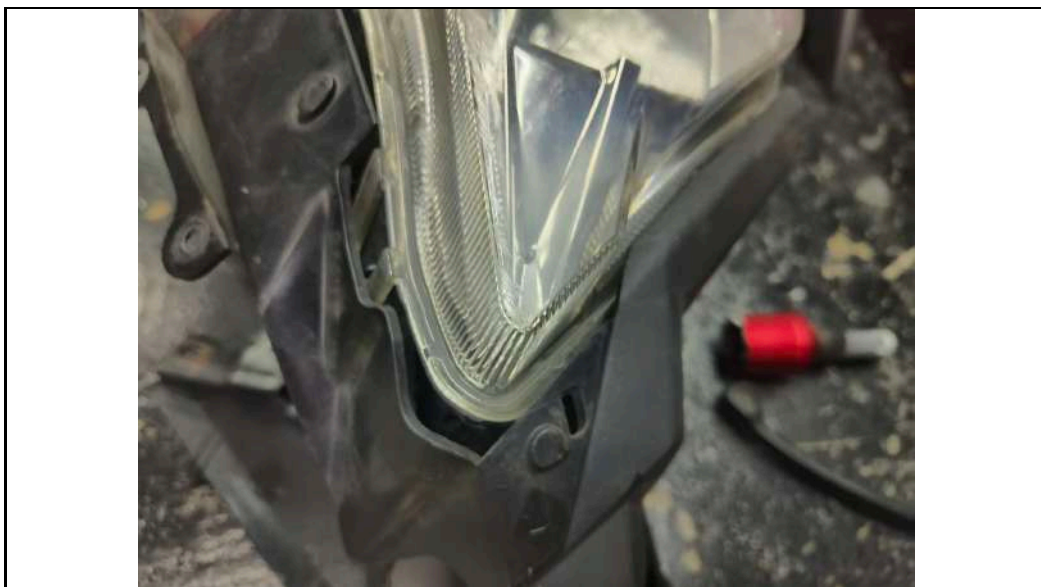

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

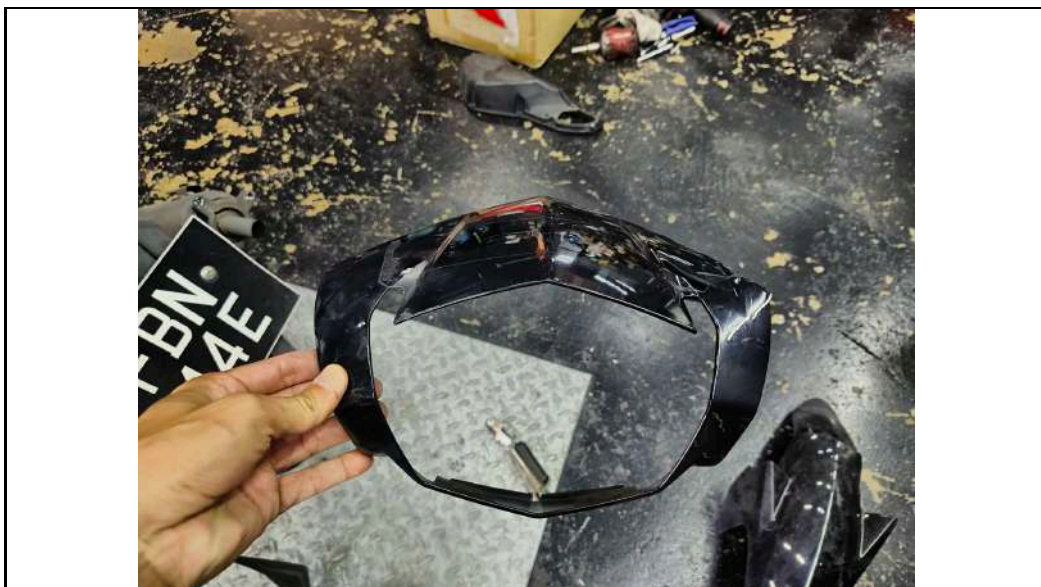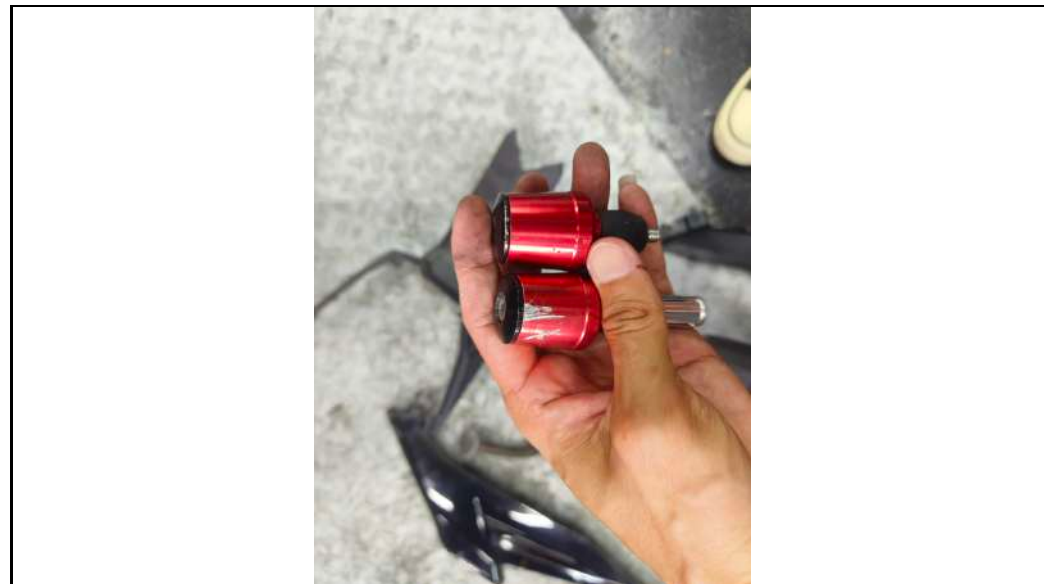


PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

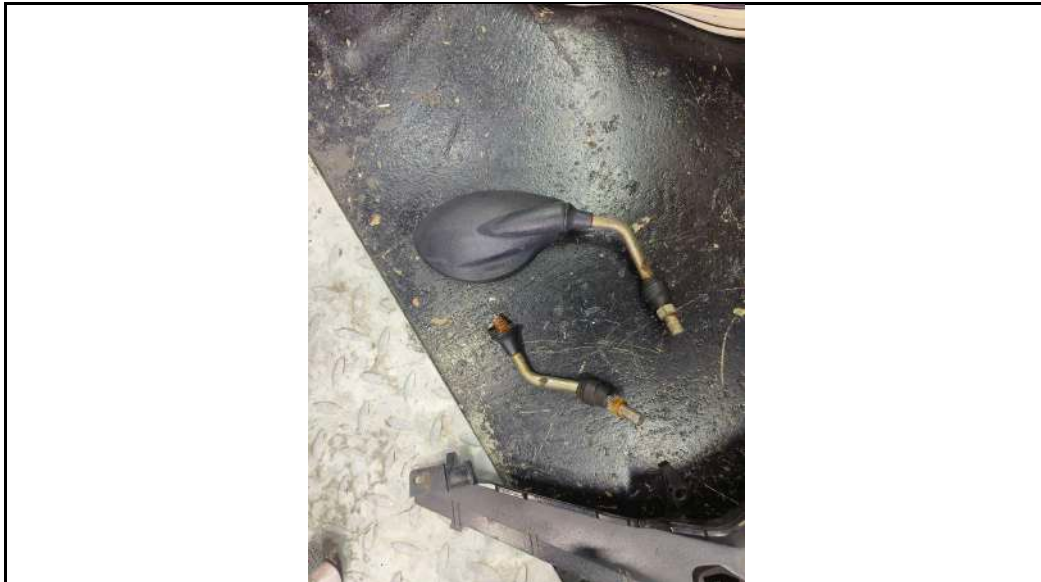

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

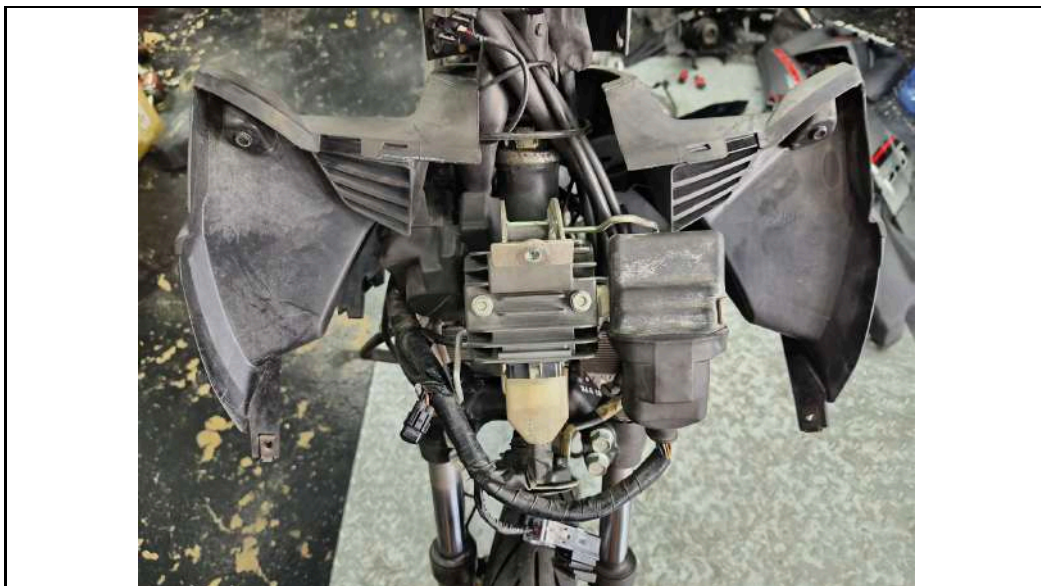

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E




PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E




PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

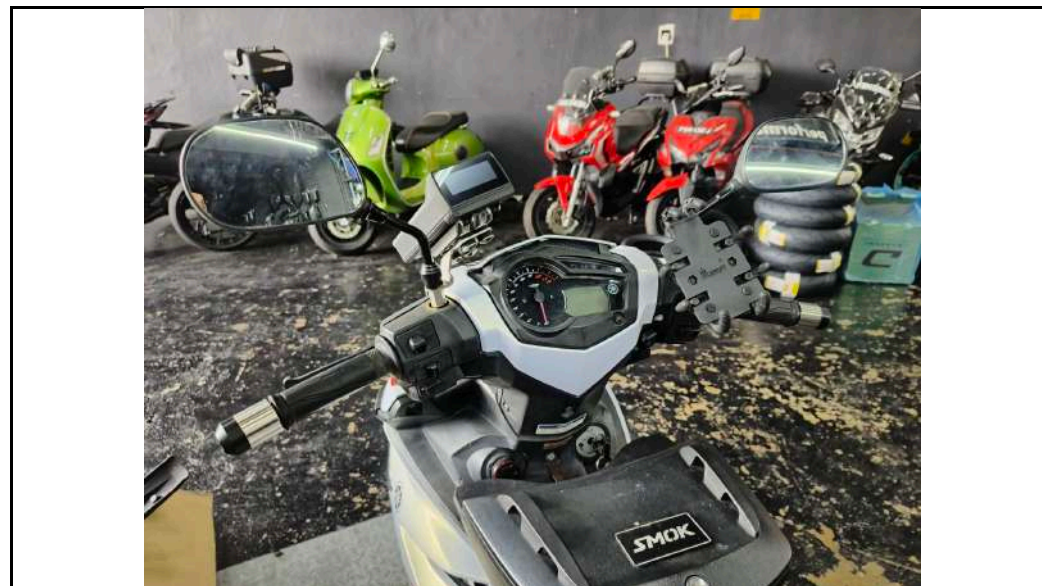


PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E



PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

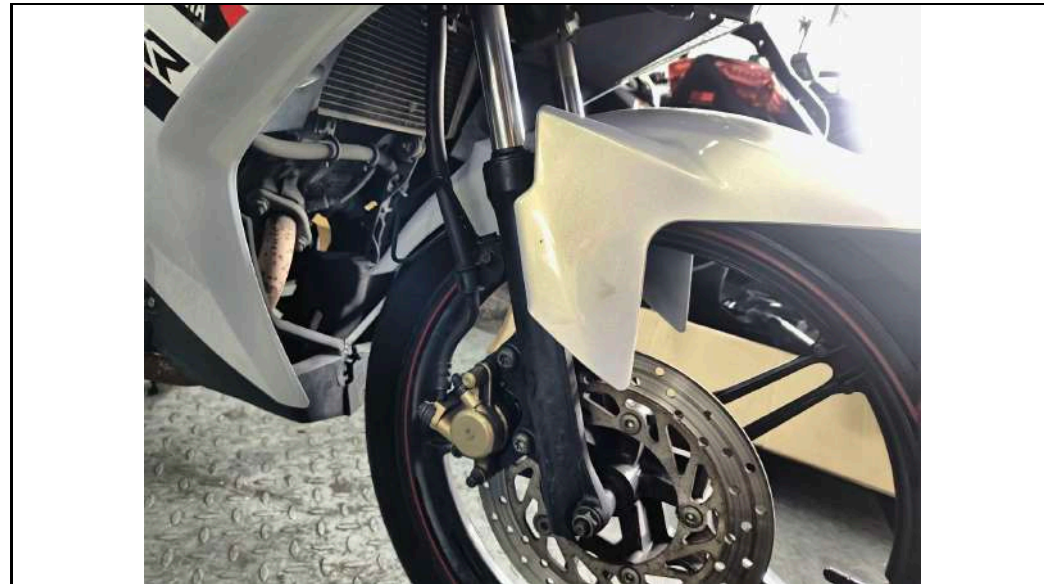

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

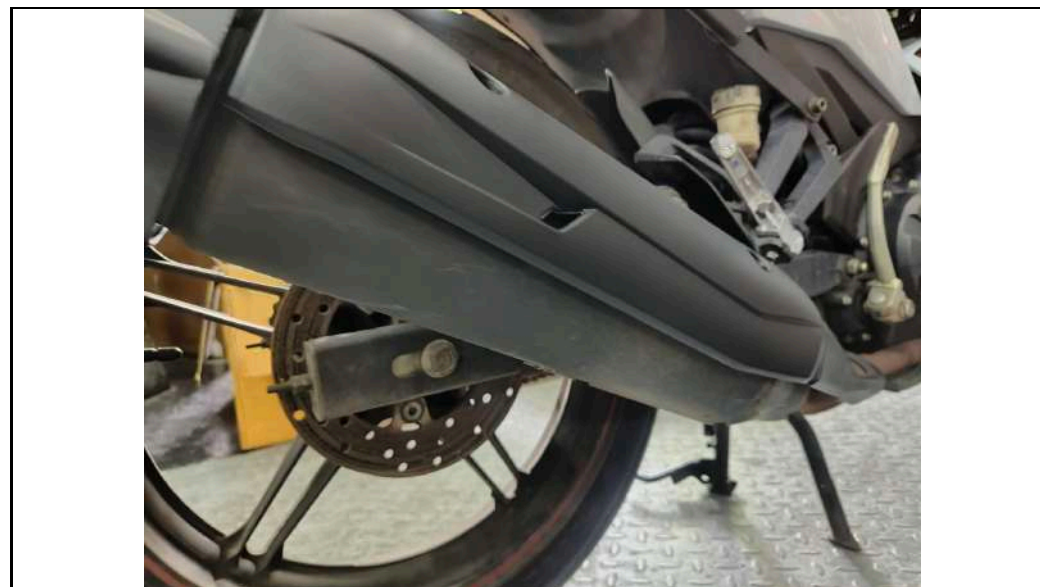

PHOTOGRAPHS FOR VEHICLE NO. : FBN 444E

