

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CS/AIG24080050/RVP3M4**Date:** 21/01/2025REFERENCE

Insured/Claimant: KAREN LEE LING LING (KAREN LI LINGLING)

Policy No: 1900246234

Date of Loss: 02/08/2024

Nature of Claim: OD Claim No: 4655146953SG

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SML1000B**

Make & Model: AUDI A1 SPORTBACK, 1.0 Advanced TFSI S-tronic (A)

Engine No: DKJ044794

Reg. Date: 21/11/2019 (Man. Year: 2019)

Chassis No: WAUZZZGB7LR005752

Colour: Green

Odometer: 11472 km

Engine Capacity: 999 cc

Market Value/New Car Price: S\$87,000.00

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 195/55R16

Rear Tyre Size: 195/55R16

Front Left Side: Goodyear 6 mm

Rear Left Side: Goodyear 6 mm

Front Right Side: Goodyear 6 mm

Rear Right Side: Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	21,501.00	12,068.88	9,432.12	43.87
Miscellaneous Items	0.00	0.00	0.00	
Labour	8,562.00	4,852.00	3,710.00	43.33
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	30,063.00	16,920.88	13,142.12	43.72
- Excess (S\$)	300.00	300.00	0.00	0.00
(S\$)	29,763.00	16,620.88	13,142.12	44.16
+ GST 9.00/9.00% (S\$)	2,678.67	1,495.88	1,182.79	44.16
Nett Amount (S\$)	32,441.67	18,116.76	14,324.91	44.16

INSPECTION

Date of Assignment: 05/08/2024

Date Inspected: 05/08/2024 Inspected At:

24 BENOI SECTOR, SINGAPORE 629857

REPAIRER: PREMIUM AUTOMOBILES PTE LTD

Estimated Period of Repair: 7.0 days

Adjuster: MOHD RASUL**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Torn	1,955.00 FS	*1,564.00 FS
2	1		*FRONT BUMPER FIXING PARTS	Not Necessary	160.00 FS	*- FS
3	1		*FRONT BUMPER SPOILER - LH	Scratched	126.00 FS	*100.40 FS
4	1		*FRONT BUMPER AIR GUIDE GRILLE - LH	Scratched	264.00 FS	*211.20 FS
5	1		*FRONT BUMPER CLOSING ELEMENT	Cracked	210.00 FS	*167.60 FS
6	2		*FRONT BUMPER GUIDE PROFILE - LH / RH	Cracked	90.00 FS	*35.92 FS
7	1		*LED HEADLIGHT - LH	Cracked	5,138.00 FS	*4,110.40 FS
8	1		*LIFT CYLINDER - LH	Serviceable	165.00 FS	*- FS
9	1		*LIFT CYLINDER HOSE	Cut	75.00 FS	*59.92 FS
10	2		*FRONT BUMPER GUIDE SECTION - LH / RH	Not Necessary	268.00 FS	*- FS
11	1		*FRONT FENDER - LH / RH	N/S Bent/ O/S Repair	2,324.00 FS	*929.60 FS
12	1		*FRONT FENDER ATTACHMENT PARTS - LH	Not Necessary	135.00 FS	*- FS
13	2		*FRONT FENDER BRACKET - LH / RH	Bent	144.00 FS	*57.52 FS
14	2		*FRONT FENDER BRACKET - LH / RH	Bent	34.00 FS	*13.28 FS
15	2		*FRONT FENDER BRACKET - LH / RH	Bent	92.00 FS	*36.32 FS
16	2		*FRONT FENDER BRACE - LH / RH	Bent	166.00 FS	*66.08 FS
17	2		*FRONT FENDER CLOSING ELEMENT - LH / RH	Not Necessary	84.00 FS	*- FS
18	2		*FRONT FENDER COVER - LH / RH	Not Necessary	56.00 FS	*- FS
19	1		*FRONT FENDER CLOSING ELEMENT - LH / RH	N/S Cracked/O/S Not Necessary	144.00 FS	*56.80 FS
20	1		*FRONT WHEEL HOUSING LINER - LH / RH	N/S Deformed/O/S Not Necessary	432.00 FS	*172.40 FS
21	1		*FRONT WHEEL HOUSING LINER ATTACHMENT- LH / RH	Not Necessary	77.00 FS	*- FS
22	1		*BONNET	Bent	2,840.00 FS	*2,272.00 FS
23	2		*BONNET HINGE - LH / RH	Bent	150.00 FS	*119.04 FS
24	2		*BONNET STRIKER - LH / RH	Bent	246.00 FS	*196.80 FS
25	1		*BONNET ATTACHMENT PARTS	Not Necessary	150.00 FS	*- FS
26	2		*BONNET IMPACT PROTECTION - LH / RH	Necessary	76.00 FS	*60.80 FS
27	1		*BONNET IMPACT PROTECTION - CENTER	Necessary	38.00 FS	*30.40 FS
28	1		*BONNET SEAL	Necessary	106.00 FS	*84.80 FS
29	1		*BONNET BOWDEN CABLE - CENTER	Serviceable	105.00 FS	*- FS
30	2		*BONNET BOWDEN CABLE - LH / RH	Serviceable	80.00 FS	*- FS
31	2		*BONNET LOCK WITH MICRO SWITCH - LH / RH	Serviceable	491.00 FS	*- FS
32	1		*BONNET BOWDEN CABLE - COVER	Serviceable	12.00 FS	*- FS
33	1		*PLENUM CHAMBER COVER	Serviceable	250.00 FS	*- FS
34	1		*PLENUM CHAMBER COVER SEAL - CENTER	Serviceable	92.00 FS	*- FS
35	2		*PLENUM CHAMBER COVER SEAL - LH / RH	Serviceable	310.00 FS	*- FS
36	1		*HORN - LH	Not Necessary	162.00 FS	*- FS
37	1		*WASH WATER RESERVOIR	Not Necessary	217.00 FS	*- FS
38	1		*WASH WATER FILLER NECK	Not Necessary	70.00 FS	*- FS
39	1		*WASH WATER SEAL RING	Not Necessary	8.00 FS	*- FS
40	1		*WASH WATER STRAINER	Not Necessary	26.00 FS	*- FS
41	1		*WASH WATER END CAP	Not Necessary	26.00 FS	*- FS
42	1		*FRONT ALUMINIUM RIM - LH	Not Necessary	1,251.00 FS	*- FS
43	1		*FRONT ALUMINIUM RIM RUBBER VALVE	Not Necessary	5.00 FS	*- FS
44	1		*SUNDRIES	Necessary	500.00 FS	*3.20 FS
45	1		*FRONT BUMPER TOP COVER (Supplementary)	Cracked	154.00 FS	*123.20 FS
46	1		*LHS HEADLIGHT HEAT SINK (Supplementary)	Cracked	896.00 FS	*716.80 FS
47	1		*LHS HEADLIGHT POWER MODULE (Supplementary)	Short	904.00 FS	*722.80 FS
48	1		*RADIATOR GRILLE CLOSING ELEMENT (Supplementary)	Cracked	197.00 FS	*157.60 FS

F=Franchise part. S=SpcNett.

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Total Parts (S\$)						21,501.00 12,068.88
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO TOW BACK THE VEHICLE FROM ACCIDENT SCENE	New	280.00	0.00
2	TO REMOVE, CHECK AND TRANSFER WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
3	TO REMOVE AND TRANSFER LHS HEADLIGHT CONTROL UNIT AND POWER MODULE	New	350.00	250.00
4	TO DISMANTLE AND RENEW FRONT BUMPER, BONNET, BOTH FRONT FENDERS AND BOTH HEADLIGHTS. RE-ORGANIZE CRASH MANAGEMENT. REINSTALL ALL PARTS REMOVED	New	3,500.00	1,750.00
5	TO RESPRAY FRONT BUMPER, BONNET, BOTH FRONT FENDERS AND BONNET HINGES	New	3,500.00	2,200.00
6	TO RENEW LHS FRONT RIM AND CARRY OUT WHEEL ALIGNMENT	New	280.00	0.00
7	TO CARRY OUT DIAGNOSTIC CHECK	New	292.00	292.00
Gross Labour Cost (\$\$)			8,562.00	4,852.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >