

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/MSG24080120/KVP3M4**Date:** 15/10/2024**REFERENCE**

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	30003159367
Claimant Vehicle No :	FBL3660M	Insured Vehicle No :	GBE5665Z
Date of Loss:	17/04/2024	Nature of Claim:	TP
		Claim No:	355897

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBL3660M	Engine No:	J409E074880
Make & Model:	YAMAHA TMAX530, 530cc CVT ABS	Chassis No:	JYASJ099000025042
Reg. Date:	16/09/2016 (Man. Year: 2016)	Odometer:	68481 km
Colour:	Black		
Engine Capacity:	530 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	120/70R15	Rear Tyre Size:	160/60R15
Front Left Side:	Pirelli 3 mm	Rear Left Side:	Pirelli 4 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,617.30	1,617.30	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,070.00	640.00	430.00	40.19
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,687.30	2,257.30	430.00	16.00
Approved Total (Overridden) (S\$)		1,800.00		
(S\$)	2,687.30	1,800.00	887.30	33.02
+ GST 9.00/9.00% (S\$)	241.86	162.00	79.86	33.02
Nett Amount (S\$)	2,929.16	1,962.00	967.16	33.02

INSPECTION

Date of Assignment:	07/08/2024		
Date Inspected:	12/08/2024	Inspected At:	SIN BOON MOTOR CO 10 ADMIRALTY STREET #01-10/11 NORTHLINK BUILDING SINGAPORE 757695
Estimated Period of Repair:	3.0 days		

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 07 Oct 2024)	
Parts:	N/A	YAMAHA TMAX530 530cc CVT ABS (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBL3660M)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*SET R/S MIRROR COVER	Dented/Cut	153.00 FL	*153.00 FL
2	1		*EXHAUST COVER	Bent	295.00 FL	*295.00 FL
3	1		*EXHAUST COVER SHORT	Cracked	204.00 FL	*204.00 FL
4	1		*R/S TAIL COVER	Cracked	216.00 FL	*216.00 FL
5	1		*R/S FOOT BOARD	Cracked	275.00 FL	*275.00 FL
6	1		*R/S LOWER COVER	Cracked	180.00 FL	*180.00 FL
7	1		*R/S CENTER COVER	Cracked	234.00 FL	*234.00 FL
8	1		*YAMAHA LOGO	Necessary	30.00 FL	*30.00 FL
9	1		*R/S TOP COVER	Cracked	210.00 FL	*210.00 FL
					Sub Total (\$\$)	1,797.00
					- List Item Discount on L Items 10.00/10.00% (\$\$)	179.70
					Total Parts (\$\$)	1,617.30

F=Franchise part. L=ListItemDisc.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TOW	New	120.00	40.00
2	RE-SPRAY	New	550.00	300.00
3	LABOUR CHARGE	New	400.00	300.00
Gross Labour Cost (\$\$)			1,070.00	640.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >