

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/AIG24080128/KNP3E2

Date: 28/08/2024

REFERENCE

Handling Insurer: AIG Asia Pacific Insurance Pte. Ltd. Policy No: 1800098561

Claimant Vehicle No : SKB1913T Insured Vehicle No : SKF3358L

Date of Loss: 02/08/2024 Nature of Claim: TP Claim No: 5276305165SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SKB1913T

Make & Model: TOYOTA C-HR HYBRID, 1.8 E G CVT (A) Engine No: 2ZR8245048

Reg. Date: 18/12/2017 (Man. Year: 2017) Chassis No: ZYX102086525

Colour: Metallic Red Odometer: 115438 km

Engine Capacity: 1797 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/50 R18 Rear Tyre Size: 225/50 R18

Front Left Side: Michelin 9 mm Rear Left Side: Michelin 9 mm

Front Right Side: Michelin 9 mm Rear Right Side: Michelin 9 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,195.02	4,524.90	670.12	12.90
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,860.00	1,510.00	350.00	18.82
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	7,055.02	6,034.90	1,020.12	14.46

INSPECTION

Date of Assignment: 07/08/2024

Date Inspected: 06/08/2024 Inspected At: Rc Auto-160 Sin Ming (HQ)
160 SIN MING DRIVE, #06-20 SIN MING AUTOCITY
Singapore 575722

Estimated Period of Repair: 5.0 days

Adjuster: KENNETH KONG

Manager: HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BOOTLID	Bent	1,207.75 FL	*1,112.45 FL
2	1		*REAR BUMPER LOWER	Bent	463.60 FL	*463.60 FL
3	1		*REAR END PANEL	Bent	892.05 FL	*731.35 FL
4	1		*REAR LAMP	Cracked	955.60 FL	*768.10 FL
5	1		*REAR BOOTLID GANISH	Mtg Cracked	1,155.60 FL	*925.60 FL
6	1		*REAR BUMPER	Buckled	468.20 FL	*468.20 FL
7	1		*REAR END PANEL GANISH	Mtg Distorted	316.20 FL	*316.20 FL
8	1		*REAR BOOTLID LAMP	Cracked	631.90 FL	*631.90 FL
9	1		*REAR BUMPER TOWING COVER	Dented	26.80 FL	*26.80 FL
10	1		*REVERSE SENSOR (2PCS)	Shorted (1Pc Only)	440.00 FL	*220.00 FL
11	1		*REAR BUMPER REINFORCEMENT	Bent	369.00 FL	*369.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (S\$)	6,926.70	6,033.20
- List Item Discount on L Items 25.00/25.00% (S\$)	1,731.68	1,508.30
Total Parts (S\$)	5,195.02	4,524.90

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE REAR WINDSCREEN	New	180.00	120.00
2	TO RESPRAY AFFECTED PARTS	New	800.00	720.00
3	TO REPLACE ABOVE PARTS	New	800.00	600.00
4	TO CHECK WIRING	New	30.00	20.00
5	ANTI RUST	New	50.00	50.00
Gross Labour Cost (S\$)			1,860.00	1,510.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >