Figure C-1: Front view of MID32369



Figure C-2: Back view of MID32369



Figure C-3: Right side view of MID32369



Figure C-4: Left side view of MID32369



Figure C-5: Close up of RHR of MID32369

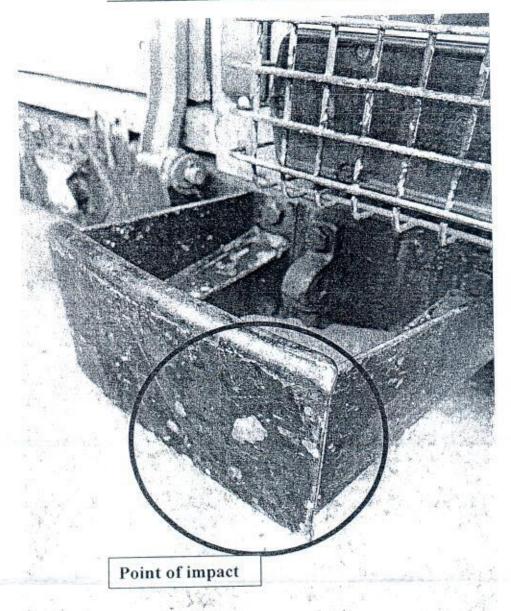


Figure C-6: Front view of GBE7564T



Figure C-7: Back view of GBE7564T



Figure C-8: Right side view of GBE7564T


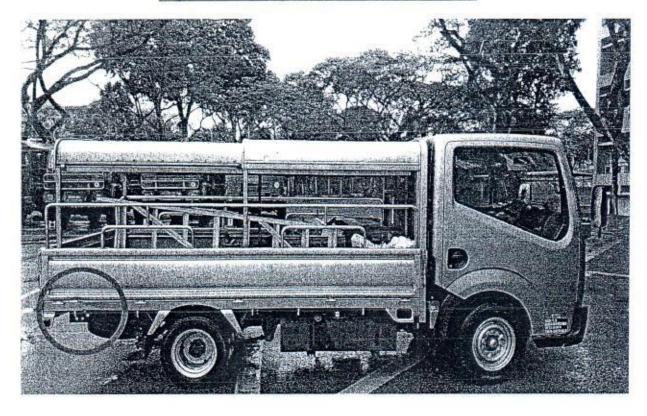


Figure C-9: Left side view of GBE7564T



Figure C-10: Damage on GBE7564T's Right side chassis

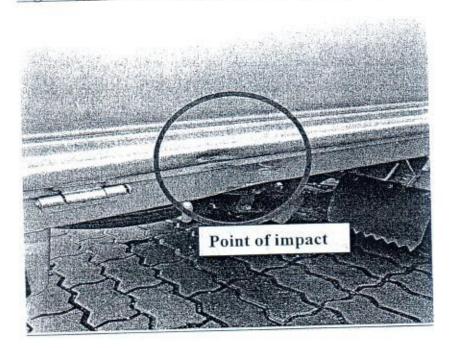

PARTICULARS REQUIRED FOR VEHICLES ACCIDENTS

VEHICLE NO	TYPE OF VEHICLE	DATE OF LAST OVERHAUL	DATE OF LAST TEST	DRIVER RA	NK & NAME	SERVICE STATUS	DRIVING EXPERIENCE	NO. OF PREVIOUS ACCIDENTS INVOLVED	
							yr mth		
	INVOLVEME	NT OF INJURY		FATAL/SERIOUS/SLIGHT/NO INJURY					
	In making you	sketch of the sc	ene of the	accident, ple	ase note the follow	wing points			
	a. Road	Road Layout and Widths			f. Str	Street names			
	b. Position of vehicles on impact				g. Vill	Village names or distances away			
	 Position of vehicles before or after impact with direction of travel of each vehicle 				h Wi	White lines and studs in roadways			
	d. Position and length of all skid marks			arks	i. Wa	Warning signs, traffic signals and pedestrian crossings			
		Obstruction etc.							
	e Obstr	uction etc.							









ECOR

Vehicle Number : MID32369

MO NO

: 8500913379

UNIT

: KHATIB CMTL TPTCEN(N)/1SAFTPTBN

Dated

: 06.07.2017

Model

: TRUCK, UTILITY: L/R, LWB, 1 TON W/MOVING DIR

JOB DESCRIPTION FOR REPAIR.

Fault: Job Description:

SCRATCHES ON RHR STOPPER

REPAIR COST = NIL

ME3 Assessment cost 0.5 hrs X 49.33 MH Rate = \$ 24.67

REMARKS:

U/M inspected/assessment by ME3 Tan Lian Siong, MAO Khatib CSW, AMB3 .

Prepared by

Mr Mazlan 34FMD MOS 3AMB 14/07/2017