CHINA TAIPING
INSURANCE (S) PTE LTD
3 ANSON ROAD
#15-02 SPRINGLEAF
TOWER

079909

Claim Reference: 3 SNM17D03062C01

Assessment Number: GR000065

Version: CHINATAI/4

Date Calculated: 12/12/2017 03:29

Full Report - V1

Registration: GBE9623T

Printed: 12/12/2017 11:30

Summary Information

Claim

Location: Singapore (SG)
Printed by: Mr K.K Lau
Authorisation Status: Interim

Work Provider: China Taiping Insurance

(S) Pt

3 SNM17D03062C01

DMCVSN1627421701

Claim Reference:
Policy Number:
Other Reference:

Other Reference: Third Party: Insured Amount: Under Warranty: Warranty Expired: Currency: SGD

Date of Incident: 23/05/2017 Able to Authorise Repairs: TBA Repairs Authorised: TBA

Estimated Repair Time: Quote Due Date: Actual Repair Days: Parts Ordered Date: Hire Car Start: Hire Car End:

SINGLE CAB COMFORT

Vehicle Details

Vehicle

Manufacturer: MITSUBISHI
Model: Fuso Canter
Sub Model: BASE MODEL
Model Sheet Number: G67.01

Model Sheet Number: G67 01
Registration: GBE9623T

Registration Month: May Registration Year: 2016

VIN Number: FEA01BA20120

Manufacture Year: Odometer: Colour:

Not Known

4P10C08932

2016

%

Engine Number: Fuel Level: **Model Specs**

Vehicle Collected:

FROM 11/2010 AIR CONDITIONING

3.0 LTR 81KW GWR 3.5T

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Severity of Impact: Steering: Vehicle Status on

Inspection:

Brakes Pedal Travel: Date of Inspection: 02/06/2017

Place of Inspection: Pre-Accident Damage:

Tyres Condition: Poor


Tread Depth LHF: Tread Depth RHF: Tread Depth RHR: Damage Areas: Tread Depth RHR: Direction of Impact:


Claim Reference: 3 SNM17D03062C01

Assessment Number: GR000065

Version: CHINATAI/4

Date Calculated: 12/12/2017 03:29

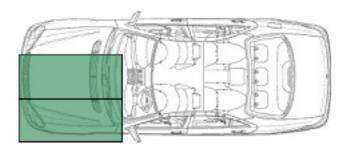

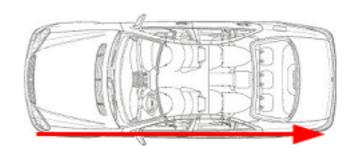

Full Report - V1

Registration: GBE9623T

Printed: 12/12/2017 11:30

Addresses

Cost Summary

Total Labour		\$1,265.00
Total Paint/Material		\$123.25
Total Parts		\$12,769.35
Total of Additional Costs		\$157.00
Repair Cost Exc GST:		\$14,314.60
Overall Discount (0.0%):		- \$0.00
Excess:		-\$3,600.00
After Deduction -	Grand Total Exc GST:	\$10,714.60
	0 % GST:	\$0.00
	Grand Total Inc GST:	\$10,714.60

Repair Information

LABOUR	Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/H Price/Dent = \$46.00/H		
Repair /		•	
Guide Numb	er Repair Details	WU	Cost Price (\$)
421010 00	R + R CAB	37.0	170.20
516118 90	R + R RADIATOR GRILLE TRIM	6.0	27.60
	INCLUDES: R + R RADIATOR GRILLE		
411011 10)	R + R FRONT BUMPER	2.0	9.20
411011 10)	RENEW FRONT BUMPER (REMOVED)	2.0	9.20
541010 10)	R + R L/MAIN HEADLAMP	1.0	4.60
	(FRONT GRILLE REMOVED)		
515041 10	R + R L/F CORNER PART	3.0	13.80
541030 10	R + R L/F REPEATER LAMP	3.0	13.80
NO NUMBER	RENEW L/KNEE PIECE	34.0	156.40
	INCLUDES: R + R SILL LINING AND COVERING		
424111 10	RENEW L/DOOR BODY	20.0	92.00
	INCLUDES: R + R ATTACHED PARTS OF THE		
	DOOR,		
	ALIGN + ADJUST DOOR		
424132 10	R + R LEFT DOOR EDGE PROTECTION	5.0	23.00
521110 10	R + R L/SEAT	3.0	13.80
427160 10)	R + R FRONT CAB CROSSMEMBER	56.0	257.60
·	(CAB REMOVED)		
	INCLUDES: R + R TORSION BAR SPRING AND		
	STEERING GEAR		
427211 10)	R + R L/F CAB HINGE	1.0	4.60
,	(CAB AND CROSSMEMBER REMOVED)		
427211 10)	R + R R/F CAB HINGE	1.0	4.60

Claim Reference: 3 SNM17D03062C01 Full Report - V1
Assessment Number: GR000065 Registration: GBE9623T

Version: CHINATAI/4 Printed: 12/12/2017 11:30

Date Calculated: 12/12/2017 03:29

	(CAB AND CROSSMEMBER REMOVED)		
NO NUMBER	DRAIN + REFILL AIR CONDITIONING	5.0	23.00
553210 10ZAX	R + R CONDENSER	10.0	46.00
555011 10)	RENEW CONDENSER-/COMPRESSOR HOSE	5.0	23.00
555011 10)	R + R EVAPORATOR/CONDENSER PIPE	5.0	23.00
LAB	OUR COST		
	Total Work Units	199.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	19.9HRS	\$915.40
	Paint Labour	7.6HRS	\$349.60
	Total Labour	27.5HRS	\$1,265.00

PAINT WO	ORK Time Basis	s 10 WU = 1 HR. Price :	= \$46.00/HR
Guide Nur	mber Description	WU	Cost Price (\$)
281	FRONT BUMPER NEW PART PAINTING	11.0	
887	L/F CORNER PANEL NEW PART PAINTING	6.0	
1481	LEFT FRONT DOOR NEW PART PAINTING	16.0	
4235	L/F WHEELARCH PANEL NEW PART PAINTING	11.0	
410	FRONT GRILLE NEW PART PAINT K1R	4.0	
1482	RIGHT FRONT DOOR SURFACE PAINT	8.0	
	LABOUR COST - PAINT		
	TIME(PAINT)	56.0	
	Preparation Main Work Metal	17.0	
	Preparation Comp. Work Plastic	3.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	76.0	
	Total Paintwork Labour	7.6HRS	\$349.60
	MATERIAL COST - PAINT		Cost Price
	New Part Painting		\$73.48
	New Part Painting - Plastic K1R		\$4.89
	Surface-/Blend Paint		\$17.78
	Material-Const Main Work Metal		\$18.10
	Material-Const Comp. Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$123.25
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$123.25

PARTS

					Price Valid:	01/06/2015
Guide No	.Qty	Description	Part Number	Supplier	Bet.	Price (\$)
7797	1	AIR CON BLOWER MOTOR	ME733628		0%	1,950.00*
4499	1	AIR INTAKE HOSE	MK512843		0%	463.25*
432	1	BADGE	Renew		0%	58.00*
4465	1	CONDENSER	ME733766		0%	1,050.00*
1000	1	DOOR HING LH	Renew		0%	130.00*
281	1	FRONT BUMPER	MK616888		0%	650.00*
410	1	FRONT GRILLE	MK614811		0%	380.00*
431	1	FRONT MANUFACT BADGE	Renew		0%	58.00*
2811	1	FRONT TORSION BAR	MK622055		0%	900.00*
1000	1	FRT BUMPER BRACKET	Renew		0%	110.00*
1000	1	FRT IMPACT DAMPER LH	Renew		0%	250.00*
1000	1	FUSO BADGE	Renew		0%	95.00*

Claim Reference: 3 SNM17D03062C01 Full Report - V1
Assessment Number: GR000065 Registration: GBE9623T

Version: CHINATAI/4 Printed: 12/12/2017 11:30

Date Calculated: 12/12/2017 03:29

1000	1	GARNISH HEADLAMP LH	Renew		0%	150.00*
1000	1	H TWIN PIPE	Renew		0%	130.95*
2813	1	L/CAB ATTACHMENT	MK622157		0%	600.00*
887	1	L/F CORNER PANEL	MK997197		0%	360.00*
1509	1	L/F DOOR FRAME SEAL	MK403141		0%	270.00*
677	1	L/F INDICATOR	MK486509		0%	210.00*
2205	1	L/F STEP	MK488279		0%	260.00*
4235	1	L/F WHEELARCH PANEL	MK702700		0%	450.00*
1737	1	L/MIRROR HEAD	MK486109		0%	85.00*
1481	1	LEFT FRONT DOOR	MK702714		0%	1,450.00*
561	1	LEFT HEADLAMP ASSY	MK486503		0%	420.00*
1000	1	MIRR STND GRNISH LH	Renew		0%	30.00*
2816	1	R/OUT TORS BAR ATTM	MK396863		0%	500.00*
1000	1	RECEIVER ASSY A/C	Renew		0%	400.00*
4500	1	RETURN HOSE	MK512842		0%	505.85 *
1000	1	ROUND MIRROR L/H	Renew		0%	150.00*
f: OEM Pa g: Origina h: Second p: Paralle x: Exchar	ıl Ihand I		Sub Total Mark Up Fron Sundry Parts Total Parts	` '	,	\$12,066.05 \$603.30 \$100.00 \$12,769.35

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	on	Betterment	Price
FRT NO PL	ATE W CVR SPECIALIST	0%	\$35.00
AUDATEX	FEES SPECIALIST		\$42.00
COOLANT	SPECIALIST	0%	\$30.00
AIRCON G	AS SPECIALIST		\$50.00
		Total Extras	\$157.00

Final Calculation

Final Calculation		
Total Parts		\$12,769.35
Labour		
Total Panel/Mechanical	\$915.40	
Total Paintwork	\$349.60	
Total Labour		\$1,265.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$157.00	
Total of Additional Costs		\$157.00
Total Paint/Material Costs		\$123.25
Repair Costs Excludes GST		\$14,314.60
Deductions		
Deduction for Excess (Fixed)	-\$3,600.00	
Total Deductions		-\$3,600.00
Grand Total Excludes GST (After Deduction)		\$10,714.60
GST @ 0 %	_	\$0.00
Grand Total Includes GST (After Deduction)		\$10,714.60

Claim Reference: 3 SNM17D03062C01 Full Report - V1
Assessment Number: GR000065 Registration: GBE9623T

Version: CHINATAI/4 Printed: 12/12/2017 11:30

Date Calculated: 12/12/2017 03:29

Assessment Notes