

22/03/2002

ASS. REC. BY:

REF:

CS/CTI 17015315/Drblz

Special Instruction:

SURVEYOR:

Meitman

ASSIGNMENT (Office)

From (Person):

Angie Foo

of

CAI

Date/Time:

8/8/17

Estimated Cost:

Bill to:

OD ~~TP~~ DWS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SKF 4376C

Insured:

SKF 8070H

at Workshop m/s

Team Work

Tel:

6844 2475

of

53 Ubi Ave 1 #01-24

Policy No:

DMHCSN 1661751600

Claim No:

SNM17D0H640C02

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

5/8/17

CA / REV / REP. / REV 24 HRS

WP

H.O.D. Endorsement:

Date/Time:

8/8

Person Contacted:

Trina

Vehicle ~~IN~~ OUT

Date/Time

Action/Instruction () Estimate

SKF 4376C - NA/CTI 17015315/K4 D.O.A. 5/8/17

SKF 8070H - X

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

☒	☒
N/S	O/S
☒	☒

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 12 days Res.: Yes or No
 Lum Sum: 20 % 3 Val.: Yes or No
 CA / REV / REP. / 24 HRS
 Date: _____ Person Contacted: _____
 Vehicle: IN / OUT

Veh No: SKF 4376C Yr Regn: Sgt 2009
 Type: MC Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or
 Make: Toyota wish C.C. 1797
 Colour: Gray A/C: Insured / Std / NI / NA
 Sp. Reading: 207078 T/Radio: Insured / Std / NI / NA
 Eng/No: 22R0433055
 C/No: 2GE200011052
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / 8/Rim / STD A/Rim or
 Tyre Size: F: 225/45 R17
 R: —

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Falken

Front	Rear
R/Bal. <u>5</u> mm	R/Bal. <u>5</u> mm
L/Bal. <u>5</u> mm	L/Bal. <u>5</u> mm
D.O.A. <u>05/08/2017</u>	D.O.I. <u>08/08/2017</u>
Survey held at <u>Tecmwork Page ubi</u>	

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
O/S Front 7 4/5 Front 7 4/5 Rear
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

MV 39K

LIA 17.3K

HL 21K

17/10/18 Insured 2/5 1660/- with 12 days.
 Red: 38,785.39, 70%.

Copyright © 2015 First Capital Insurance Limited (http://www.first-insurance.com.sg/). All rights reserved.

Submit Assessment

Date/Time File Pass to?



Prelt. Report

Days Of Repair: 121) tyist

Final Report

Resurvey No. of Trip: 2

Date/Time File Return to?

2)

Add Fee: ☐

Site Insp (\$)

SUMMARY

Interview (\$)

Tech. Invs (\$)

Weekend (\$)

Report Format: JPLump Sum / LB: (\$) 1660

Action

Job Remarks

Date



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD			Ref : CS/CTI17015315/Drb	
3 ANSON ROAD #16-00 SPRINGLEAF TOWERS SINGAPORE 079909			Date : 08-08-2017	
			Code : CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SKF 8070H	Veh. Inspected	SKF 4376C	
Policy No.	DMHCSN1661751600	Coverage (\$)	0.00	
Claim No.	SNM17D04640C02	Excess (\$)	0.00	
Assign From	ANGIE FOO (MERIMEN)	Assign Date	08/08/2017	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	05/08/2017	Inspection Date	08/08/2017	
Survey held at	TEAMWORK GARAGE PTE LTD 53 UBI AVENUE 1 #01-24 SINGAPORE 408934.			
5a. Remarks				
A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	08 Aug 2017		08 Aug 2017 13:51 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:		Z'S LIMO [Created by insurer]							
Main Claimant:		MOHAMED RAFI BIN MOHAMED MUSTAFA, ID: S6924665F							
Vehicle Reg. No.:		SKF4376C							
Claim Type:		TP / SNM17D04640C02							
Vehicle Reg. No. (Insured):		SKF8070H							
		Date of Loss:	05/08/2017 14:00 - :59						
		Policy/Cover Note No.:	DMHCSN1661751600						
		Policy No. (Claimant):	CN790604						
		Excess:	S\$0.00						
Repairer:		Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475							
Handling Insurer:		China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Angie Foo - 6389 6186]							
Claimant's Insurer:		AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288							
Adjuster:		LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 18/08/2017]							
Adj Asg. Remarks:		PLEASE SURVEY THIRD PARTY, CHECK CONSISTENCY OF THE DAMAGES ON WITHOUT PREJUDICE BASIS. KINDLY LET US HAVE YOUR RECOMMENDED REPAIR AMOUNT IF THERE IS NO ESTIMATE PROVIDED DURING PRE REPAIR.							
ASSOCIATED MAIL RECEIVED									
There are no mail for this case.			View All	Compose Case Mail					
ALL ASSOCIATED TASKS									
Due Date	Priority	Type	Task Group	Subject	Handler	View All	Search Tasks	Create New Task	Complete
No results.						Assigned By	Completed On	Created On	Done?

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	07/08/2017 17:56
Date Of Accident	05/08/2017 14:45
Exact Location Of Accident	BUKIT TIMAH ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKF4376C
Insured/Policyholder	
Name Of Registered Owner	MOHAMED RAFI BIN MOHAMED MUSTAFA
NRIC No	S6924665F
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-98801434
Alternative Phone No	OFFICE-98801434

Vehicle Particulars

Manufacturer	TOYOTA
Model	WISH-1.8 (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category PRIVATE CAR

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	CN790604
Cover Note Number	

Driver

Name of Driver	MOHAMED SHAFEEQ BIN MOHAMED RAFI
NRIC No	S9740294I
Date Of Birth	14/11/1997
Occupation	INDOOR
Date Of Driving Pass	12/12/2016
Driving Experience	0 YEAR AND 7 MONTH
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
EMail Address	NOEMAIL

Address

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured CHILDREN

Vehicle Registration Number of Driver's Own Vehicle

-

-

-

Insurance Company of Driver's Own Vehicle

-

-

-

General Information of the Accident

Type Of Accident CHAIN COLLISION

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Was any body injured in the Accident? YES

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

REFER TO ATTACHMENT.

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? NO

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SKF8070H

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SKS9923Y

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number

SBL6122E

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

DETAILS OF INJURED PERSON 1

Name

MOHAMED SHAFEEQ BIN MOHAMED RAFI

Approximate Age

Injuries Sustain

Injured person in which vehicle?

SKF4376C

Were seat belts worn?

Was injured conveyed to hospital by ambulance?

Address

Postcode

Accident Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report accurately the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to rescind policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claim including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claim;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claim.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be used outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
Progressive Automotive Pte Ltd
Blk 3622A Ubi Road 1 #01-45/46
Singapore 406716

Sketch Plan

	Number Plate A - SF 4376 B - SF 2074 C - SF 4123 D - SF 6122 Legend Vehicle Bike
--	--

Accident Sketch Plan

Describe Circumstances of the Accident

My car was travelling along Bukit Timah Road towards Bukit Timah (Beauty World) at the right most lane. Vehicle B which was travelling on my left (middle lane) suddenly recklessly in a fast speed cut into my lane and hit onto the left side portion of my car. The huge impact from vehicle B resulting my car to move forward, swerved towards the right and hit onto a vehicle which was stationary waiting to making a right turn and my car mount up the kerb, scratch along the sign board and came to a stop. I got off my car and found that total 4 vehicles involved in the accident.

PH 2

Declaration

We declare the foregoing particulars are true in every respect

[Signature]
Policyholder's Signature / Date & Time

[Signature]
Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel



Pte Ltd

TeamWork Garage Pte Ltd

53 Ubi Avenue 1 #01-23/24 Spore 408934

Paya Ubi Industrial Park

Tel : 6844 2475 Fax : 6844 2474

E-mail : claims@teamworkgarage.com

Register number : 201015366H

3RD PARTY CLAIM ESTIMATION

China Taiping Insurance (Singapore) Pte Ltd

105 Cecil Street #19-00

The Octagon

Singapore 069534

Vehicle number : SKF4376C
Make / Model : TOYOTA/WISH
Chassis number : ZGE200011052
Accident date : 05 August 2017
Reference : 1708-19

Qty Particulars

Unit Price - SGD \$

PARTS REPLACEMENT - LIST ITEMS		
1	FRONT BUMPER <i>Dent</i>	547.00 819.30 ✓
2	FRONT BUMPER SIDE COVER NF	143.90 X
2	FRONT BUMPER SIDE RETAINER N/S broken o/s svc	110.05 220.10 ✓
1	FRONT BUMPER REINFORCEMENT bt	316.30 482.40 ✓
1	FRONT BUMPER SPONGE torn	261.09 ✓
1	FRONT BUMPER LOWER MESH broken	281.54 ✓
1	FRONT GRILLE <i>crack grille</i>	361.30 ✓
1	FRONT SUPPORT PANEL bt	781.59 ✓
2	HORN svc	314.00 X
2	FRONT HEADLAMP broken	1378.00 1681.50 ✓
1	FRONT RH CHASSIS <i>Dent</i>	731.90 ✓
1	FRONT RH WHEEL HOUSE PANEL <i>Dent</i>	981.40 ✓
2	FRONT FENDER <i>Dent</i>	1281.70 ✓
2	FRONT FENDER INNER SHIELD N/S torn o/s dislodged	310.40 384.30 ✓
1	WIPER WASHER TANK <i>deformed</i>	261.40 ✓
2	WIPER WASHER TANK MOTOR <i>Dam</i>	281.60 ✓
1	WIPER PANEL TOP GARNISH <i>cut</i>	191.80 ✓
1	BONNET <i>Dent</i>	722.80 884.40 ✓
1	BONNET CHROME STRIP <i>dislodged</i>	261.20 ✓
1	BONNET LOCK <i>bt</i>	185.09 ✓
1	BONNET INSULATOR <i>svc</i>	289.10 X
2	BONNET HINGE <i>bt</i>	221.80 ✓
1	AIRCON CONDENSER <i>bt</i>	1217.80 1817.40 ✓
1	AIRCON SUCTION PIPE-LOW <i>NH</i>	561.40 X
1	AIRCON SUCTION PIPE-HIGH <i>NH</i>	581.09 X
1	RADIATOR <i>bt</i>	1417.38 ✓
1	RADIATOR COWLING broken	300.76 300.76 661.40 ✓
1	RADIATOR FAN MOTOR <i>Dam</i>	481.50 ✓
1	RADIATOR FAN BLADE <i>distorted</i>	161.40 ✓
1	RADIATOR EXPANSION TANK <i>deformed</i>	281.30 ✓
1	ABS CONTROL UNIT <i>svc</i>	3031.42 X

13328.10

VEHICLE NUMBER : SKF4376C

MAKE MODEL : TOYOTA WISH

REF : 1708-19

Qty	Particulars	Unit Price - SGD \$
1	ABS CONTROL UNIT BRACKET <i>src</i>	129.01 7 X
1	ENGINE COVER LH <i>src</i>	151.00 X
1	ENGINE COVER RH <i>src</i>	151.00 X
1	ENGINE MOUNTING LH <i>src</i>	281.10 X
1	ENGINE MOUNTING RH <i>crack</i>	271.50 ✓
1	ENGINE MOUNTING BEAR Front <i>crack</i>	290.20 ✓
2	FRONT SHOCK ABSORBER <i>distorted</i>	701.10 1658.90 ✓
2	FRONT KNUCKLE ARM <i>distorted</i>	909.14 1029.60 ✓
2	FRONT KNUCKLE BEARING <i>Don</i>	412.30 ✓
2	FRONT LOWER ARM <i>distorted</i>	790.28 ✓
2	FRONT DRIVER SHAFT distorted <i>2 H/L</i>	2695.90 7 X
2	STEERING TIE ROD END <i>1st</i>	290.30 ✓
1	STEERING RACK AND PINION <i>H/L</i>	1825.29 X
1	REAR BUMPER <i>Cnt</i>	546.00 765.21 ✓
2	REAR BUMPER BRACKET <i>src</i>	231.90 X
2	REAR BUMPER DAMPER <i>h/L</i>	281.50 X
1	REAR LH TAILLAMP <i>H/L</i>	483.20 X
1	REAR END PANEL <i>H/L</i>	638.10 X
1	REAR END PANEL GARNISH <i>H/L</i>	230.40 X
		32897.39
		Less 25%
		8224.34
		Subtotal
		24673.05
		Balance C/F
		24673.05
	<u>PARTS REPLACEMENT - SPECIAL NETT ITEMS</u>	
	Balance B/F	24673.05
1	FRONT NUMBER PLATE <i>crack</i>	80.00 45/-
1 SET	FRONT BUMPER CLIP <i>H/L</i>	60.00 30/-
1 SET	FRONT FENDER INNER SHIELD CLIP <i>H/L</i>	50.00 20/-
1 SET	FRONT ENGINE UNDERCOVER CLIP <i>H/L</i>	60.00 20/-
2	SILL GARNISH <i>crack mounting</i>	1000/- 2400.00 ✓
2	RIM <i>Cnt 45 front 7 1/2 rear 0.5 front</i>	1000/- 1600.00 ✓
1	BRAKE FULID <i>H/L</i>	60.00 40/-
1	REAR BUMPER CLIP <i>H/L</i>	60.00 30/-
1 SET	REAR REVERSE SENSOR <i>H/L</i>	400.00 X
1	JOINT SEALANT <i>H/L</i>	150.00 40/-
1	COOLANT <i>H/L</i>	60.00 30/-
		Subtotal
		4980.00
		Balance C/F
		29653.05
S/No	<u>LABOUR AND MISCELLANEOUS CHARGES</u>	
	Balance B/F	29653.05
1	CHECK FRONT , REAR WIRING AND LIGHTNING SYSTEM	60.00 30/-

VEHICLE NUMBER : SKF4376C

MAKE MODEL : TOYOTA WISH

REF : 1708-19

S/No	Particulars	Unit Price - SGD \$
2	REMOVE AND RENEW RADIATOR AND TOP UP COOLANT	200.00 50/-
3	REMOVE AND RENEW CONDENSER AND TOP UP GAS	200.00 120/-
4	CHECK FRONT WHEEL ALIGNMENT	150.00 60/-
5	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS	200.00 180/-
6	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT	500.00 250/-
7	REMOVE AND REFIT DASHBOARD	500.00 NA
8	REMOVE AND RENEW REAR REVERSE SENSOR	150.00 40/-
9	REMOVE AND REFIT REAR LINING, TRIM AND GARNISH	200.00 NA
10	PANEL BEATING ON AFFECTED AREAS	2500.00 1600/-
11	SPRAY PAINTING ON AFFECTED AREAS	1400/- 2000.00
12	APPLY ANTI RUST ON AFFECTED AREAS	200.00 60/-
Subtotal		6860.00
Grand total		55 385.39 36513.05

3790/-

KK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

08/08/2017 @ 1500 hrs 19198.44
 Not Autum Supp 1546.96
 L/Sum 2074540.
 12 days. L/S 16600/-
 2KK Auto

Check part prices.
 Check MV
 Repair Limit.



TeamWork Garage Pte Ltd
 53 Ubi Avenue 1 #01-23/24 Spore 408934
 Paya Ubi Industrial Park
 Tel : 6844 2475 Fax : 6844 2474
 E-mail : claims@teamworkgarage.com
 Register number : 201015366H

China Taiping Insurance (Singapore) Pte Ltd
 105 Cecil Street #19-00
 The Octagon
 Singapore 069534

3RD PARTY CLAIM SUPPLEMENTRY ITEMS

Vehicle number : SKF4376C
 Make / Model : TOYOTA/WISH
 Chassis number : ZGE200011052
 Accident date : 05 August 2017
 Reference : 1708-19

Qty Particulars

Unit Price - SGD \$

<u>PARTS REPLACEMENT - LIST ITEMS</u>		
1	FRONT SUPPORT PANEL GARNISH <i>damaged</i>	128.30 ✓
2	STABILISE LINK <i>5r</i>	290.38 ✓
1	STABILISER BAR <i>distorted</i>	138.20 ✓
1	CROSS MEMBER <i>distorted</i>	683.20 ✓
2	FRONT FOG LAMP COVER <i>crack</i>	192.00 292.50 ✓
1	FRONT BRACE PANEL <i>5r</i>	101.40 ✓
1	FRONT HEADLAMP PANEL <i>o/s 15w</i>	195.80 ✓
		1829.78
	Less 25%	457.44
	Subtotal	1372.34
<u>PARTS REPLACEMENT - SPECIAL NETT ITEMS</u>		
	Balance B/F	1372.34
2	FRONT TYRE <i>Cnt 50% dep.</i>	500.00 250/-
	Subtotal	500.00
	Balance C/F	1872.34
	Grand total	1872.34
		1546.96
		38385.38

Ly
 LKK Auto

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	08 Aug 2017		08 Aug 2017 13:51 Edit Adj Rpt	S\$16,600.00 Edit Estimates	S\$16,600.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	-----------------

CLAIM SUBFOLDER DETAILS				[Created by Insurer]		
Insured:	Z'S LIMO , Co. Reg. No.: -					
Main Claimant:	MOHAMED RAFI BIN MOHAMED MUSTAFA , ID: S6924665F					
Vehicle Reg. No.:	SKF4376C	Date of Loss:	05/08/2017 14:00 - :59			
Claim Type:	TP / SNM17D04640C02	Policy/Cover Note No.:	DMHCSN1661751600			
Vehicle Reg. No. (Insured):	SKF8070H	Policy No. (Claimant):	CN790604			
		Excess:	S\$0.00			
Repairer:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park, 408934 Ubi - Tel: 6844 2475					
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Angie Foo - 6389 6186]					
Claimant's Insurer:	AXA Insurance Pte Ltd (HQ) - Tel: 6338 7288					
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Janice Lee Si Hua] ... [Final Rpt due 18/08/2017]					
Adj Asg. Remarks:	PLEASE SURVEY THIRD PARTY, CHECK CONSISTENCY OF THE DAMAGES ON WITHOUT PREJUDICE BASIS. KINDLY LET US HAVE YOUR RECOMMENDED REPAIR AMOUNT IF THERE IS NO ESTIMATE PROVIDED DURING PRE REPAIR.					

ASSOCIATED MAIL RECEIVED	View All	Compose Case Mail
There are no mail for this case.		

ALL ASSOCIATED TASKS ☐										View All	Search Tasks	Create New Task	Complete
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?				
No results.													

Claim Documents

*SKF4376C (SNM17D04640C02)
[SKF8070H]
TP
MOHAMED RAFI BIN MOHAMED MUSTAFA
Aug 5 2017 2:00PM
[Z'S LIMO]
Teamwork Garage Pte Ltd

[Upload Documents](#)
[Upload Photos](#)
[Compose New Letter](#)

View View in Browser

Assessment Reports				1 per page	☒
No	Finalized On	Progressive Automotive Pte Ltd (HQ)		Thumbnail	Print
1	07/08/17 18:03	Accident Statement		Load HTM	

Photos/Images				3 per page	☒
No	Finalized On	Progressive Automotive Pte Ltd (HQ)		Thumbnail	Print
1	07/08/17 18:02	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
2	07/08/17 18:02	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
3	07/08/17 18:02	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
4	07/08/17 18:02	Accident Photo [Linked Accident Report Documents]		Load JPG	☒
5	07/08/17 18:02	Accident Photo [Linked Accident Report Documents]		Load JPG	☒

No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	15/12/17 10:33	Front View Left		Load JPG	☒
2	15/12/17 10:33	Front View Right		Load JPG	☒
3	15/12/17 10:33	General View		Load JPG	☒
4	15/12/17 10:33	General View		Load JPG	☒
5	15/12/17 10:33	General View		Load JPG	☒
6	15/12/17 10:33	General View		Load JPG	☒
7	15/12/17 10:33	General View		Load JPG	☒
8	15/12/17 10:33	General View		Load JPG	☒
9	15/12/17 10:33	General View		Load JPG	☒
10	15/12/17 10:33	General View		Load JPG	☒
11	15/12/17 10:33	General View		Load JPG	☒
12	15/12/17 10:33	General View		Load JPG	☒
13	15/12/17 10:33	General View		Load JPG	☒
14	15/12/17 10:33	General View		Load JPG	☒
15	15/12/17 10:33	General View		Load JPG	☒
16	15/12/17 10:33	General View		Load JPG	☒
17	15/12/17 10:33	General View		Load JPG	☒
18	15/12/17 10:33	General View		Load JPG	☒
19	15/12/17 10:33	General View		Load JPG	☒
20	15/12/17 10:33	General View		Load JPG	☒
21	15/12/17 10:33	General View		Load JPG	☒
22	15/12/17 10:33	General View		Load JPG	☒
23	15/12/17 10:33	General View		Load JPG	☒
24	15/12/17 10:33	General View		Load JPG	☒

25	15/12/17 10:33	General View	1	Load JPG	☒
26	15/12/17 10:33	General View	1	Load JPG	☒
27	15/12/17 10:33	General View	1	Load JPG	☒
28	15/12/17 10:33	General View	1	Load JPG	☒
29	15/12/17 10:33	General View	1	Load JPG	☒
30	15/12/17 10:33	General View	1	Load JPG	☒
31	15/12/17 10:33	General View	1	Load JPG	☒
32	15/12/17 10:33	General View	1	Load JPG	☒
33	15/12/17 10:33	General View	1	Load JPG	☒
34	15/12/17 10:33	General View	1	Load JPG	☒
35	15/12/17 10:33	General View	1	Load JPG	☒
36	15/12/17 10:33	General View	1	Load JPG	☒
37	15/12/17 10:33	General View	1	Load JPG	☒
38	15/12/17 10:33	General View	1	Load JPG	☒
39	15/12/17 10:33	General View	1	Load JPG	☒
40	15/12/17 10:33	General View	1	Load JPG	☒
41	15/12/17 10:33	General View	1	Load JPG	☒
42	15/12/17 10:33	General View	1	Load JPG	☒
43	15/12/17 10:33	General View	1	Load JPG	☒
44	15/12/17 10:33	General View	1	Load JPG	☒
45	15/12/17 10:33	General View	1	Load JPG	☒
46	15/12/17 10:33	General View	1	Load JPG	☒
47	15/12/17 10:33	General View	1	Load JPG	☒
48	15/12/17 10:33	General View	1	Load JPG	☒
49	15/12/17 10:33	General View	1	Load JPG	☒
50	15/12/17 10:33	General View	1	Load JPG	☒
51	15/12/17 10:33	General View	1	Load JPG	☒
52	15/12/17 10:33	General View	1	Load JPG	☒
53	15/12/17 10:33	General View	1	Load JPG	☒
54	15/12/17 10:33	General View	1	Load JPG	☒
55	15/12/17 10:33	General View	1	Load JPG	☒
56	15/12/17 10:33	General View	1	Load JPG	☒
57	15/12/17 10:33	General View	1	Load JPG	☒
58	15/12/17 10:33	General View	1	Load JPG	☒
59	15/12/17 10:33	General View	1	Load JPG	☒
60	15/12/17 10:33	General View	1	Load JPG	☒
61	15/12/17 10:33	General View	1	Load JPG	☒
62	15/12/17 10:33	General View	1	Load JPG	☒
63	15/12/17 10:33	General View	1	Load JPG	☒
64	15/12/17 10:33	General View	1	Load JPG	☒
65	15/12/17 10:33	General View	1	Load JPG	☒
66	15/12/17 10:33	General View	1	Load JPG	☒
67	15/12/17 10:33	General View	1	Load JPG	☒
68	15/12/17 10:33	General View	1	Load JPG	☒
69	15/12/17 10:33	General View	1	Load JPG	☒
70	15/12/17 10:33	General View	1	Load JPG	☒
71	15/12/17 10:33	General View	1	Load JPG	☒
72	15/12/17 10:33	General View	1	Load JPG	☒
73	15/12/17 10:33	General View	1	Load JPG	☒
74	15/12/17 10:33	General View	1	Load JPG	☒

75	15/12/17 10:33	General View	1	Load JPG	☒
76	15/12/17 10:33	General View	1	Load JPG	☒
77	15/12/17 10:33	General View	1	Load JPG	☒
78	15/12/17 10:33	General View	1	Load JPG	☒
79	15/12/17 10:33	General View	1	Load JPG	☒
80	15/12/17 10:33	General View	1	Load JPG	☒
81	15/12/17 10:33	General View	1	Load JPG	☒
82	15/12/17 10:33	Rear View Right	1	Load JPG	☒
83	15/12/17 10:33	Rear View Left	1	Load JPG	☒
84	15/12/17 10:33	General View	1	Load JPG	☒
85	15/12/17 10:33	General View	1	Load JPG	☒
86	15/12/17 10:33	General View	1	Load JPG	☒
87	15/12/17 10:33	General View	1	Load JPG	☒
88	15/12/17 10:33	General View	1	Load JPG	☒
89	15/12/17 10:33	General View	1	Load JPG	☒
90	15/12/17 10:33	General View	1	Load JPG	☒
91	15/12/17 10:33	General View	1	Load JPG	☒
92	15/12/17 10:33	General View	1	Load JPG	☒
93	15/12/17 10:33	Odometer Reading	1	Load JPG	☒
94	15/12/17 10:33	Chassis Number	1	Load JPG	☒
95	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
96	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
97	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
98	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
99	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
100	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
101	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
102	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
103	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
104	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
105	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
106	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
107	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
108	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
109	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
110	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
111	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
112	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
113	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
114	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
115	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
116	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
117	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
118	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
119	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
120	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
121	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
122	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
123	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
124	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒

125	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
126	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
127	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
128	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
129	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
130	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
131	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
132	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
133	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
134	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
135	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
136	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
137	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
138	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
139	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
140	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
141	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
142	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
143	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
144	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
145	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
146	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
147	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
148	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
149	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
150	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
151	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
152	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
153	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
154	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
155	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
156	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
157	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
158	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
159	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
160	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
161	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
162	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
163	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
164	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
165	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
166	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
167	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
168	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
169	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
170	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
171	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
172	15/12/17 10:34	Reinspection Photo	1	Load JPG	☒
173	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
174	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒

175	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
176	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
177	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
178	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
179	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
180	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
181	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
182	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
183	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
184	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
185	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
186	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
187	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
188	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
189	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
190	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
191	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
192	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
193	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
194	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
195	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
196	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
197	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
198	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
199	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
200	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
201	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
202	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
203	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
204	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
205	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
206	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
207	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
208	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
209	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
210	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
211	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
212	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
213	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
214	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
215	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
216	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
217	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
218	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
219	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
220	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
221	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
222	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
223	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
224	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒

225	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
226	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
227	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
228	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
229	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
230	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
231	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
232	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
233	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
234	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
235	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
236	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
237	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
238	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
239	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
240	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
241	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
242	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
243	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
244	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
245	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
246	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
247	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
248	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
249	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
250	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
251	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
252	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
253	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
254	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
255	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
256	15/12/17 10:35	Reinspection Photo	1	Load JPG	☒
257	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
258	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
259	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
260	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
261	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
262	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
263	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
264	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
265	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
266	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
267	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
268	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
269	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
270	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
271	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
272	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
273	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
274	15/12/17 10:36	Finishing Photo	1	Load JPG	☒

275	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
276	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
277	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
278	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
279	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
280	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
281	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
282	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
283	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
284	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
285	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
286	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
287	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
288	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
289	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
290	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
291	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
292	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
293	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
294	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
295	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
296	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
297	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
298	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
299	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
300	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
301	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
302	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
303	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
304	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
305	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
306	15/12/17 10:36	Finishing Photo	1	Load JPG	☒
Documentation				1 per page	☒
No	Finalized On	Progressive Automotive Pte Ltd (HQ)		Thumbnail	Print
1	07/08/17 18:02	Common Statement [Linked Accident Report Documents]	1	Load JPG	☒
2	07/08/17 18:02	Individual Statement [Linked Accident Report Documents]	1	Load JPG	☒
3	07/08/17 18:02	Accident Sketch Plan [Linked Accident Report Documents]	1	Load JPG	☒
4	07/08/17 18:02	Accident Sketch Plan [Linked Accident Report Documents]	1	Load JPG	☒
5	07/08/17 18:02	IC AND LICENSE [Linked Accident Report Documents]	1	Load TIF	
6	07/08/17 18:02	IC AND LICENSE [Linked Accident Report Documents]	1	Load TIF	
No	Finalized On	China Taiping Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	08/08/17 13:53	THIRD PARTY SKF4376C -FROM TEAMWORK GARAGE -PRS EMAIL	1	Load PDF	
2	08/08/17 13:53	INSURED SAS REPORT SKF8070H	1	Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	22/01/18 12:34	Supplementary	1	Load PDF	

Linked Accident Report Documents

View

Assessment Reports			1 per page	☒
No	Finalized On	Progressive Automotive Pte Ltd (HQ)	Thumbnail	Print
1	07/08/17 18:03	Accident Statement	 Load HTM	☐
Photos/Images			3 per page	☒
No	Finalized On	Progressive Automotive Pte Ltd (HQ)	Thumbnail	Print
1	07/08/17 18:02	Accident Photo	 Load JPG	☒
2	07/08/17 18:02	Accident Photo	 Load JPG	☒
3	07/08/17 18:02	Accident Photo	 Load JPG	☒
4	07/08/17 18:02	Accident Photo	 Load JPG	☒
5	07/08/17 18:02	Accident Photo	 Load JPG	☒
Documentation			1 per page	☒
No	Finalized On	Progressive Automotive Pte Ltd (HQ)	Thumbnail	Print
1	07/08/17 18:02	Common Statement	 Load JPG	☒
2	07/08/17 18:02	Individual Statement	 Load JPG	☒
3	07/08/17 18:02	Accident Sketch Plan	 Load JPG	☒
4	07/08/17 18:02	Accident Sketch Plan	 Load JPG	☒
5	07/08/17 18:02	IC AND LICENSE	 Load TIF	☐
6	07/08/17 18:02	IC AND LICENSE	 Load TIF	☐

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) Show Remarks To: ☐ Handling Insurer Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/CT117015315/DRB

Date: 22/01/2018

REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMHCSN1661751600
Claimant Vehicle No :	SKF4376C	Insured Vehicle No :	SKF8070H
Date of Loss:	05/08/2017	Nature of Claim:	TP
		Claim No:	SNM17D04640C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKF4376C	Engine No:	2ZR0433055
Make & Model:	TOYOTA WISH, 1.8 (A)	Chassis No:	ZGE200011052
Reg. Date:	28/09/2009 (Man. Year: 2009)	Odometer:	207078 km
Colour:	Grey		
Engine Capacity:	1797 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/45 R17	Rear Tyre Size:	225/45 R17
Front Left Side:	Falken 5 mm	Rear Left Side:	Falken 5 mm
Front Right Side:	Falken 5 mm	Rear Right Side:	Falken 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	31,525.38	16,955.40	14,569.98	46.22
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,860.00	3,790.00	3,070.00	44.75
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	38,385.38	20,745.40	17,639.98	45.95
Approved Total (Overridden) (S\$)		16,600.00		
(S\$)	38,385.38	16,600.00	21,785.38	56.75
+ GST 7.00/7.00% (S\$)	2,686.98	1,162.00	1,524.98	56.75
Nett Amount (S\$)	41,072.36	17,762.00	23,310.36	56.75

INSPECTION

Date of Assignment:	08/08/2017	
Date Inspected:	08/08/2017 Inspected At:	Teamwork Garage Pte Ltd (HQ) 53 Ubi Ave 1 #01-24, Paya Ubi Industrial Park Singapore 408934
Estimated Period of Repair:	12.0 days	

Adjuster: Janice Lee Si Hua**Manager:** BRYAN TANI

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 22 Jan 2018)
Parts: M1-MPV TOYOTA WISH 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SKF4376C)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	1	*FRONT BUMPER	Dented	819.30 FL	*547.00 FL
2	2	*FRONT BUMPER SIDE COVER	Not fitted	143.90 FL	*- FL
3	1	*FRONT BUMPER SIDE RETAINER	N/S Broken / O/S Serviceable	220.10 FL	*110.05 FL
4	1	*FRONT BUMPER REINFORCEMENT	Bent	482.40 FL	*316.30 FL
5	1	*FRONT BUMPER SPONGE	Torn	261.09 FL	*261.09 FL
6	1	*FRONT BUMPER LOWER GRILLE	Broken	281.54 FL	*281.54 FL
7	1	*FRONT GRILLE	Cracked	361.30 FL	*361.30 FL
8	1	*FRONT SUPPORT PANEL	Bent	781.59 FL	*781.59 FL
9	2	*HORN	Serviceable	314.00 FL	*- FL
10	2	*FRONT HEADLAMP	Broken	1,681.50 FL	*1,378.00 FL
11	1	*FRONT RH CHASSIS	Dented	731.90 FL	*731.90 FL
12	1	*FRONT RH WHEEL HOUSE PANEL	Dented	981.40 FL	*981.40 FL
13	2	*FRONT FENDER	Dented	1,281.70 FL	*1,281.70 FL
14	2	*FRONT FENDER INNER SHIELD	N/S Torn / O/S Dislodged	381.30 FL	*310.40 FL
15	1	*WIPER WASHER TANK	Deformed	261.40 FL	*261.40 FL
16	2	*WIPER WASHER TANK MOTOR	Damaged	281.60 FL	*281.60 FL
17	1	*WIPER PANEL TOP GARNISH	Cut	191.80 FL	*191.80 FL
18	1	*BONNET	Dented	881.40 FL	*722.80 FL
19	1	*BONNET CHROME STRIP	Dislodged	261.20 FL	*261.20 FL
20	1	*BONNET LOCK	Bent	185.09 FL	*185.09 FL
21	1	*BONNET INSULATOR	Serviceable	289.10 FL	*- FL
22	2	*BONNET HINGE	Bent	221.80 FL	*221.80 FL
23	1	*AIRCON CONDENSER	Bent	1,817.40 FL	*1,217.80 FL
24	1	*AIRCON SUCTION PIPE-LOW	Not Necessary	561.40 FL	*- FL
25	1	*AIRCON SUCTION PIPE-HIGH	Not Necessary	581.09 FL	*- FL
26	1	*RADIATOR	Bent	1,417.38 FL	*1,417.38 FL
27	1	*RADIATOR COWLING	Broken	661.40 FL	*300.76 FL
28	1	*RADIATOR FAN MOTOR	Damaged	481.50 FL	*481.50 FL
29	1	*RADIATOR FAN BLADE	Distorted	161.40 FL	*161.40 FL
30	1	*RADIATOR EXPANSION TANK	Deformed	281.30 FL	*281.30 FL
31	1	*ABS CONTROL UNIT	Serviceable	3,031.42 FL	*- FL
32	1	*ABS CONTROL UNIT BRACKET	Serviceable	129.01 FL	*- FL
33	1	*ENGINE COVER LH	Serviceable	151.00 FL	*- FL
34	1	*ENGINE COVER RH	Serviceable	151.00 FL	*- FL
35	1	*ENGINE MOUNTING LH	Serviceable	281.10 FL	*- FL
36	1	*ENGINE MOUNTING RH	Cracked	271.50 FL	*271.50 FL
37	1	*ENGINE MOUNTING FRONT	Cracked	290.20 FL	*290.20 FL
38	2	*FRONT SHOCK ABSORBER	Distorted	1,658.90 FL	*701.10 FL
39	2	*FRONT KNUCKLE ARM	Distorted	1,029.60 FL	*909.14 FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
40	2		*FRONT KNUCKLE BEARING	Damaged	412.30 FL	*412.30 FL
41	2		*FRONT LOWER ARM	Distorted	790.28 FL	*790.28 FL
42	2		*FRONT DRIVER SHAFT	Not Necessary	2,695.90 FL	*- FL
43	2		*STEERING TIE ROD END	Bent	290.30 FL	*290.30 FL
44	1		*STEERING RACK AND PINION	Not Necessary	1,825.29 FL	*- FL
45	1		*REAR BUMPER	Cut	765.21 FL	*545.00 FL
46	2		*REAR BUMPER BRACKET	Serviceable	231.90 FL	*- FL
47	2		*REAR BUMPER DAMPER	Not Necessary	281.50 FL	*- FL
48	1		*REAR LH TAILLAMP	Not Necessary	483.20 FL	*- FL
49	1		*REAR END PANEL	Not Necessary	638.10 FL	*- FL
50	1		*REAR END PANEL GARNISH	Not Necessary	230.40 FL	*- FL
51	1		*FRONT NUMBER PLATE	Cracked	80.00 FS	*45.00 FS
52	1		*SET FRONT BUMPER CLIP	Necessary	60.00 FS	*30.00 FS
53	1		*SET FRONT FENDER INNER SHIELD CLIP	Necessary	50.00 FS	*20.00 FS
54	1		*SET FRONT ENGINE UNDERCOVER CLIP	Necessary	60.00 FS	*20.00 FS
55	2		*SILL GARNISH	Mounting Cracked	2,400.00 FS	*1,000.00 FS
56	2		*RIM	Cut	1,600.00 FS	*1,000.00 FS
57	1		*BRAKE FLUID	Necessary	60.00 FS	*40.00 FS
58	1		*REAR BUMPER CLIP	Necessary	60.00 FS	*30.00 FS
59	1		*SET REAR REVERSE SENSOR	Not Necessary	400.00 FS	*- FS
60	1		*JOINT SEALANT	Necessary	150.00 FS	*40.00 FS
61	1		*COOLANT	Necessary	60.00 FS	*30.00 FS
62	1		*FRONT SUPPORT PANEL GARNISH	Deformed	128.30 FL	*128.30 FL
63	2		*STABILISE LINK	Bent	290.38 FL	*290.38 FL
64	1		*STABILISER BAR	Distorted	138.20 FL	*138.20 FL
65	1		*CROSS MEMBER	Distorted	683.20 FL	*683.20 FL
66	2		*FRONT FOG LAMP COVER	Cracked	292.50 FL	*192.00 FL
67	1		*FRONT BRACE PANEL	Bent	101.40 FL	*101.40 FL
68	1		*FRONT HEADLAMP PANEL O/S	Buckled	195.80 FL	*195.80 FL
69	2		*FRONT TYRE (50%)	Cut	500.00 FS	*250.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$) 40,207.17 21,772.20
 - List Item Discount on L Items 25.00/25.00% (S\$) 8,681.79 4,816.80

Total Parts (S\$) 31,525.38 16,955.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CHECK FRONT, REAR WIRING AND LIGHTNING SYSTEM	New	60.00	30.00
2	REMOVE AND RENEW RADIATOR AND TOP UP COOLANT	New	200.00	50.00
3	REMOVE AND RENEW CONDENSER AND TOP UP GAS	New	200.00	120.00
4	CHECK FRONT WHEEL ALIGNMENT	New	150.00	60.00
5	REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS	New	200.00	180.00
6	MOUNT VEHICLE ON BENCH FOR CHASSIS REPLACEMENT	New	500.00	250.00
7	REMOVE AND REFIT DASHBOARD	New	500.00	0.00
8	REMOVE AND RENEW REAR REVERSE SENSOR	New	150.00	40.00
9	REMOVE AND REFIT REAR LINING, TRIM AND GARNISH	New	200.00	0.00
10	PANEL BEATING ON AFFECTED AREAS	New	2,500.00	1,600.00
11	SPRAY PAINTING ON AFFECTED AREAS	New	2,000.00	1,400.00
12	APPLY ANTI RUST ON AFFECTED AREAS	New	200.00	60.00
Gross Labour Cost (S\$)			6,860.00	3,790.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >