



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

General Details

Involving

1 2011 BMW 523 I (SKB2827C)

Date of Loss

6 October 2017

Time of Loss

19.00

Loss Description

SKB2827C (INSD) HIT SLE8736P (TP) REAR

Comment

Workshop Details

Total Rebate Amount

50518

Nett Loss Amount

\$23,482.00

Assigned Workshop

LKK AUTO CONSULTANTS PTE LTD (OD)

Target Date of Completion *

20/08/2018



Days of work completion *

312



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details Vehicle & Driver Details Vehicle Condition Taxes & Ratio Parts & Labour Miscellaneous

Summary

Vehicle & Driver Details

Vehicle Registration#
SKB2827C

Purchase Date

dd/mm/yyyy



Registration State

SINGAPORE

Registration Date *

13/05/2011



Mileage

123381

Age of Vehicle

6

CATEGORY Manufacturing Year

POLICY INFORMAT... 2011

ASSESSMENT INFO... 2011

Driver Details

CATEGORY Driver Name

FNOL INFORMATI... WONG KENG LOON VINCENT

POST SURVEY INF...

CATEGORY Make

POLICY INFORMAT... BMW

ASSESSMENT INFO...

CATEGORY Model

POLICY INFORMAT... 523 I

ASSESSMENT INFO...

CATEGORY Type

POLICY INFORMAT...

ASSESSMENT INFO...

CATEGORY Type of Paint

POLICY INFORMAT...

ASSESSMENT INFO...

CATEGORY Chassis No

POLICY INFORMAT... WBAFP32090C865615

CATEGORY Date of Birth

FNOL INFORMATI... 13 May 1975

POST SURVEY INF...

 

CATEGORY Age

FNOL INFORMATI... 43

POST SURVEY INF...

CATEGORY Occupation

FNOL INFORMATI... Unknown

POST SURVEY INF...

CATEGORY Education Qualification

FNOL INFORMATI... Other

POST SURVEY INF...

CATEGORY Driving Experience

ASSESSMENT INFO...

CATEGORY Engine No

POLICY INFORMAT... 07977723N52B25AF

ASSESSMENT INFO...

CATEGORY Engine Capacity

POLICY INFORMAT...

ASSESSMENT INFO...

CATEGORY Sum Insured

POLICY INFORMAT... 0

ASSESSMENT INFO...

CATEGORY Market Value

POLICY INFORMAT... 0

ASSESSMENT INFO...

FNOL INFORMATI... 21

POST SURVEY INF...

CATEGORY Driver License #

FNOL INFORMATI...

POST SURVEY INF...

CATEGORY License Type

FNOL INFORMATI...

POST SURVEY INF...

CATEGORY License Issue Date

FNOL INFORMATI...

POST SURVEY INF... 

CATEGORY License Expiration Date

FNOL INFORMATI...

POST SURVEY INF... 

CATEGORY Address

FNOL INFORMATI... 900 DUNEARN ROAD, #04-24 THE BLOSSOM VALE, 589473, Singapore

POST SURVEY INF...

CATEGORY Address type

FNOL INFORMATI... Residential

POST SURVEY INF...

CATEGORY Gender

FNOL INFORMATI... Male

POST SURVEY INF...

CATEGORY Marital status

FNOL INFORMATI... Married

POST SURVEY INF...

CATEGORY Identification #

FNOL INFORMATI... S7515064D

POST SURVEY INF...



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Detailed Assessment

Inspection Date *

19/10/2017



Total Loss

Yes No

Towing Charges

0

Voluntary Excess

0

Compulsory Excess

600

Young/Inexperienced/Unnamed Driver Excess

0

Other Excess

Age of Tyres

Front Tyre Size

245/40R19

Condition of Vehicle at time of survey

General condition

Fair



Steering (Serviceable)

Yes No

Footbrake (Serviceable)

Yes No

Handbrake (Serviceable)

Yes No

Engine Modification

Yes No

Pre-accident condition

Fair



Tyre Condition

Spare wheel

Rear Tyre Size

245/40R19

Front left side

GOODYEAR6mm

Front right side

GOODYEAR6mm

Rear left side

GOODYEAR6mm

Rear right side

GOODYEAR6mm



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Tax Eligibility & Additional Deduction for Parts

Depr./Btrr%

Salvage%

Discount%

Settlement%

Paint Labour/Material Ratio

Paint Labour Ratio

Paint Material Ratio

Cash Loss

 Yes No

Part Supplied by AXA

Yes

No

Save

Assessment Details

General & Workshop Details Vehicle & Driver Details Vehicle Condition Taxes & Ratio Parts & Labour Miscellaneous Summary **Parts**

	EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTIO (PART)
<input type="checkbox"/>		1	1			A/C CONDENSER (NPA)			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		2	1			ENGINE OIL COOLER AIR DUCT LH			Cracked	50				50	Review
<input type="checkbox"/>		3	1			ENGINE OIL COOLER AIR DUCT RH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		4	1			FRONT AIR DUCT ASSY			Cracked	280				280	Review
<input type="checkbox"/>		5	1			FRONT BONNET			Bent	1680				1680	Review
<input type="checkbox"/>		6	1			FRONT BONNET HINGE LH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		7	1			FRONT BONNET HINGE RH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		8	10			FRONT BONNET INSULATOR CLIPS			Necessary	2.5				25	Review
<input type="checkbox"/>		9	1			FRONT BUMPER			Deformed	1450				1450	Review
<input type="checkbox"/>		10	1			FRONT BUMPER LOGO			Necessary	60				60	Review
<input type="checkbox"/>		11	1			FRONT BUMPER LOWER BEAM			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		12	1			FRONT BUMPER LOWER GRILLE CENTRE			Serviceable	0	0	0	0	0	Deny

	EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR./ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTIO (PART:
<input type="checkbox"/>		13	1			FRONT BUMPER LOWER GRILLE LH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		14	1			FRONT BUMPER LOWER GRILLE RH			Deformed	65				65	Review
<input type="checkbox"/>		15	1			FRONT BUMPER LOWER GRILLE TRIM LH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		16	1			FRONT BUMPER LOWER GRILLE TRIM RH			Damaged	30				30	Review
<input type="checkbox"/>		17	1			FRONT BUMPER REINFORCEMENT			Bent	490				490	Review
<input type="checkbox"/>		18	2			FRONT BUMPER RIVET			Necessary	2.5				5	Review
<input type="checkbox"/>		19	1			FRONT BUMPER SPONGE			Cracked	50				50	Review
<input type="checkbox"/>		20	2			FRONT CENTER SENSOR			Damaged	180				360	Review
<input type="checkbox"/>		21	1			FRONT FOG LAMP LH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		22	1			FRONT FOG LAMP RH			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		23	1			FRONT GRILLE INNER BRACKET			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		24	1			FRONT GRILLE LH			Deformed	130				130	Review
<input type="checkbox"/>		25	1			FRONT GRILLE RH			Cracked	130				130	Review
<input type="checkbox"/>		26	1			FRONT HEADLAMP LH			Cracked	1800				1800	Review

	EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTION (PARTS)
		27	1			FRONT HEADLAMP LOWER SUPPORT LH			Cracked	150				150	Review
		28	1			FRONT HEADLAMP LOWER SUPPORT RH			Cracked	150				150	Review
		29	1			FRONT HEADLAMP RH			Cracked	1800				1800	Review
		30	1			FRONT HEADLAMP WASHER BRACKET LH			Serviceable	0	0	0	0	0	Deny
		31	1			FRONT HEADLAMP WASHER BRACKET RH			Serviceable	0	0	0	0	0	Deny
		32	1			FRONT HEADLAMP WASHER JET LH			Serviceable	0	0	0	0	0	Deny
		33	1			FRONT HEADLAMP WASHER JET RH			Serviceable	0	0	0	0	0	Deny
		34	1			FRONT LOWER AIR DUCT			Cracked	55				55	Review
		35	1			FRONT PANEL			Bent	145				145	Review
		36	1			FRONT PANEL TRIM			Serviceable	0	0	0	0	0	Deny
		37	1			FRONT PANEL RUBBER SEAL			Necessary	40				40	Review
		38	1			FRONT REINFORCEMENT BAR LH			Damaged	35	0	0	0	35	Review

EDIT	SR NO	QUANTITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTIO (PART:
<input type="checkbox"/>		39			FRONT REINFORCEMENT BAR RH			Damaged	35				35	Review
<input type="checkbox"/>		40			RADIATOR (NPA)			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		41			RADIATOR LOWER COVER (NPA)			Serviceable	0	0	0	0	0	Deny
<input type="checkbox"/>		42			RADIATOR TOP COVER (NPA)			Serviceable	0	0	0	0	0	Deny

Labour

EDIT	SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR R&R	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT	RI
<input type="checkbox"/>		1	TO REPAIR FRONT FENDER LH & RH. TO REMOVE AND REPLACE ALL ACCIDENT DAMAGED PARTS AND REALIGN ALL AFFECTED AREA	700	0	0	Reviewing		1
<input type="checkbox"/>		2	TO SPRAY PAINT ON ACCIDENT AFFECTED AREA	800	0	0	Reviewing		1
<input type="checkbox"/>		3	TO RESET AND REPROGRAM FRONT HEADLAMP	180	0	0	Reviewing		1
<input type="checkbox"/>		4	TO REMOVE AND REFIX FRONT SENSORS AND CHECK WIRING	60	0	0	Reviewing		1

Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

EDIT	SR NO	NAME	ACTION	AMOUNT	COMMENT	REMOVE	
<input type="checkbox"/>		1	DAYS OF REPAIR : 7 DAYS	Reviewing			
<input type="checkbox"/>		2	FRONT NUMBER PLATE	Reviewing	35	BENT	
<input type="checkbox"/>		3	AIR DUCT BRACKET	Reviewing	25	NECESSARY (SUPPLEMENTARY)	
<input type="checkbox"/>		4	FRONT BUMPER REINFORCEMENT BRACKET (2 PCS)	Reviewing	50	NECESSARY (SUPPLEMENTARY)	

Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Claim Amount \$10,265.00

Claim Amount \$10,265.00

CATEGORY	ESTIMATE	REVISED AMOUNT
Labour	\$1,740.00	\$1,740.00
Miscellaneous	\$110.00	\$110.00
Excess	-\$600.00	-\$600.00
Spare Parts	\$9,015.00	\$9,015.00

Submit for Review