| REC.BY: | M/a Juane | REF: (%) LE | CONTRACTOR OF THE PROPERTY OF THE PARTY OF T | | | | |
|-------------------|-------------------------|---------------------------------------|--|------------|-------------|--------------|---------|
| m (Person): | | · · · · · · · · · · · · · · · · · · · | Bill to: | | | | |
| imated Cost: | | RES / EVA / INV / MY | V I CS | | | nn 276611 | |
| _ | icle No: | SIJ 9040E | VICS | _ Insured: | 2012 | (265 A | |
| Workshop m | | Thium Heng Y | Auat | Let | 8263 | 6275 | |
| (| | BIK 176 SiT | Mary Drix # 0 | 15-14 | E 111 (1) (| 15.003 | |
| | | | Claim No: | 1268 | 5111113 | 1,003 | |
| 9.000 St. 100 St. | | | Excess: | | | 11162017 | |
| Make of Veh: | | | | | D.O.A | 14132017 | |
| Client's Record | | | 30052017 | @ after | llam | Endorsement: | |
| | REP. / REV | | Clause | n | ******* | | |
| Date/Time: | 27037011 | 3220m Person Conta | cted: | - | Acidete-F | | |
| | | 1 | | | | | |
| Date/Time | Action/Instru | ction (×) Est | | | | | |
| Date/Time | | ction (×) Est | | | | | - |
| Date/Time | ard dead, | <u> </u> | | | | | - |
| Date/Time | 913 90HC | ₹ - × N - × | imate | | | | |
| Date/Time | DIAP ERE | 1052017 | imate | | | | |
| Date/Time | Jismontle After repair | ton 31052017 r 02062017 | inate | | | | |
| Date/Time | Jismontle After repair | ton 31052017 r 02062017 | inate | rled | ,470 | 0.92%), 24 | il. |
| Date/Time | Jismontle After repair | ton 31052017 r 02062017 | inate | Cled | ,470 | 0:92%), 24 | y |
| | Sulom | ton 31052017 n 02062017 | #H00 - | Cled | ,470 | 0.920/0), 24 | y |
| | Sulom | ton 31052017 r 02062017 | #H00 - | Cled | ,470 | 0.92°/0), 2d | inh inh |
| | Sulom | ton 31052017 n 02062017 | #H00 - | Cled | ,470 | 0.90%), 2d | in the |



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| 1619 | | Affiliated to Federation Inte | rnationale Des Experts En Autom | | | | |
|-------------|------------------------------------|---|---------------------------------|---|--|--|--|
| AIG | ASIA PACIFIC INS | URANCE PTE LTD | Ref : CS3/LCR17005 | 728/M1tb-1 | | | |
| 78 S CHA | HENTON WAY #08 RTIS BUILDINGSII | 8-16 NGAPORE 079120 | Date: 16-11-2017 Code: LCR | | | | |
| 1. | CONTRACTOR TO STATE | Policy Particu | lars :- THIRD PARTY CLAI | M | | | |
| | Insured Veh. | SLB 3755H | Veh. Inspected | SLJ 9040E | | | |
| _ | Policy No. | | Coverage (\$) | 0.00 | | | |
| | Claim No. | 1268521191SG003 | Excess (\$) | 0.00 | | | |
| | Assign From | JOANE | Assign Date | 16/11/2017 | | | |
| 2. | | Vehicle | Particulars & Condition | | | | |
| AND STATE | Make & Model | | c.c | 0 | | | |
| | Engine No. | HIDDEN | Year of Reg. | | | | |
| | Chassis No. | | Colour | | | | |
| | Odometer | - | Steering | | | | |
| | Brakes | | Modification | | | | |
| | General | | | | | | |
| 3. | | C | onditions of Tyres | | | | |
| | | Size | Make | Balance | | | |
| | R/H Front Tyre | | | mm | | | |
| | L/H Front Tyre | | | mm | | | |
| | R/H Rear Tyre | | | mm | | | |
| | L/H Rear Tyre | | | mm | | | |
| 4. | | Des | cription of Damages | | | | |
| _ | | G | eneral Information | | | | |
| 5. | Accident Date | 14/03/2017 | Inspection Date | 16/11/2017 | | | |
| | Survey held at | THIAM HENG HUAT PTE | 10 - 10 | A SAN DE TRANSPORTE DE LA CONTRACTOR DE | | | |
| | Survey field at | 176 SIN MING DRIVE #05-14 SINGAPORE 575 | | | | | |
| 5a. | STATE OF THE STATE OF | | Remarks | | | | |
| | A)THE INSPECTION | ON WAS CONDUCTED ON CE TO YOUR INSTRUCTION | A"WITHOUT PREJUDICE" BA | SIS. ISED REPAIRS. | | | |

Catherine Chong (LKK Auto)

From: Boyogan, Joane < Joane.Boyogan@aig.com>
Sent: Thursday, 16 November, 2017 2:34 PM

To: admin-d@lkkauto.com

Subject: URGENT! #1268521191SG003#027#paper resuvey for SLJ9040E

Attachments: 1268521191SG_tp survey report.pdf

Dear Catherine,

Noted that LKK has conducted PRI on third party vehicle SLJ9040E

Kindly assist to review enclosed survey report from third party and let us have your recommendation on COR & estimated days to repair

Appreciate if we can have your advice urgently on this matter

Thank you

Regards,

Joane Boyogan

AIG

Complex Claims Examiner
Claims | AIG Asia Pacific Insurance Pte. Ltd.

78 Shenton Way AIG Building #08-16 Singapore 079120 Tel +64191898 | Fax +68357416 joane.boyogan@aig.com | www.aig.com.sg

IMPORTANT NOTICE:

The information in this email (and any attachments) is confidential. If you are not the intended recipient, you must not use or disseminate the information. If you have received this email in error, please immediately notify me by "Reply" command and permanently delete the original and any copies or printouts thereof. Although this email and any attachments are believed to be free of any virus or other defect that might affect any computer system into which it is received and opened, it is the responsibility of the recipient to ensure that it is virus free and no responsibility is accepted by AIG for any loss or demage arising in any way from its use.

| NAC INC | | | |
|--|--|-------|-----|
| | | | |
| The state of the s | Item | CO | NAC |
| 1001 991886 | Prt Number Plate | 100 | 100 |
| 1002 991887 | Frt Number Plate Base | - | - |
| 1003 991889 | Prt Number Plate Garnish | - | +++ |
| 1004 991300 | is a common plane damish | | |
| 1004 351200 | Frt Bumper | FRA | 1 |
| 1005 992341 | Prt Bumper Clips | NES | |
| 1006 991325 | Frt Bumper Bracker | 1 | |
| 1007 991462 | Pit Bumper Side Retainer | - | + |
| 1008 991433 | Frt Bumper Reinforcement | 1 | - |
| 1009 991318 | I to oumper Reintorcement | 1 | |
| 1005 531210 | Frt Bumper Beam | | |
| 1010 991468 | Frt Bumper Sponge | CRD | 1 |
| 1011 991427 | Frt Bumper Protector | 10000 | |
| 1012 991420 | Frt Bumper Pad | + | ++ |
| 1013 991363 | Fri Bumper Grille | - | - |
| 1014 991301 | P. P. Compet Critice | CRA | |
| | Frt Bumper Moulding | | |
| 1015 991407 | Fit Bumper Lower Spoiler | | |
| 1016 991438 | Frt Bumper Senzor | - | 1 |
| 1017 995100 | Frt LH Bumper Fog Lamp Cover | + | + + |
| | Frt RH Bumper Fog Lamp Cover | V4.1 | |
| 1019 995079 | Fact to D | T*L | |
| 1020 00505 | Frt LH Bumper Fog Lamp | | |
| 1020 995080 | Frt RH Bumper Fog Lamp | 184 | 1 |
| 1021 991793 | Frt Grille | CPA | - |
| 1022 991328 | Frt Grille Emblem | NEC | 1 |
| 1023 991799 | Frt Grille Chrome Moulding | 100 | - |
| 1024 991222 | Frt Apron Panel | 1 | |
| 1025 992013 | Frt Support Panel | | |
| 1026 992025 | Fit Support Panel | | |
| 1026 992025 | Frt Support Panel Top Garnish Cover | | |
| 071 337410 | Horn | | |
| 1028 991277 | Frt Brace Panel | | |
| 029 995153 | Fri LH Headlamp Assy | and a | - |
| 030 991821 | Frt RH Headlamp Assy | CRA | |
| 031 995088 | Fit Ret neattamp Assy | | |
| 032 995089 | Fr: LH Side Lamp | | |
| 032 995089 | Fri RH Side Lamp | | |
| 033 990248 | Bonnet | | 4 |
| 034 991328 | Bonnet Emblem | | |
| 035 990287 | Bonnet Look | | -1 |
| 036 990285 | Bonnet insulator | | - |
| 037 990273 | Bonnet Hinge | | - |
| 038 990261 | Bonnet Damper | | |
| 039 990305 | b | | _ |
| | | | |
| | Bonnet Rubber | | - |
| 040 990252 | Bonnet Cable | | |
| 040 990252 041 990311 | Bonnet Cable Bonnet Stand | | |
| 040 990252 041 990311 042 990119 | Bonnet Cable Bonnet Stand Air Con Condenser | | |
| 040 990252 041 990311 042 990119 | Bonnet Cable Bonnet Stand Air Con Condenser | | |
| 040 990252 041 990311 042 990119 043 990122 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pine (Low Pressure) | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 990118 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 990118 046 990133 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 990118 046 990133 047 99014 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 99014 048 990149 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Discharge Hose | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 99014 048 990149 049 995066 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 99014 048 990149 049 995066 050 990111 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Receiver Assy | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 99014 048 990149 049 995066 050 990111 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Receiver Assy | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 052 995074 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Ladiator | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 052 995074 B | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Compressor Assy Air Con Belt Ladiator Cadiator Cowling | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 052 995074 B 053 992738 B | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Ladiator Ladiator Cowling Ladiator Fan Assy | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 052 995074 B 053 992745 R | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Cadiator Cowling Indiator Fan Assy Indiator Fan Clutch | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 052 995074 B 053 992738 B 054 992742 R 055 992745 R 056 992758 R | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Cadiator Cowling Indiator Fan Assy Indiator Fan Clutch | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 049 995066 050 990111 051 995294 052 995074 B 053 992738 B 054 992745 R 056 992758 R | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Liquid Pipe Air Con Compressor Assy Air Con Belt Lodintor Radiator Cowling Radiator Fan Assy Radiator Fan Clutch Indiator Hose Top | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995074 052 995074 053 992738 054 992745 055 992745 056 992757 057 992757 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Compressor Assy Air Con Belt tadiator Cowling adiator Fan Assy adiator Fan Assy adiator Hose Top adiator Hose Bottom | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 F 053 992745 R 056 992757 R 056 992757 R 057 992757 R | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt tediator tediator Cowling adiator Fan Assy adiator Fan Clutch adiator Hose Top adiator Hose Bottom adiator Expansion Tank | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 050 990111 051 995294 052 995074 053 992745 055 992745 056 992757 057 992757 058 992757 059 990151 059 990151 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt tediator tediator Cowling adiator Fan Assy adiator Fan Clutch adiator Hose Top adiator Hose Bottom adiator Expansion Tank Ir Duct | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 050 990111 051 995294 052 995074 053 992745 055 992745 056 992757 057 992757 058 992757 059 990151 059 990151 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt tediator tediator Cowling adiator Fan Assy adiator Fan Clutch adiator Hose Top adiator Hose Bottom adiator Expansion Tank Ir Duct | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 053 992738 054 992738 055 992741 056 992757 057 992757 058 992757 059 990151 059 990151 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (Fligh Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Bell Lodintor Ladiator Cowling Ladiator Fan Assy Adiator Fan Clutch Ladiator Hose Top Adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 F 053 992742 R 053 992743 R 054 992757 R 055 992757 R 056 992757 R 057 992757 R 058 992757 R 059 990151 A 060 990070 A 051 99056 A | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Cowling Ladiator Fan Assy Indiator Hose Top Ladiator Hose Bottom Ladiator Expansion Tank Lir Duct Lir Cleaner Assy In Cleaner Hose | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990149 048 990149 049 995066 050 990111 051 995294 052 995074 F 053 992742 R 053 992743 R 055 992757 R 056 992757 R 057 992757 R 058 992757 R 059 990151 A 060 990070 A 061 990056 A 062 990089 A | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Cowling Ladiator Fan Assy Indiator Hose Top adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 P 053 992742 R 053 992743 R 056 992757 R 057 992757 R 058 992741 R 059 990151 A 060 990070 A 061 990056 A 062 990089 A 063 991712 F | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Fan Assy Indiator Fan Clutch Indiator Hose Top adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator It Exhaust Manifold | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 P 053 992742 R 053 992743 R 056 992757 R 057 992757 R 058 992741 R 059 990151 A 060 990070 A 061 990056 A 062 990089 A 063 991712 F | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Fan Assy Indiator Fan Clutch Indiator Hose Top adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator It Exhaust Manifold | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 F 053 992742 R 053 992745 R 056 992757 R 057 992757 R 058 992741 R 059 990151 A 060 990070 A 061 990056 A 062 991089 A 063 991712 F 064 991713 F | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Fan Assy Indiator Fan Clutch Indiator Hose Top adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator It Exhaust Manifold It Exhaust Manifold | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 053 992738 053 992738 055 992742 056 992757 057 992757 058 992741 059 990151 059 990151 059 990151 059 990151 059 990151 059 99070 059 990151 059 990151 059 99070 059 9907 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Cowling Ladiator Fan Assy Indiator Hose Top adiator Hose Bottom Adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator It Exhaust Manifold Lixhaust Manifold Lixhaust Manifold Lixhaust Manifold Cover Lixhaust Manifold | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 F 053 992738 R 055 992742 R 056 992757 R 056 992757 R 057 992757 R 058 992741 R 059 990151 A 060 990070 A 061 990056 A 062 991089 A 063 991712 F 064 991713 F 055 991054 F 056 991714 F 056 991714 F | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Fan Assy Indiator Fan Clutch Indiator Hose Top adiator Hose Bottom Adiator Hose Bottom Adiator Expansion Tank Ir Duct Ir Cleaner Assy Ir Cleaner Hose Ir Cleaner Resonator I Exhaust Manifold Cover I Exhaust Manifold Sensor (Oxygen) I Exhaust Pine | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 053 992738 053 992738 055 992742 056 992757 057 992757 058 992741 059 990151 059 990 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Cowling Ladiator Fan Assy Indiator Hose Top adiator Hose Top adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator It Exhaust Manifold It Exhaust Manifold Cover It Exhaust Manifold Sensor (Oxygen) Interv | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 053 992738 053 992738 055 992742 056 992757 057 992757 058 992741 059 990151 059 990 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Cowling Ladiator Fan Assy Indiator Hose Top adiator Hose Top adiator Hose Bottom Adiator Expansion Tank Lir Duct Lir Cleaner Assy Ir Cleaner Assy Ir Cleaner Resonator It Exhaust Manifold It Exhaust Manifold Cover It Exhaust Manifold Sensor (Oxygen) Interv | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 990188 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 F 053 992742 R 053 992745 R 054 992757 R 055 992757 R 056 992757 R 057 992757 R 058 992758 R 059 990151 A 060 990070 A 051 990056 A 052 991089 A 053 991712 F 054 991713 F 055 991054 F 056 991714 F 057 990219 B 058 990224 B 058 990224 B | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Ladiator Ladiator Cowling Ladiator Fan Assy Ladiator Fan Clutch Indiator Hose Top Adiator Hose Top Adiator Hose Top Adiator Hose Top Cleaner Assy Ir Cleaner Assy Ir Cleaner Hose Ir Cleaner Hose Ir Cleaner Hose Ir Cleaner Resonator I Exhaust Manifold Cover I Exhaust Manifold Sensor (Oxygon) I Exhaust Manifold Sensor (Oxygon) I Exhaust Pipe Ittery Intercy Cover | | |
| 040 990252 041 990311 042 990119 043 990122 044 990134 045 99018 046 990133 047 990144 048 990149 049 995066 050 990111 051 995294 052 995074 052 995074 053 992738 054 992742 055 992745 056 992757 057 992757 058 992741 059 990151 059 990 | Bonnet Cable Bonnet Stand Air Con Condenser Air Con Fan Assy Air Con Suction Pipe (Low Pressure) Air Con Suction Pipe (Low Pressure) Air Con Suction Hose Air Con Discharge Pipe (High Pressure) Air Con Discharge Hose Air Con Liquid Pipe Air Con Receiver Drier Air Con Compressor Assy Air Con Belt Lodintor Ladiator Cowling Ladiator Fan Assy Indiator Fan Clutch Indiator Hose Top adiator Hose Bottom adiator Hose Bottom adiator Expansion Tank Ir Duct Ir Cleaner Assy Ir Cleaner Assy Ir Cleaner Hose Ir Cleaner Resonator I Exhaust Manifold Cover I Exhaust Manifold Sensor (Oxygen) I Exhaust Pipe Ittery Biscker Ittery Biscker | | |

| | . T | Vehicle No. SLJ | | |
|--------------------|--|--|---------|--------|
| NA | | Item | | AC Qty |
| 107 | | 5 Fuse Box | | 1000 |
| 107 | | 1 Relay Box | | |
| 107 | 99505 | 3 Wiper Washer Tank | - | |
| 107 | 99505 | 2 Wiper Washer Tank Motor | - | - |
| 107 | 99015 | 9 Alternator Assy | - | - |
| 107 | 99016 | O Alternator Belt | - | - |
| 107 | 99268 | 8 Power Steering Pump | - | |
| 107 | 00266 | 9 Power Steering Belt | | |
| 1079 | 99443 | | | |
| 1080 | | | | |
| 108 | | 2 Power Steering Hose | | |
| Marie Marie Salary | 99001 | 0 ABS Pump Control Unit | | |
| 1082 | 99042 | 7 Brake Master Pump Assy | | |
| 1083 | 95040 | 3 Brake Booster Pump Assy | | |
| 1084 | and the second second | many and the second sec | | |
| 108. | | | ingen i | |
| 1080 | the state of the s | | | |
| 1057 | 99094 | 9 Engine Mounting Frt | | |
| 1088 | | O Engine Mounting LH | | |
| 1089 | 99095 | 2 Engine Mounting RH | | |
| 090 | | I Engine Mounting Rear | | |
| 091 | 99223 | 4 Gear Box Mounting | | |
| 092 | 991520 | Frt LH Chassis Member | | |
| 093 | 991520 | Frt RH Chassis Member | | |
| 094 | 990728 | Frt Vertical Cross Member | | |
| 095 | 199186. | Fit Lower Cross Member | | |
| 096 | 995070 | Frt LH Fender | | |
| 097 | 99307 | Prt LH Fender Inner Panel | | |
| 098 | 995147 | Frt LH Fender Lamp | | |
| 099 | 995148 | | | |
| 100 | 991740 | Frt LH Fender Inner Shield | | |
| 101 | 995179 | | | |
| 102 | 995170 | | | |
| 103 | 994025 | | | |
| 104 | 995065 | Fit LH Tyre | | |
| 106 | | | | |
| 107 | 991739 | | | |
| 108 | 001753 | Fit RH Fender Lamp Fit RH Fender Protestor | - | - |
| 109 | 991740 | Frt RM Fender Inner Shield | 101 | |
| 110 | 001994 | Frt RH Mudflap | - | |
| 111 | 002002 | Frt RH Wheel Rim | | |
| 112 | 994025 | | | |
| 113 | 995065 | | - | - |
| 114 | 992093 | Annual Control of the | - | |
| 115 | 992117 | | - | - |
| 16 | 992108 | | - | |
| 17 | AND REAL PROPERTY. | The state of the s | | |
| 13 | 992098 | | | |
| 19 | 991020 | | | |
| 20 | 992140 | Frt Wiper Arm | - | - |
| 21 | | | - | - |
| 22 | 995045 | Wiper Panel Garnish | - | - |
| 23 | 991126 | Firewall Panel | | - |
| 24 | 990753 | Dashboard Assy | - | - |
| 25 | 992282 | Glove Box Cover | - | - |
| 26 | 992281 | Glove Box Compastment | - | - |
| 27 | 994483 | Steame Wheel Ald | - | - |
| 28 | 994485 | Steering Wheel Airbag | | - |
| 29 | TO TOTAL COMMENTS AND ADDRESS. | Steering Wheel Airbag Sensor | | - |
| | 990749 | Dashboard Airbag | | |
| 30 | 990750 | Dashboard Airbag Sensor | | |
| 31 | 990029 | Airbag Control Unit | | |
| 32 | 990864 | Fri Driver Seat | | |
| 33 | 991922 | Fit RH Sear Belt Assy | | |
| 34 | 991899 | Frt Passenger Sent | | 11 |
| 15 | 995182 | Fit LH Sear Belt Assy | | |
| 36 | 990247 | Sticker 0 1 | | |
| | | | 177 | |
| | | men | 10 | |
| | | / / / | | 1-1 |
| | | 1 1 | | |
| | on the board | the same of the sa | | |

No of Items:

ACTELEOUS STMON

Claim Documents

*SLJ9040E (1268521191SG) [SLB3755H] TP THE DIGITAL MAGE PTE LTD Mar 14 2017 10:00AM [Lion City Rentals Pte Ltd] Thiam Heng Huat Pte Ltd

| _ | Ipload Documents | | 3 per p | age 🔻 | V |
|---------|---|--|---------|-----------|----------|
| | tos/Images | LKK Auto Consultants Pte Ltd (HQ) | | Thumbnail | Print |
| No 1 | 30/05/17 14:54 | General View | 0 | Load JPG | 7 |
| 2 | 30/05/17 14:54 | General View | 0 | Load JPG | (Z) |
| 3 | 30/05/17 14:54 | General View | 0 | Load JPG | V |
| 4 | 30/05/17 14:54 | General View | 0 | Load JPG | V |
| 5 | 30/05/17 14:54 | General View | 0 | Load JPG | 0 |
| 6 | 30/05/17 14:54 | General View | 0 | Load JPG | V |
| 7 | 30/05/17 14:54 | General View | 0 | Load JPG | V |
| | 30/05/17 14:54 | General View | 0 | Load JPG | V |
| 8 | 30/05/17 14:54 | General View | 0 | Load JPG | V |
| 9 | | General View | 0 | Load JPG | V |
| 10 | 30/05/17 14:54 | General View | 0 | Load JPG | [7] |
| 11 | 30/05/17 14:54 | General View | 0 | Load JPG | 1 |
| 12 | | General View | 0 | Load JPG | V |
| 13 | | General View | 0 | Load JPG | V |
| 15 | CONTRACT CONTRACT | General View | 0 | Load JPG | 7 |
| | | General View | Ð | Load JPG | V |
| 16 | | General View | 0 | Load JPG | 7 |
| 17 | | General View | 0 | Load JPG | V |
| 18 | | General View | 0 | Load JPG | 7 |
| 19 | | Photographs of Damaged Parts | 0 | Load JPG | 12 |
| 20 | | Photographs of Damaged Parts | 0 | Load JPG | V |
| 21 | | Photographs of Damaged Parts | 0 | Load JPG | V |
| 2.7 | | Photographs of Damaged Parts | 0 | Load JPG | [7 |
| 2. | and the second of the second of | Photographs of Damaged Parts | 0 | Load JPG | 12 |
| 2 | | Photographs of Damaged Parts | 0 | Load JPG | V |
| 2 | | Photographs of Damaged Parts | 0 | Load JPG | 17 |
| 2 | 100000000000000000000000000000000000000 | | 0 | Load JPG | U |
| 2 | | Photographs of Damaged Parts Photographs of Damaged Parts | 0 | Load JPG | 10 |
| 2 | | The state of the s | 0 | Load JPG | 10 |
| 2 | | Photographs of Damaged Parts | 0 | Load JPG | 15 |
| 3 | 0 05/06/17 19:04 | Photographs of Damaged Parts | 0 | Load 3PG | 6 |
| 3 | 05/06/17 19:04 | t named Parts | 0 | - | 1 |
| 3 | 05/06/17 19:04 | | 0 | | . 6 |
| 3 | 3 05/06/17 19:04 | | 0 | | 1 5 |
| 3 | 34 05/06/17 19:04 | | 6 | | |
| 1 | 35 05/06/17 19:05 | | • | | 3 1 |
| 1 | 36 05/06/17 19:05 | | 0 | | |
| 13 | 37 05/06/17 19:05 | | • | - | |
| | 38 05/06/17 19:05 | Photo After Spray | 0 | | |

| | | | | | V |
|-------|--|-----------------------------------|-------|------------|-------|
| | | | 0 | Load JPG | 7 |
| 40 | 05/06/17 19:05 | Photo After Spray | 0 | Load JPG | 2 |
| 41 | 05/06/17 19:05 | Photo After Spray | 0 | Load JPG | (V) |
| 42 | 05/06/17 19:05 | Photo After Spray | o | Load JPG | 7 |
| 43 | 05/06/17 19:05 | Photo After Spray | U | Load 3r G | 12.0 |
| 1,000 | L. Solution of the Control of the Co | | 1 per | page • | 7 |
| Doc | umentation | 4-114 (110) | | Thumbnail | Print |
| No | Relabel/Reorder | LKK Auto Consultants Pte Ltd (HQ) | 0 | Load PDF | |
| 1 | 07/06/17 15:12 | LAWYER LETTER | | T - WALLEY | |

Documents Checklist

| Chromosom respective and the second s | Reset Save Print |
|--|------------------|
| DOCUMENTS CHECKLIST | |
| There are no document checklists configured. | |
| Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) | |
| Our Checklist Remarks - LKK Rulo Company | |
| | |
| Show Remarks To: Handling Insurer Note: Remarks are private unless you show it to other parties. | |

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25. Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No:

CS3/LCR17005728/M1BE2

Date:

19/06/2017

REFERENCE

Handling

AIG Asia Pacific Insurance Pte. Ltd.

Policy No:

Insurer: Claimant

SLJ9040E

Insured Vehicle No: SLB3755H

Vehicle No: Date of Loss:

14/03/2017

Nature of Claim:

TP

Claim No: 1268521191SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:

SLJ9040E

Make & Model:

TOYOTA HARRIER, 2.0 (A)

Engine No: Chassis No: 3ZRB799561

Reg. Date:

29/12/2016 (Man. Year: 2016) Maroon

Odometer:

ZSU600080653 18895 km

Colour:

Engine Capacity: Market Value/New Car Price: 1986 cc N/A

Sum Insured (S\$):

Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:

Steering (Serviceable):

Yes Footbrake (Serviceable): No Pre-accident Condition:

Yes

Handbrake (Serviceable): CONDITION OF TYRES

Yes Engine Modification:

235/55 R18

Front Tyre Size: Front Left Side:

235/55 R18 Bridgestone 7 mm Rear Tyre Size: Rear Left Side:

Bridgestone 7 mm

Front Right Side:

Bridgestone 7 mm

Rear Right Side:

Bridgestone 7 mm

The above values represent the remaining tyre treads depth

| Labour | 0.00 | 0.00 | 0.00 | |
|--|----------------------------|----------------------------|--------------|--------|
| Paintwork Labour | 0.00 | 0.00 | 0.00 | |
| Towing | 0.00 | 0.00 | 0.00 | |
| COST OF CLAIMS Parts Miscellaneous Items | Repairer's 0.00 0.00 | Adjuster's 0.00 0.00 | 0.00 0.00 | Diff % |

INSPECTION

Date of Assignment:

22/03/2017

Date Inspected:

30/05/2017 Inspected At:

Thiam Heng Huat Pte Ltd (SIN MING)

176 SIN MING DRIVE, #05-14

Singapore 575721

Estimated Period of Repair:

2.0 days

Adjuster: MA CHIN FOOK

Manager: CATHERINE CHONG KAI LING

NOTE. This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

| No. | Oty Part No. | Particulars | Condition | Repairer's | Amount |
|-------|---------------|---|-------------------|------------|--------|
| _ | | *FRT BUMPER | Cracked | 0.00 F | *-F |
| 1 | 1 | FRT BUMPER CLIPS | Necessary | 0.00 F | *- F |
| 2 | 6 | FRT BUMPER SPONGE | Cracked | 0.00 F | *-F |
| 3 | 1 | FRT BUMPER GRILLE | Cracked | 0.00 F | *- F |
| 4 | 1 | | Cracked | 0.00 F | *-F |
| 5 | 1 | *FRT RH BUMPER FOG LAMP COVER *FRT RH BUMPER FOG LAMP | Cracked | 0.00 F | *- F |
| 6 | 1 | | Cracked | 0.00 F | *-F |
| 7 | 1 | *FRT GRILLE | Necessary | 0.00F | *- F |
| 8 | 1 | FRT GRILLE EMBLEM | Cracked | 0.00 F | *-F |
| 9 | 1 | *FRT LH HEADLAMP ASSY | Gradines | 235765 | |
| F=Fra | anchise part. | | Total Parts (S\$) | 0.00 | 0.00 |

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or witholding of material facts may allow insurance companies to repudiate policy ability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- 6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available

| aforesaid. | | |
|--|-----------------------------------|------|
| TO VALUE AND A STATE OF THE STA | ACCIDENT STATEMENT | |
| Date Of Report | 14/03/2017 16:47 | |
| Date Of Accident | 14/03/2017 10:15 | |
| Exact Location Of Accident | TRADE HUB 21 LVL 2 CARPARK #02-08 | |
| Country/State of Loss | Singapore | |
| | DETAILS OF OWN VEHICLE | 9-13 |
| Vehicle Registration Number | SLJ9040E | |
| Insured/Policyholder | | |
| Name Of Registered Owner | THE DIGITAL MAGE PTE LTD | |

Name Of Registered Owner 201618340H

Co Reg No

MIKE@THEDIGITALMAGE.COM Email Address

(LOCAL) +65-97261816 Mobile Phone No Office-97261816 Alternative Phone No

Vehicle Particulars

TOYOTA Manufacturer

HARRIER-2.0 (A) Model

Exact Purpose for which vehicle was being used

at time of accident

Are you claiming under your own insurance policy

for repair to your vehicle?

Third Party If No. Please state action to be taken Private Car Vehicle Category

Insurance Company

NTUC Income Insurance Co-operative Ltd Name of Insurance Company

WORK

Comprehensive Type Of Coverage

Fleet Policy

5087164382 Policy Number

Cover Note Number

Driver

NEO DETING (LIANG DETING) Name of Driver

S8230803B NRIC No 21/09/1982 Date Of Birth Indoor Occupation 17/08/2009 Date Of Driving Pass

7 Years And 6 Months Driving Experience

Gender

(Local) +65-90920751 Mobile Number

Fax Number Contact Number

MIKE@THEDIGITALMAGE.COM EMail Address

430 ANG MO KIO AVE 3 Address

24-2598

560430 Postcode

Was driver an employee of the Insured's Company No

If No, Relationship of the Driver with the Insured Owner

Vehicle Registration Number of Driver's Own

Vehicle

Insurance Company of Driver's Own Vehicle

No

No

No

No

General Information of the Accident

Damaged whilst parked Type Of Accident

Clear Weather Conditions Dry Road Surface

Other Information

Was any foreign vehicle involved in this accident? No

Was any body injured in the Accident?

Was any other material or property damaged? Yes

I have been approached by unknown person(s) soliciting/offering accident claims assistance.

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police?

If Yes, Please state which Police Station

Was notice of intended Prosecution given?

If Yes, against whom?

Circumstances of Accident

REFER TO SKETCH

Attachment(s)

Are accident photos available for attachment?

Yes No

Was there any video captured by Car Camera?

No

Was there any audio recorded?

DETAILS OF OTHER VEHICLE PROPERTY 1

SLB3755H Vehicle Registration Number

Vehicle Make/Model/Colour

Details Of Properties

CHUNG KIM CHOI Name of Driver

S2621406H NRIC/Passport Number 97261816 Contact Number

Address Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

Sketch Plan

| cribe Circumstances of the Accident | |
|--|---------------------------------------|
| | |
| On the share motioned three le clothe. I was not trade. I then I then I then I then the food down door | do 21, meetly my cled when I come out |
| I reclaid these was a deat of chip on my whole I returned | my video recording and cold that NAVC |
| ivenue immediately. | 1 |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |
| | |

Declaration

We declare the foregoing particulars are true in every respect.

M)THE DIGITAL MAGE

THE DIGITAL MAGE PTE LTD Reg No. 201618340H

14/3/A 1300h

Witnessed by Reporting Centre

Policyholder's Signature / Date & Time

Driver's Signature (# driver is not the policyholder) / Date & Time

Personnel

SKETCH PLAN

IMPORTANT NOTICE


- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Formmust be completed by the Policyholder and/or the Authorised Driver.
- Information provided must be as <u>truthful and accurate as possible</u>. Any wilful misrepresentation or withholding of material facts may allow insurance companies to <u>repudiate policy liability</u>.
- The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- The report will be forwarded by the insurers of the GiA Records Management Centre established by the General insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. Consent under the Personal Data Protection Act (PDPA)

Lunderstand, acknowledge, agree and consent that:

- (a) My Insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law yers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims:
- (ii) investigating the accident and/or my claims;
- (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
- (iv) administering my claims (including the mailing of correspondence, statements, invokes, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
- (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' law yers/law firms, may/are permitted to collect, use, disclose and/or process my Personal information for one or more of the above Purposes; and
- (c) my Personal information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law yers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

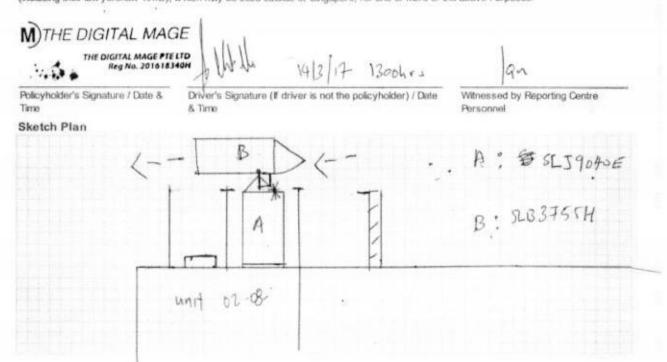

Reg. No. 52941122M

470 Segar Road #09-232 Singapore 670470 Tel: 98505311 Fax: 63107269

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S: The Digital Mage Pte Ltd

C/O Thiam Heng Huat Pte Ltd Blk 176 Sin Ming Drive #05-14

Sin Ming Autocare Singapore 575721

Date Our Ref

: 01 August 2017

: TP/THH/SLJ9040E/7692

REFERENCE PARTICULARS

Date of Accident

: 14 March 2017

Type of Inspection : Third Party Claim

Date of Inspection

: 29 May 2017

Date of Re-Inspn : 02 June 2017

VEHICLE PARTICULARS

Registration No

: SLJ 9040 E

Engine No

: 3ZRB799561

Make Model Year

: Toyota

Chassis No

: ZSU600080653

: Harrier 2.0 Elegance AT ABS D/AIRBAG 2WD : 2016

Odometer Colour

: 18895 km : Brown

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition

: Good

General Body Work: Good

: Serviceable

Foot Brake Hand Brake

: Serviceable : Serviceable Steering Lightings

: Serviceable

TYRE CONDITION (Remaining estimated life of tyre in mm)

Make Thread Balance Size Front Near side : Bridgestone 235/55R18 8 mm Front Off Side : Bridgestone 235/55R18 8 mm Rear Near Side : Bridgestone 235/55R18 8 mm Rear off Side : Bridgestone 235/55R18 8 mm

GENERAL DESCRIPTION OF DAMAGES



The vehicle sustained damage at the front off side portion. For details, refer to assessment for repairs and photographs

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was \$5,100.00 nett at lump sum basis. (Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs: Four (4) working days.

Enclosed Twenty-Eight (28) photographs depicting damage to the vehicle and after repair.

Inspection conducted at : Blk 176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Name of Workshop: Thiam Heng Huat Pte Ltd

In accordance to your instruction, we have not authorise repairs and inspection was conducted strictly on a "WITHOUT PREJUDICE BASIS".

Our Ref : TP/THH/SLJ9040E/7692

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

| | | QTY | ASSESSED | | ORIGINAL | | REVISED |
|---|---|-------------|-------------------------------|------|-----------|----|-----------------|
| | SPARE PARTS | PC/SET | CONDITION | | QUOTATION | | QUOTATION |
| 1 | Front bumper | 1 | Torn/Deformed | \$ | 1,720.00 | S | 1,720.00 × 2 |
| 2 | Front bumper side retainer L/R @ 68.50 | 2 | RH only (Damaged) | 5 | 137.00 | 5 | 68.50 / 9 |
| 3 | Front bumper form | 1 | Serviceable | \$ | 174.50 | | ~ |
| 1 | Front bumper grille | 1 | Serviceable | \$ | 464.30 | | ~ |
| ; | Front bumper lower lip | 1 | Scraped | S | 297.00 | S | 297.00 × |
| 5 | Front radiator grille | 1 | Sheared off | S | 789.50 | S | 789.50 X C |
| 7 | Front headlamp RH | 1 | Scraped/Hld Cracked | S | 2,960.00 | \$ | 2,960.00 > |
| | Front fog lamp RH | 1 | Hld Cracked | 5 | 370.00 | S | 370.00 × 🔾 |
| , | Front fog lamp cover RH | 1 | Torn | \$ | 175.00 | S | 175.00 × 9 |
| | | | | S | 7,087.30 | S | 6,380.00 |
| | | | Less 25% | \$ | 1,771.83 | S | 1,595.00 |
| | | | | \$ | 5,315.48 | \$ | 4,785.00 |
| | S/Nett Item | • 55.4 | | s | 45.00 | s | 45.00 🔀 🅢 |
| 0 | Front bumper clips | 1 set | Necessary Parts Total: | 5 | 5,360.48 | S | 4,830.00 |
| 1 | LABOUR CHARGES & MISC Spray painting on above new & repaired popaint materials. | | | s | 800.00 | s | 650.00 2 |
| 2 | Remove damaged parts, straighten, knock | | | | | | |
| | panel, panel beating, remove & reinstall no repairs, reshape, refit, adjust, replace and r | | | S | 850.00 | S | 700.00 2 |
| 3 | To carry out diagnostic checks and reset. | cuilgii uii | 1.74.4-4 (1.00) (1.00) (1.00) | S | 250.00 | S | $180.00 \times$ |
| 4 | Check wiring, lighting system, focus headl | ights & ce | ntre locking system | 3350 | | | |
| * | for proper function. | | | \$ | 50.00 | \$ | 30,00 ≤ |
| | na proper remember | | Labour Total: | S | 1,950.00 | S | 1,560.00 |
| | | Total | Parts and Labour | 5 | 7,310.48 | s | 6,390.00 |
| | | | | | | | |

POINT OF IMPACT

The impact was confined to the front off side portion of the vehicle.

The damages appeared to be consistent as per the accident report statement.

Please refer the attached schedule and photographs for details.

: TOYOTA HARRIER 2.0 ELEGANCE AT ABS D/AIRBAG 2WD

Our Ref : TP/THH/SLJ9040E/7692

ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.

CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of \$5,100.00 nett corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully

KTO Automobile Assessors

Ong Ah Keng (CAE, AMIMI, MSAAA)

Automotive Appraiser































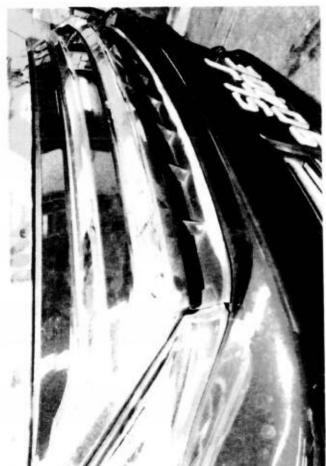



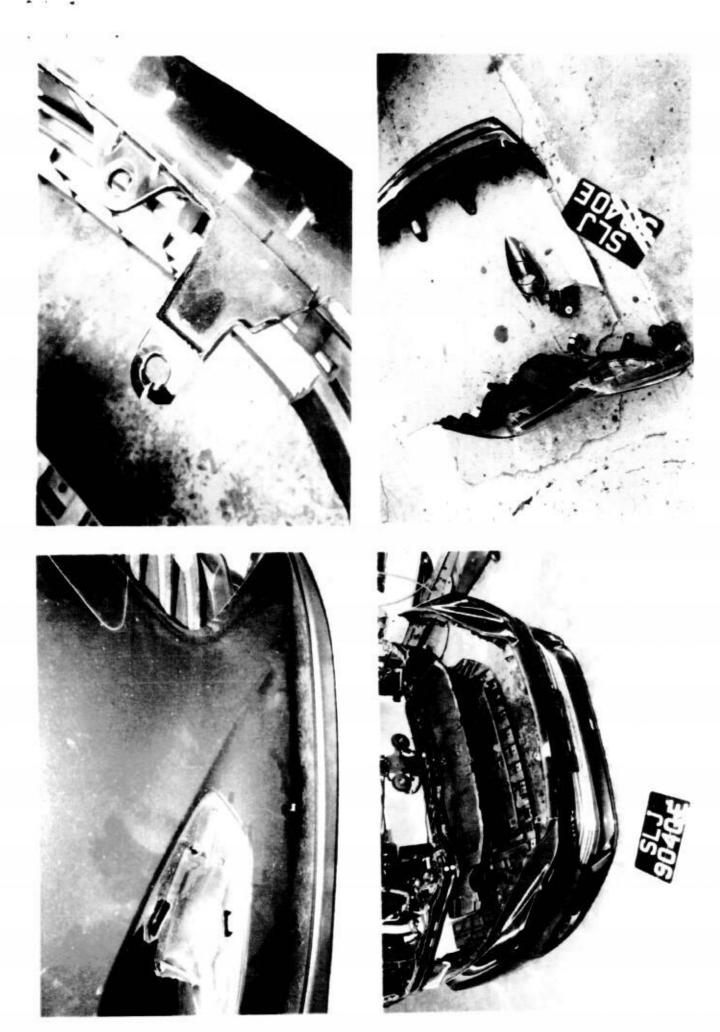



















LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

| 5000000 | | Affiliated to Federation Inte | rnationale Des Experts En Auton | nobile | | | |
|----------|--|---|--|------------|--|--|--|
| AIG ASIA | A PACIFIC IN | SURANCE PTE LTD | Ref : CS3/LCR17005728/M1tbe2-1 | | | | |
| | ITON WAY #0 S BUILDINGS | 08-16 INGAPORE 079120 | Date: 12-12-2017 Code: LCR | | | | |
| l | | Policy Particu | lars :- THIRD PARTY CLA | M | | | |
| Ins | ured Veh. | SLB 3755H | Veh. Inspected SLJ 9040E | | | | |
| Po | licy No. | | Coverage (\$) | 0.00 | | | |
| Cla | aim No. | 1268521191SG003 | Excess (\$) | 0.00 | | | |
| As | sign From | JOANE | Assign Date | 16/11/2017 | | | |
| 2. | | Vehicle F | Particulars & Condition | | | | |
| Ma | ke & Model | TOYOTA HARRIER | c.c | 1986 | | | |
| En | gine No. | HIDDEN | Year of Reg. | 2016 | | | |
| Ch | assis No. | ZSU600080653 | Colour | MAROON | | | |
| Od | ometer | 18895 | Steering | IN ORDER | | | |
| Bra | akes | IN ORDER | Modification | SPORTS RIM | | | |
| Ge | neral | GOOD | | | | | |
| 3. | | Co | nditions of Tyres | | | | |
| | | Size | Make | Balance | | | |
| R/H | H Front Tyre | 235/55 R18 | BRIDGESTONE | 7 mm | | | |
| L/H | Front Tyre | 235/55 R18 | BRIDGESTONE | 7 mm | | | |
| R/H | Rear Tyre | 235/55 R18 | BRIDGESTONE | 7 mm | | | |
| L/H | Rear Tyre | 235/55 R18 | BRIDGESTONE | 7 mm | | | |
| ١. | Description of Damages | | | | | | |
| | E VEHICLE SU MAGES SEE D | STAINED DAMAGES AT THI ETAILS. | E FRONT PORTION. | | | | |
| 5. | | Ger | neral Information | | | | |
| Ac | cident Date | 14/03/2017 | Inspection Date | 30/05/2017 | | | |
| Su | rvey held at | THIAM HENG HUAT PTE L | TD | | | | |
| | ************************************** | 176 SIN MING DRIVE #05-14 SINGAPORE 575721 | | | | | |
| 5a. | | | Remarks | | | | |
| | | | "WITHOUT PREJUDICE" BAS S, WE HAVE NOT AUTHORIS | | | | |
| 5b. | | Estin | nate Days of Repair | | | | |
| ES. | TIMATED NOR | MAL PERIOD FOR REPAIR: | 2 Working Day | 'S | | | |



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLJ 9040E

| Qty | Description of Parts | Condition | Estimate By Workshop (\$)) | Our Adjusted (\$) |
|-----|---|----------------------------|-------------------------------|----------------------|
| | REPLACEMENT OF PARTS | - NO. 100 | | |
| 1 | FRONT BUMPER | TO REPAIR SEE LABOUR | 1,720.00 | - |
| 2 | FRONT BUMPER SIDE RETAINER L/R @\$68.50 | SERVICEABLE | 137.00 | |
| | FRONT BUMPER FORM | SERVICEABLE | 174.50 464.30 | |
| 1 | FRONT BUMPER GRILLE | SERVICEABLE | 297.00 | |
| 1 | FRONT BUMPER LOWER LIP | SERVICEABLE | 789.50 | |
| | FRONT RADIATOR GRILLE | SERVICEABLE SERVICEABLE | 2,960.00 | 1 |
| | FRONT HEADLAMP RH | SERVICEABLE | 370.00 | 1 |
| | FRONT FOG LAMP RH | SERVICEABLE | 175.00 | 1 |
| 1 | FRONT FOG LAMP COVER RH | SERVICEABLE | -1,771.83 | 1 |
| | LESS 25% DISCOUNT | | 5,315.47 | |
| | SPECIAL NETT ITEMS | | 45.00 | |
| 1 | SET FRONT BUMPER CLIPS (SN) | NOT NECESSARY | 45.00 | |
| | LABOUR SPRAY PAINTING ON ABOVE NEW & REPAIRED PARTS | | 800.00 | 200.0 |
| | INCLUDING SUPPLY OF PAINT METERIALS. REMOVE DAMAGED PARTS, STRAIGHTEN, KNOCK OUT DENTS, JACK OUT DAMAGED PANEL, PANEL BEATING, REMOVE & REINSTALL NECESSARY REALIGN ALL RELEVANT PARTS. INCLUSIVE OF THE REPAIR OF | 55 | 850.0 | 0 200.0 |
| | FRONT BUMPER. TO CARRY OUT DIAGNOSTIC CHECKS AND RESET. | NOT NECESSARY | 250.0 | 0 |
| | CHECK WIRING, LIGHTING SYSTEM, FOCUS HEADLIGHTS & CENTRE LOCKING SYSTEM FOR | NOT NECESSARY | 50.0 | 00 |
| | PROPER FUNCTION. | | | - |
| | | | 1,950.0 | 00 400. |
| _ | ORAND TOTAL | | 7,310.4 | 47 400. |
| | GRAND TOTAL | | | 40 |

RECOMMENDED COST OF REPAIRS 400.00

Report Ref No. CS3/LCR17005728/M1tbe2-1





Report Ref No. CS3/LCR17005728/M1tbe2-1

MA CHIN FOOK

Automotive Assessor

St. S.

ADRIAN LING WAI PING

B.Eng, AMSOE, AMIRTE, AMSAE-A, M. MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contact or tort, is accepted to any third party who may reply on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.