

ASS. REC. BY:

REF: CS/FCI17023138/K/bnz

Special Instruction:

Surveyor:
CWS

Kenneth

ASSIGNMENT (Office)

From (Person):

Joanna Yong

of

FCI

Date/Time: 9:34am @ 6/12/17

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SHD151G

Insured:

SHC2007H

at Workshop m/s

Trans-Cab

Tel:

6287 6666

of

NO. 2 AMK Street 63

Policy No:

Claim No:

D17011153 MFSH

Sum Insured:

Excess:

Make of Veh:

D.O.A.

1/12/2017

(Client's Record)

CA / REV / REP. / REV 24 HRS

'wp'

H.O.D. Endorsement:

Date/Time:

9:55am @ 6/12/17

Person Contacted:

Candy

Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction (✓) Estimate
	SHD151G-CS/RSI11004038/Ks2n- D.O.A: 1/03/2011
	SHC2007H-NA/MSG12025029/e1 D.O.A: 28/12/2012
2/12	Revert preli advise via memmen
	Part by Part \$18678.05, 10 days (Red: 54555.10:74%)

ASSIGNMENT

From: _____ Date: **6/12/17**

Estimated Cost: _____

OD ☒ WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: **SHD 151 G**

at Workshop n/s **Trans-Cab**

of **No. 2 AMK Street 63**

Insured: _____

Policy No: _____

Claims No: _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bel. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: **10** days Res.: Yes or No

Lump Sum: **1.31** % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS **'wps**

Date: _____ Person Contacted: _____

Vehicle: IN / OUT



Veh No: **SHD 151 G** Vt Page: **09 15**

Type: M. Car / M. Cycle / Bus / Van / Lorry / ☒ Prime Mover

Truck / Trailer or

Make: **Renault Latitude** **A1** **1993**

Colour: **White/Red** **A2** Insured / Std / NI / NA

So. Reading: **275789** **A3** Insured / Std / NI / NA

Eng No: _____

C/No: **VFIABL 15 Ave 282259**

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: ☒ In order / Jammed / Leaked / Burnt or

Brake: ☒ In order / Jammed / Leaked / Burnt or

Mod: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size: **F: 215/60R16**

Rling Long

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front: _____ Rear: _____

R. Bal: **3** mm R. Bal: **4** mm

L. Bal: **3** mm L. Bal: **6** mm

D.O.A: **1/12/17** D.O.I: **6/12/17**

Survey held at: _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear n/s

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

7/12 15h pass to Catherine

RECEIVED 14 JUN 2018

Date/Time File Passed: ☐ Prel. Report

H/b Typist ☒ Final Report

Date/Time File Returned:

Days Of Repair: **10**Resurvey No. of Trip: **1**

Survey Fee

Transportation

Add Fee: ☐ Site Insp \$☐ Interview \$☐ Tech. Insp \$☐ Med. Insp \$

64 x 15 = 960

170 + 960

50

50

21

Report Format:

TP

Lump Sum / I.B. \$: **18648.05**

550
652
18/6/18

1251



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No. 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
FIRST CAPITAL INSURANCE LTD		Ref : CS/FCI17023138/Ktb	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877		Date : 06-12-2017	
		Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM			
Insured Veh.	SHC 2007H	Veh. Inspected	SHD 151G
Policy No.		Coverage (\$)	0.00
Claim No.	D17011153MFSH	Excess (\$)	0.00
Assign From	CWS (JOANNE YONG)	Assign Date	06/12/2017
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	01/12/2017	Inspection Date	06/12/2017
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		
5a. Remarks			
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: D17011153MFSH

Date: 8/12/2017

Our Ref: CS/FCI17023138/Ktb

The Motor Claims Department
First Capital Insurance Ltd

Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SHD 151G

Please be informed that we had conducted the inspection of the abovementioned vehicle on 6/12/2017 at the premises of M/s Trans-Cab at and have the following to report:-

Workshop Estimate Amount	: S\$ 73,233.15
Revised Estimate Amount	: S\$ 18,678.05
"Check" Items Amount	: S\$ -
Market Value	: S\$ -
LTA Reimbursement Value	: S\$ -
Nett Value	: S\$ -

Description of Damage:


The vehicle sustained damages
At rear n/s portion.

Repair days: 10

Yours faithfully

Kenneth

Motor Surveyor

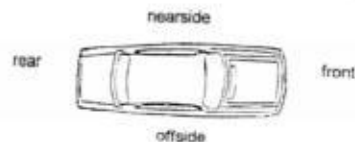

First Capital Insurance Limited

A FAIRFAX Company

Company Reg. No. 195000106C
GST Reg. No. M2-0001676-9

MOTOR SURVEY ASSIGNMENT

Date	04-12-2017	Our Ref No. D17011153MFSH
Accident Date	01-12-2017	Claim Type. Third Party
Insured Vehicle	SHC2007H	Third Party Vehicle. SHD151G
Survey Location	NO. 2 ANG MO KIO STREET 63	
Contact Person.	CANDY KONG	
Contact No.	62876666/ 0	Fax No. 62571330
Survey Type	WITHOUT PREJUDICE:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	TRANS-CAB AUTO SERVICES PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	JOANNEY	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Job Sheet (/ClaimWS/Surveyor/JobSheet/231369)



PRI Documents



Close



PRI Header Details

Claim No	D17011153MFSH	Policy No	D-15072701MFSH	Claimant S.No & Name	1 & TRANS-CA
Workshop Name	TRANS-CAB AUTO SERVICES PTE LTD (Contact Person : CANDY KONG)	Survey Location & Contact Details	NO. 2 ANG MO KIO STREET 63 Mobile: 0 , Phone: 62876666 , Fax: 62571330 EmailId: ZHEWEI.KEK@TRANSCAB.COM.SG		
Our Surveyor	LKK AUTO CONSULTANTS PTE LTD	Instructions To Surveyor	WITHOUT PREJUDICE:		
Insured Name	COMFORT TRANSPORTATION PTE LTD	Insured Vehicle No	SHC2007H	TP Vehicle No	SHD151G
PRI Recieved Date	05-12-2017 08:30:54 PM	Surveyor Appointed Date	06-12-2017 09:33:06 AM	Surveyor Accept Date	06-12-2017 11

Survey Report Upload

Surveyor Inspection Date *:		Surveyor Report Date	06-12-2017	Upload Survey Report *:	Choose File
------------------------------------	--	-----------------------------	------------	--------------------------------	--

Vehicle Particulars

Make	Please Select Make ▼	Model	Please Select Model ▼	Year	Select Year ▼
Chasis No		Engine No		Mileage	
Color		Cubic Capacity			

Multiple Documents Upload

File Name

Action

Surveyor Job Remarks

Remarks

Denise Tay (LKKAuto)

From: Denise Tay (LKKAuto)
Sent: Friday, 8 December, 2017 10:18 AM
To: Admin-D (LKKAuto); 'Claim Workflow System'; assignments
Cc: JOANNEYONG@FIRST-INSURANCE.COM.SG; SUR
Subject: RE: SURVEY ASSESSMENT - D17011153MFSH/1
Attachments: PRELI ADVISED SHD 151G.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle **SHD 151G**

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAuto)
Sent: Wednesday, 6 December, 2017 9:57 AM
To: 'Claim Workflow System' <cwsmotorclaims@first-insurance.com.sg>; assignments <assignments@lkkauto.com>
Cc: JOANNEYONG@FIRST-INSURANCE.COM.SG; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D17011153MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Best Regards,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claim Workflow System [<mailto:cwsmotorclaims@first-insurance.com.sg>]
Sent: Wednesday, 6 December, 2017 9:33 AM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWSMOTORCLAIMS@FIRST-INSURANCE.COM.SG; JOANNEYONG@FIRST-INSURANCE.COM.SG
Subject: PRI: SURVEY ASSESSMENT - D17011153MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Best Regards,

Admin Team

Claim Workflow System

Motor Claims Department

First Capital Insurance Limited

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type	Company
Owner ID	3878K
Vehicle Details	
Vehicle No.	SHD151G
Vehicle to be Exported	Yes
Intended De-registration Date	01 Dec 2017
Vehicle Make	RENAULT
Vehicle Model	LATITUDE 2.0L DCI AUTO D/AB 4DR
Primary Colour	Red
Manufacturing Year	2015
Engine No.	M9R8839C002849
Chassis No.	VF1ABL15AUC282259
Maximum Power Output	127.0 kW (170 bhp)
Open Market Value	\$19,998.00
Original Registration Date	04 Sep 2015
First Registration Date	04 Sep 2015
Transfer Count	0
Actual ARF Paid	\$19,998.00
Intended PARF Rebate Details	
PARF Eligibility	Yes
PARF Eligibility Expiry Date	03 Sep 2023
PARF Rebate Amount	\$14,998.00
Intended COE Rebate Details	
COE Expiry Date	03 Sep 2023
COE Category	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years)	8
PQP Paid	\$47,373.00
COE Rebate Amount	\$34,082.00
Total Rebate Amount	\$49,080.00
Message	
Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon	

TRANS-CAB AUTO SERVICES PTE LTD

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHD151G - FCIL**AAD1712-004***Not Authorized
Resurvey By pain**7/12/17*

Vehicle No.:

Chassis No.:

Vehicle Make:

Vehicle Model:

Date of Accident :

Third Party Insurer :

SHD151G - CANDY

VF1ABL15AUC282259

RENAULT

LATITUDE

01.12.2017

FCIL**PART****LIST**

1	1	BUMPER COVER REAR	\$	<i>Tr</i> 1,108.46 ✓
2	1	BUMPER LOWER REAR	\$	<i>CR</i> 768.84 ✓
3	1	BUMPER BRACKET CTR REAR	\$	<i>Sn</i> 113.47 X
4	1	BUMEP R BRACKET SIDE LH REAR	\$	<i>CR</i> 135.97 ✓
5	1	BUMEP R BRACKET CTR LH REAR	\$	<i>CR</i> 44.99 ✓
6	1	BUMEP R BRACKET SIDE RH REAR	\$	<i>Sn</i> 135.97 X
7	1	BUMEP R BRACKET CTR RH REAR	\$	<i>Sn</i> 44.99 X
8	1	BUMPER BEAM REAR	\$	<i>Bz</i> 777.52 ✓
9	1	BUMPER BEAM BRACKET LH REAR	\$	<i>Bz</i> 225.95 ✓
10	1	BUMPER BEAM BRACKET RH REAR	\$	<i>R</i> 225.95 X
11	1	BUMPER REFLECTOR LH	\$	<i>Bz</i> 43.61 ✓
12	1	BUMPER REFLECTOR RH	\$	<i>Sn</i> 43.61 X
13	1	BOOT REAR	\$	<i>Bz</i> 2,872.68 ✓
14	2	BOOT RUBBER PLUG	\$	<i>Sn</i> 221.81 X
15	1	BOOT FINISHER	\$	<i>Sn</i> 470.06 X
16	1	BOOT SWITCH	\$	<i>Sn</i> 168.13 X
17	1	BOOT TRIM BOARD	\$	<i>Return</i> 914.87 ✓
18	1	BOOT LOCK	\$	<i>R</i> 202.67 X
19	1	BOOT LOCK CATCH	\$	<i>R</i> 74.40 X
20	1	BOOT LOCK LINKAGE	\$	<i>Sn</i> 34.53 X
21	1	BOOT LOCK LINKAGE HOLDER	\$	<i>Sn</i> 154.52 X
22	1	BOOT LOCK CATCH TRIM BOARD	\$	<i>Sn</i> 249.24 X
23	1	BOOT WHEATERSTRIP	\$	<i>Dis/Inv</i> 323.05 ✓
24	1	BOOT REFLECTOR LAMP LH	\$	<i>CR</i> 493.35 ✓
25	1	BOOT REFLECTOR LAMP RH	\$	<i>Sn</i> 493.35 X
26	1	BOOT BADGE 'RENAULT'	\$	<i>R</i> 225.36 ✓
27	1	BOOT BADGE	\$	<i>R</i> 225.36 ✓
28	1	BOOT STRUT LH	\$	<i>Sn</i> 276.08 X
29	1	BOOT STRUT RH	\$	<i>Sn</i> 276.08 X
30	1	BOOT HINGE LH	\$	<i>R</i> 367.84 X
31	1	BOOT HINGE RH	\$	<i>R</i> 367.84 X
32	2	LICENCE PLATE LAMP	\$	<i>Sn</i> 50.52 X
33	1	WINDSCREEN REAR	\$	<i>Sn</i> 1,463.28 X
34	1	WINDSCREEN GARNISH INNER LH	\$	<i>Sn</i> 263.74 X

TRANS-CAB AUTO SERVICES PTE LTD**AAD1712-004**

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHD151G - FCIL

77	1	FUEL TANK NECK	\$	Sn 684.77	X
78	1	FUEL CAP	\$	Sn 233.02	X
79	1	DOOR PANEL REAR LH	\$	K 2,844.66	X
80	1	DOOR SEAL REAR LH	\$	Sn 187.08	X

TOTAL	\$	58,045.14
10%	\$	5,804.51
	\$	52,240.63

Special Nett

1	1SET	BUMPER RR CLIP	\$	na 66.00	—
2	1SET	BUMPER BEAM BOLT	\$	na 22.22	—
3	1SET	PARKING AID	\$	Short 600.00	—
4	1	BUMPER BRACKET CLIP CTR REAR	\$	na 15.00	}
5	1	BUMEPR BRACKET SIDE CLIP LH REAR	\$	na 12.00	
6	1	BUMEPR RETAINER CLIP LH REAR	\$	na 10.40	
7	1	BUMEPR BRACKET SIDE CLIP RH REAR	\$	na 12.00	
8	1	BUMEPR RETAINER CLIP RH REAR	\$	na 10.40	
9	1	CAP HUB LH RR	\$	Sn 35.00	
10	1	RIM LH RR	\$	Sn 385.00	
11	1	TYRE LH RR	\$	Sn 330.00	
12	1	CAP HUB RH RR	\$	Sn 35.00	
13	1	RIM RH RR	\$	Sn 385.00	
14	1	TYRE RH RR	\$	Sn 330.00	
15	1	SPARE TYRE RIM (ROUE 7J 16H 2547)	\$	Sn 385.00	}
16	1	SPARE TYRE	\$	Sn 330.00	
17	1SET	BOOT FINISHER CLIP	\$	na 25.10	}
18	1	Rear boots sticker "trans-cab"	\$	na 30.00	
19	1	Rear boots sticker "6555-3333"	\$	na 30.00	
20	1	FENDER PANEL INNER TRIM CLIP REAR LH	\$	na 22.00	X
21	1SET	WHEELARCH CLIP LH RR	\$	na 32.34	X
22	1SET	WHEELARCH CLIP RH RR	\$	na 32.34	—
23	2	Rear windscreen sealant	\$	na 80.00	40sn
24	1	Windscreen moulding	\$	na 100.00	—
25	1	Rear Windscreen Inner Sponge Seal	\$	na 100.00	30sn
26	1	EXHAUST MOUNTING REAR	\$	Sn 65.50	X
27	1	EXHAUST BRACKET REAR	\$	na 22.22	X
28	1SET	Front licence plate with holder	\$	Sn 80.00	X
29	1SET	Rear licence plate with holder	\$	Sn 80.00	X
30	1	DOOR STICKER "6555-3333" LH	\$	na 80.00	X
31	1	DOOR STICKER "6555-3333" RH	\$	na 80.00	X

TRANS-CAB AUTO SERVICES PTE LTD**AAD1712-004**

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHD151G - FCIL

TOTAL	\$	3,822.52
TOTAL PARTS	\$	56,063.15

Panel beating, knocking and straightening the necessary portion, remove and renewal of parts, adjust and realign the same	\$	5,600.00	1400
Towing Fees.	\$	120.00	500
To apply paint protection system (PPS) maintain and enhancement	\$	380.00	X
Putty and spray painting of the affected portion.	\$	6,000.00	1100
To rust-proofing of the affected areas.	\$	170.00	900
To remove and refit interior fittings, trimings, garnish, fittings and other, to enable repair.	\$	380.00	100
To check steering geometry and computer wheel alignment	\$	220.00	X
To transfer of tire, rim and on wheel balancing.	\$	170.00	X
To Check Electrical Lighting Concerned.	\$	170.00	200
To pull and jack out chassis frame and correct it to symmetrical position with the aid of hydraulic pneumatic jack.	\$	380.00	} 2500
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	380.00	
To transfer of rear end panel fittings, attachment and perform water seepage test.	\$	170.00	X
To transfer of rear luggage floor panel fittings, attachment and perform water seepage test.	\$	170.00	X
To supply and re-do rear luggage floor panel insulation padding.	\$	380.00	X

TRANS-CAB AUTO SERVICES PTE LTD**AAD1712-004**

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHD151G - FCIL

35	1	WINDSCREEN GARNISH INNER RH	\$	Sm	263.74	X
36	1	TAILLAMP LH	\$	Bz	552.55	—
37	1	TAILLAMP PANEL LH	\$	Bz	986.70	—
38	1	TAILLAMP RH	\$	Sm	552.55	X
39	1	TAILLAMP PANEL RH	\$	R	986.70	X
40	1	CHASSIS PANEL REAR LH	\$	R	3,766.43	X
41	1	FENDER PANEL REAR LH	\$	BT	3,299.13	—
42	1	FENDER PANEL REAR RH	\$	R	3,299.13	X
43	1	WHEELARCH REAR LH	\$	CM	543.47	—
44	1	WHEELARCH REAR RH	\$	Sm	543.47	X
45	1	FENDER PANEL INNER TRIM REAR LH	\$	Return	671.45	—
46	1	FENDER WHEEL HOUSE PANEL REAR LH	\$	R	3,039.04	X
47	1	LOWER ARM REAR LH	\$	Sm	905.99	X
48	1	KUCKLE ARM REAR LH	\$	Sm	736.67	X
49	1	ABSORBER REAR LH	\$	Sm	389.75	X
50	1	ABSORBER BOLT REAR LH	\$	Sm	52.10	X
51	1	ABSORBER DUST COVER REAR LH	\$	Sm	92.16	X
52	1	AIR VENT RH	\$	Sm	97.28	X
53	1	REAR AXLE	\$	Sm	4,167.03	X
54	1	AXLE ARM ROD	\$	Sm	117.22	X
55	1	AXLE ARM LH	\$	Sm	117.22	X
56	1	AXLE ARM RH	\$	Sm	117.22	X
57	1	AXLE ARM SHIELD LH	\$	Sm	9.08	X
58	1	AXLE ARM SHIELD RH	\$	Sm	9.08	X
59	1	AXLE SPRING ARM LH	\$	Sm	376.92	X
60	1	AXLE SPRING ARM RH	\$	Sm	376.92	X
61	1	STABILIZER BAR REAR	\$	Sm	604.65	X
62	1	STABILIZER LINK REAR LH	\$	Sm	92.36	X
63	1	STABILIZER LINK REAR RH	\$	Sm	92.36	X
64	1	SPARE WHEEL PANEL (Luggage Floor Panel)	\$	R	2,189.88	X
65	1	SPARE WHEEL PANEL TRIM (Luggage Floor Panel)	\$	Sm	612.21	X
66	1	SPARE WHEEL PANEL BRACKET LH	\$	R	123.73	X
67	1	SPARE WHEEL PANEL BRACKET RH	\$	R	121.36	X
68	1	OUTER PANEL REAR (End Panel)	\$	R	1,471.77	—
69	1	OUTER PANEL REAR (End Panel)TRIM	\$	CM	401.02	—
70	1	EXHAUST REAR	\$	R	7,489.05	X
71	1	EXHAUST CAP REAR	\$	R	230.49	X
72	1	EXHAUST MOUNTING REAR	\$	Sm	31.97	X
73	1	EXHAUST BRACKET REAR	\$	R	39.86	X
74	1	EXHAUST HEAT SHIELD REAR	\$	Sm	99.06	X
75	1	SHIELD - HEAT - TUNNEL	\$	Sm	225.16	X
76	1	FUEL FLAP	\$	Sm	343.57	X

TRANS-CAB AUTO SERVICES PTE LTD**AAD1712-004**

NO.2 ANG MO KIO ST63 SINGAPORE 569111

TEL NO. 6287 6666 FAX NO. 6257 1330

CO/GST REG NO. 201019626G

SHD151G - FCIL

To transfer of bootlid fittings, attachments and perform water seepage test.	\$	170.00	601
To transfer of rear fender fittings, attachment and perform water seepage test.	\$	380.00	nn X
To transfer of tailgate fittings and conduct water seepage test.	\$	170.00	nn X
To transfer of rear windscreen fittings, attachments and perform water seepage test.	\$	380.00	1201
To reinstall rear bumper parking sensor.	\$	170.00	601
To drop rear exhaust box, renew the same, to repair and realign centre exhaust pipe.	\$	280.00	nn X
To repair and realign rear exhaust pipe.	\$	170.00	nn X
To dismantle and refit rear undercarriage parts, final checking and testing.	\$	380.00	nn X
To dismantle and refit rear axle housing assy, remove and renewal of parts, final checking and testing.	\$	380.00	nn X
To drop rear axle assy, remove and renewal of the necessary parts	\$	380.00	nn X
Labour charge to mount and dismount vehicle on jig bench, to facilitate repair.	\$	380.00	nn X
To Transfer Of Fender Fittings, Attachments And Perform Water Seepage Test.	\$	170.00	nn X

TOTAL \$ 17,170.00 18100**Over All Total \$ 73,233.15**

LKK Auto Consultants hence notify the Repairer of the following:

< parts by parts > Repair Days

- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer:

Signature:

Date:

20 DAYS

10 days

74163.13



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

FIRST CAPITAL INSURANCE LTD

Ref : CS/FCI17023138/Ktbn2

36 ROBINSON ROAD
#16-01 CITY HOUSESINGAPORE 068877

Date : 20-06-2018



Code : FCI2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SHC 2007H	Veh. Inspected	SHD 151G
Policy No.	D-15072701MFSH	Coverage (\$)	0.00
Claim No.	D17011153MFSH	Excess (\$)	0.00
Assign From	JOANNE YONG	Assign Date	06/12/2017

2. Vehicle Particulars & Condition

Make & Model	RENAULT LATITUDE (A)	c.c	1995
Engine No.	HIDDEN	Year of Reg.	2015
Chassis No.	VF1ABL15AUC282259	Colour	WHITE / RED
Odometer	275789	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/60 R16	LING LONG	3 mm
L/H Front Tyre	215/60 R16	LING LONG	3 mm
R/H Rear Tyre	215/60 R16	LING LONG	4 mm
L/H Rear Tyre	215/60 R16	LING LONG	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR N/S PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	01/12/2017	Inspection Date	06/12/2017
Survey held at	TRANS-CAB AUTO SERVICES PTE LTD NO.2 ANG MO KIO ST 63 SINGAPORE 569111		

5a. Remarks

A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	10 Working Days
-------------------------------------	-----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.: 1 of 6

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SHD 151G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BUMPER COVER REAR	TORN	1,108.46	1,108.46
1	BUMPER LOWER REAR	CRACKED	768.84	768.84
1	BUMPER BRACKET CTR REAR	SERVICEABLE	113.47	-
1	BUMPER BRACKET SIDE LH REAR	CRACKED	135.97	135.97
1	BUMPER BRACKET CTR LH REAR	CRACKED	44.99	44.99
1	BUMPER BRACKET SIDE RH REAR	SERVICEABLE	135.97	-
1	BUMPER BRACKET CTR RH REAR	SERVICEABLE	44.99	-
1	BUMPER BEAM REAR	BENT	777.52	777.52
1	BUMPER BEAM BRACKET LH REAR	BENT	225.95	225.95
1	BUMPER BEAM BRACKET RH REAR	TO REPAIR SEE LABOUR	225.95	-
1	BUMPER REFLECTOR LH	BROKEN	43.61	43.61
1	BUMPER REFLECTOR RH	SERVICEABLE	43.61	-
1	BOOT REAR	BENT	2,872.68	2,872.68
2	BOOT RUBBER PLUG	SERVICEABLE	221.81	-
1	BOOT FINISHER	SERVICEABLE	470.06	-
1	BOOT SWITCH	SERVICEABLE	168.13	-
1	BOOT TRIM BOARD	DEFORMED	914.87	914.87
1	BOOT LOCK	TO REPAIR SEE LABOUR	202.67	-
1	BOOT LOCK CATCH	TO REPAIR SEE LABOUR	74.40	-
1	BOOT LOCK LINKAGE	SERVICEABLE	34.53	-
1	BOOT LOCK LINKAGE HOLDER	SERVICEABLE	154.52	-
1	BOOT LOCK CATCH TRIM BOARD	SERVICEABLE	249.24	-
1	BOOT WEATHERSTRIP	DISTORTED / CUT	323.05	323.05
1	BOOT REFLECTOR LAMP LH	CRACKED	493.35	493.35
1	BOOT REFLECTOR LAMP RH	SERVICEABLE	493.35	-
1	BOOT BADGE "RENAULT"	NECESSARY	225.36	225.36
1	BOOT BADGE	NECESSARY	225.36	225.36
1	BOOT STRUT LH	SERVICEABLE	276.08	-
1	BOOT STRUT RH	SERVICEABLE	276.08	-

Report Ref No. CS/FCI17023138/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BOOT HINGE LH	TO REPAIR SEE LABOUR	367.84	-
1	BOOT HINGE RH	TO REPAIR SEE LABOUR	367.84	-
2	LICENCE PLATE LAMP	SERVICEABLE	50.52	-
1	WINDSCREEN REAR	SERVICEABLE	1,463.28	-
1	WINDSCREEN GARNISH INNER LH	SERVICEABLE	263.74	-
1	WINDSCREEN GARNISH INNER RH	SERVICEABLE	263.74	-
1	TAILLAMP LH	BROKEN	552.55	552.55
1	TAILLAMP PANEL LH	BENT	986.70	986.70
1	TAILLAMP RH	SERVICEABLE	552.55	-
1	TAILLAMP PANEL RH	TO REPAIR SEE LABOUR	986.70	-
1	CHASSIS PANEL REAR LH	TO REPAIR SEE LABOUR	3,766.43	-
1	FENDER PANEL REAR LH	BENT	3,299.13	3,299.13
1	FENDER PANEL REAR RH	TO REPAIR SEE LABOUR	3,299.13	-
1	WHEELARCH REAR LH	CRACKED	543.47	543.47
1	WHEELARCH REAR RH	SERVICEABLE	543.47	-
1	FENDER PANEL INNER TRIM REAR LH	DEFORMED	671.45	671.45
1	FENDER WHEEL HOUSE PANEL REAR LH	TO REPAIR SEE LABOUR	3,039.04	-
1	LOWER ARM REAR LH	SERVICEABLE	905.99	-
1	KNUCKLE ARM REAR LH	SERVICEABLE	736.67	-
1	ABSORBER REAR LH	SERVICEABLE	389.75	-
1	ABSORBER BOLT REAR LH	SERVICEABLE	52.10	-
1	ABSORBER DUST COVER REAR LH	SERVICEABLE	92.16	-
1	AIR VENT RH	SERVICEABLE	97.28	-
1	REAR AXLE	SERVICEABLE	4,167.03	-
1	AXLE ARM ROD	SERVICEABLE	117.22	-
1	AXLE ARM LH	SERVICEABLE	117.22	-
1	AXLE ARM RH	SERVICEABLE	117.22	-
1	AXLE ARM SHIELD LH	SERVICEABLE	9.08	-
1	AXLE ARM SHIELD RH	SERVICEABLE	9.08	-

Report Ref No. CS/FC117023138/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	AXLE SPRING ARM LH	SERVICEABLE	376.92	-
1	AXLE SPRING ARM RH	SERVICEABLE	376.92	-
1	STABILIZER BAR REAR	SERVICEABLE	604.65	-
1	STABILIZER LINK REAR LH	SERVICEABLE	92.36	-
1	STABILIZER LINK REAR RH	SERVICEABLE	92.36	-
1	SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL)	TO REPAIR SEE LABOUR	2,189.88	-
1	SPARE WHEEL PANEL TRIM (LUGGAGE FLOOR PANEL)	SERVICEABLE	612.21	-
1	SPARE WHEEL PANEL BRACKET LH	TO REPAIR SEE LABOUR	123.73	-
1	SPARE WHEEL PANEL BRACKET RH	TO REPAIR SEE LABOUR	121.36	-
1	OUTER PANEL REAR (END PANEL)	BENT	1,471.77	1,471.77
1	OUTER PANEL REAR (END PANEL) TRIM	CRACKED	401.02	401.02
1	EXHAUST REAR	TO REPAIR SEE LABOUR	7,489.05	-
1	EXHAUST CAP REAR	TO REPAIR SEE LABOUR	230.49	-
1	EXHAUST MOUNTING REAR	SERVICEABLE	31.97	-
1	EXHAUST BRACKET REAR	TO REPAIR SEE LABOUR	39.86	-
1	EXHAUST HEAT SHIELD REAR	SERVICEABLE	99.06	-
1	SHIELD-HEAT-TUNNEL	SERVICEABLE	225.16	-
1	FUEL FLAP	SERVICEABLE	343.57	-
1	FUEL TANK NECK	SERVICEABLE	684.77	-
1	FUEL CAP	SERVICEABLE	233.02	-
1	DOOR PANEL REAR LH	TO REPAIR SEE LABOUR	2,844.66	-
1	DOOR SEAL REAR LH	SERVICEABLE	187.08	-
	LESS 10% DISCOUNT		-5,804.51	-1,608.61
			52,240.61	14,477.49
	SPECIAL NETT ITEMS			
1	SET BUMPER RR CLIP (SN)	NECESSARY	66.00	66.00
1	SET BUMPER BEAM BOLT (SN)	NECESSARY	22.22	22.22
1	SET PARKING AID (SN)	SHORTED	600.00	600.00

Report Ref No. CS/FCI17023138/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	BUMPER BRACKET CLIP CTR REAR (SN)	NOT NECESSARY	15.00	-
1	BUMPER BRACKET SIDE CLIP LH REAR (SN)	NOT NECESSARY	12.00	-
1	BUMPER RETAINER CLIP LH REAR (SN)	NOT NECESSARY	10.40	-
1	BUMPER BRACKET SIDE CLIP RH REAR (SN)	NOT NECESSARY	12.00	-
1	BUMPER RETAINER CLIP RH REAR (SN)	NOT NECESSARY	10.40	-
1	CAP HUB LH RR (SN)	SERVICEABLE	35.00	-
1	RIM LH RR (SN)	SERVICEABLE	385.00	-
1	TYRE LH RR (SN)	SERVICEABLE	330.00	-
1	CAP HUB RH RR (SN)	SERVICEABLE	35.00	-
1	RIM RH RR (SN)	SERVICEABLE	385.00	-
1	TYRE RH RR (SN)	SERVICEABLE	330.00	-
1	SPARE TYRE RIM (ROUE 7J 16H 2547)(SN)	SERVICEABLE	385.00	-
1	SPARE TYRE (SN)	SERVICEABLE	330.00	-
1	SET BOOT FINISHER CLIP (SN)	NOT NECESSARY	25.10	-
1	REAR BOOTS STICKER "TRANS-CAB" (SN)	NECESSARY	30.00	30.00
1	REAR BOOTS STICKER "6555-3333" (SN)	NECESSARY	30.00	30.00
1	FENDER PANEL INNER TRIM CLIP REAR LH (SN)	NOT NECESSARY	22.00	-
1	SET WHEELARCH CLIP LH RR (SN)	NOT NECESSARY	32.34	-
1	SET WHEELARCH CLIP RH RR (SN)	NECESSARY	32.34	32.34
2	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	WINDSCREEN MOULDING (SN)	NECESSARY	100.00	100.00
1	REAR WINDSCREEN INNER SPONGE SEAL (SN)	NECESSARY	100.00	30.00
1	EXHAUST MOUNTING REAR (SN)	SERVICEABLE	65.50	-
1	EXHAUST BRACKET REAR (SN)	TO REPAIR SEE LABOUR	22.22	-
1	SET FRONT LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	80.00	-
1	SET REAR LICENCE PLATE WITH HOLDER (SN)	SERVICEABLE	80.00	-
1	DOOR STICKER "6555-3333" LH (SN)	NOT NECESSARY	80.00	-
1	DOOR STICKER "6555-3333" RH (SN)	NOT NECESSARY	80.00	-
			3,822.52	950.56
	LABOUR			
	TO TRANSFER OF FENDER FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-

Report Ref No. CS/FCI17023138/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:5 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	PANEL BEATING,KNOCKING AND STRAIGHTENING THE NECESSARY PORTION,REMOVE AND RENEWAL OF PARTS,ADJUST AND REALIGN THE SAME. }		5,600.00	1,400.00
	INCLUSIVE OF THE REPAIR OF BUMPER BEAM BRACKET RH REAR,BOOT LOCK,BOOT LOCK CATCH,BOOT HINGE LH,BOOT HINGE RH,TAILLAMP PANEL RH,CHASSIS PANEL REAR LH,FENDER PANEL REAR RH,FENDER WHEEL HOUSE PANEL REAR LH,SPARE WHEEL PANEL (LUGGAGE FLOOR PANEL),SPARE WHEEL PANEL BRACKET LH,SPARE WHEEL PANEL BRACKET RH,EXHAUST REAR,EXHAUST CAP REAR,EXHAUST BRACKET REAR,DOOR PANEL REAR LH AND EXHAUST BRACKET REAR. }		-	-
	TOWING FEES.		120.00	50.00
	TO APPLY PAINT PROTECTION SYSTEM (PPS) MAINTAIN AND ENHANCEMENT.	NOT NECESSARY	380.00	-
	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION.		6,000.00	1,100.00
	TO RUST-PROOFING OF THE AFFECTED AREAS.		170.00	90.00
	TO REMOVE AND REFIT INTERIOR FITTINGS,TRIMINGS,GARNISH, FITTINGS AND OTHER,TO ENABLE REPAIR.		380.00	100.00
	TO CHECK STEERING GEOMETRY AND COMPUTER WHEEL ALIGNMENT.	NOT NECESSARY	220.00	-
	TO TRANSFER OF TIRE,RIM AND ON WHEEL BALANCING.	NOT NECESSARY	170.00	-
	TO CHECK ELECTRICAL LIGHTING CONCERNED.		170.00	20.00
	TO PULL AND JACK OUT CHASSIS FRAME AND CORRECT IT TO SYMMETRICAL POSITION WITH THE AID OF HYDRAULIC PNEUMATIC JACK. }		380.00	250.00
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH,TO FACILITATE REPAIR. }		380.00	-
	TO TRANSFER OF REAR END PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR LUGGAGE FLOOR PANEL FITTINGS,ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO SUPPLY AND RE-DO REAR LUGGAGE FLOOR PANEL INSULATION PADDING.	NOT NECESSARY	380.00	-
	TO TRANSFER OF BOOTLID FITTINGS,ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		170.00	60.00

Report Ref No. CS/FCI17023138/Ktbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:6 of 6

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO TRANSFER OF REAR FENDER FITTINGS, ATTACHMENT AND PERFORM WATER SEEPAGE TEST.	NOT NECESSARY	380.00	-
	TO TRANSFER OF TAILGATE FITTINGS AND CONDUCT WATER SEEPAGE TEST.	NOT NECESSARY	170.00	-
	TO TRANSFER OF REAR WINDSCREEN FITTINGS, ATTACHMENTS AND PERFORM WATER SEEPAGE TEST.		380.00	120.00
	TO REINSTALL REAR BUMPER PARKING SENSOR.		170.00	60.00
	TO DROP REAR EXHAUST BOX, RENEW THE SAME, TO REPAIR AND REALIGN CENTRE EXHAUST PIPE.	NOT NECESSARY	280.00	-
	TO REPAIR AND REALIGN REAR EXHAUST PIPE.	NOT NECESSARY	170.00	-
	TO DISMANTLE AND REFIT REAR UNDERCARRIAGE PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO DISMANTLE AND REFIT REAR AXLE HOUSING ASSY, REMOVE AND RENEWAL OF PARTS, FINAL CHECKING AND TESTING.	NOT NECESSARY	380.00	-
	TO DROP REAR AXLE ASSY, REMOVE AND RENEWAL OF THE NECESSARY PARTS.	NOT NECESSARY	380.00	-
	LABOUR CHARGE TO MOUNT AND DISMOUNT VEHICLE ON JIG BENCH, TO FACILITATE REPAIR.	NOT NECESSARY	380.00	-
			18,100.00	3,250.00
GRAND TOTAL			74,163.13	18,678.05

RECOMMENDED COST OF REPAIRS			18,678.05
------------------------------------	--	--	------------------

Report Ref No. CS/FCI17023138/Ktbn2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.