

22/03/2002

ASS. REC. BY:

REF: CS/FCI7033341/Kvb02

Special Instruction:

GIA

Surveyor: Kenneth

ASSIGNMENT (Office)

From (Person): CWS Sithura

of

FCI

Date/Time:

07.12.2017 6:24pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKR 5156

Insured:

SHC 7493D

at Workshop m/s

Carewell Auto

Tel:

98189926

of

160 Sim ring

Dmc #03-21

Policy No:

Claim No:

D17011174MBSH

Sum Insured:

Excess:

Make of Veh:

D.O.A.

02.12.2017

(Client's Record)

CA / REV / REP. / REV 24 HRS '09'

H.O.D. Endorsement:

Date/Time:

08.12.2017 9.19am

Person Contacted:

Kim Hua

Vehicle

IN OUT

Date/Time

Action/Instruction (✓) Estimate

SKR 5156 - X

SHC 7493D - NA / III 13007995/21

DUP 280413

11/12/17

Send preli revised by email

12/14

87574.57 email

ASS. REC. BY:

REF:

1502


ASSIGNMENT

Kenneth

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s As Core well
 of 03-21
 Insured: Kim Hu
 Policy No. _____
 Claims No. _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

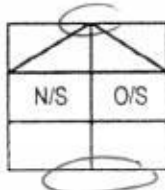

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: 7-8 days Res.: Yes or No
 Lum Sum: 113.1 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: 98189926 Vehicle: IN / OUT

Veh No: SKR 515G Yr Regn: 05, 11
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or N Nylon
 Make: M B160 c.c. 1498
 Colour: Black A/C: Insured / Std / NI / NA
 Sp. Reading: 92326 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: W002452312J708405
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: Inorder / Jammed / Leaked / Burnt or
 Brake: Inorder / Jammed / Leaked / Burnt or
 Modl: NII / S/Rim / STD A/Rim or
 Tyre Size: F: 215/45R17
 R: _____
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or
 Front 7 mm Rear 7 mm
 R/Bal. 7 mm L/Bal. 7 mm
 D.O.A. 2/12/17 D.O.I. 8/12/17
 Survey held at _____
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
8.15
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
11/12	File pass to Cathman.
19/4	87867.50 Confirmed by email (Ref 5311.00, 409) (NO LS)
	<u>2, 9/10/18</u>
RECEIVED 20 APR 2018	

Date/Time, File Pass to? ☐ : Preli. Report
☐ : Final Report

1) _____

2) 19/4-typt

Report Format : CWS
 Lump Sum / I.B.I. (\$) 7867.50

Days Of Repair: 7
 Resurvey No. of Trip: 2

Add Fee: ☐ : Site Insp (\$)
☐ : Interview (\$)
☐ : Tech Invs (\$)
☐ : Weekend (\$)

Survey Fee:	3x15 = 45
Transportation:	170 + 45
	50
	50 + 50
	43
	408
TOTAL	

Survey Department Check List (Case Handler)

Reference No.: CS/FC 17023341 Kvb
 Policy Type: OD / TP / TP RES / TL / EVA

Case Handler

Typist

Admin (): Case handler to make sure all Information created by the assignment team are ACCURATE.

(1) Office Assign Form

		Y-Date	N-Date	Y-Date	N-Date
C	Reference No.	✓			
C	Customer Code				
N	Assign From				
C	Assign Date	✓			
C	Veh No (Inspected)	✓			
C	Veh No (Insured)	✓			
C	D.O.A	✓			
C	Policy No				
C	Claim No	✓			
C	Insurance Authorisation (CA /REV/REP)				
C	Report Type	✓			
C	Weekend Charges				
N	Survey held at/Repairer	✓			
C	Excess				

Surveyor (): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

C	Vehicle No	✓			
C	Regn Month/Year	✓			
N	Vehicle Type	✓			
N	Make & Model	✓			
C	Engine Capacity. (C.C)	✓			
N	Colour	✓			
C	Odometer. (Sp.Reading)	✓			
C	Chassis No	✓			
N	General Condition	✓			
N	Steering	✓			
N	Brake	✓			
N	Modification (Modi)	✓			
C	Tyre Size	✓			
N	Tyre Make	✓			
C	Tyre Balance	✓			
C	Date of Inspection	✓			
N	Survey held	✓			
N	Des.of Damages	✓			

(2) System - (Views/Merimen)

C	Damaged Vehicle Photographs Uploaded	✓			
---	--------------------------------------	---	--	--	--

(3) Workshop Estimate/Assignment Form

N	ALL Parts condition	✓			
C	Market Value for OD cases				
C	Estimate Repair Cost for PRI (RSI, TMI, MSIG)				
C	Days of repair	✓			
C	Finalised Amount	✓			
C	Re-inspection Cases to Finalize within 5 Days				

(4) System - (Views/Merimen)

C	Resurvey photo Uploaded	✓			
---	-------------------------	---	--	--	--

Check By: VERON 19/4/18
 Case Handler Date

*C: Critical *N: Non-Critical

21/05/2014



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI17023341/Kvb	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 08-12-2017	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 7493D		Veh. Inspected	SKR 515G
Policy No.			Coverage (\$)	0.00
Claim No.	D17011174MFSH		Excess (\$)	0.00
Assign From	CWS (SITHARA)		Assign Date	07/12/2017
2. Vehicle Particulars & Condition				
Make & Model			c.c	0
Engine No.	HIDDEN		Year of Reg.	
Chassis No.			Colour	
Odometer			Steering	
Brakes			Modification	
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	02/12/2017		Inspection Date	08/12/2017
Survey held at	160 SIN MING DRIVE #03-21			
Repairer	CAREWELL AUTO SERVICE			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your ref: D17011174MFSH
Our ref: CS/FCI17023341/Kvb

Date : 11/12/2017

The Motor Claims Department
M/s First Capital Insurance Ltd

Dear Sir/Madam,

INITIAL INSPECTION REPORT OF VEHICLE NO. SKR 515G


We thank for your instruction on 7/12/2017

Please be informed that we had conducted the inspection of the above mentioned vehicle on 8/12/2017 at the premises of M/s CAREWELL AUTO SERVICE and have the following to report:-

Workshop Estimate Amount	: S\$13,178.70
Revised Estimate Amount	: S\$7,421.68
"Check" Items Amount	: S\$3,657.09
Market Value	: S\$
LTA Reimbursement Value	: S\$
Nett Value	: S\$

Description of Damage:

The vehicle sustained damages at the rear and front portion

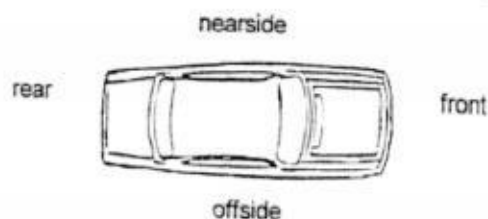

Comments/Present Status:
Damages Consistent

Yours faithfully,

Kenneth Kong
Licensed Appraiser

First Capital Insurance Limited

A FAIRFAX Company

Company Reg. No. 195000106C

GST Reg. No. M2-0001676-9

MOTOR SURVEY ASSIGNMENT

Date	04-12-2017	Our Ref No.	D17011174MFSH
Accident Date	02-12-2017	Claim Type.	Third Party
Insured Vehicle	SHC7493D	Third Party Vehicle.	SKR515G
Survey Location	160 SIN MING DRIVE #03-21 SIN MING AUTOCITY		
Contact Person.	KIM HUA		
Contact No.	64599926/ 98189926	Fax No.	64599928
Survey Type	WITHOUT PREJUDICE: WE ADMIT LIABILITY QUANTUM TO BE AGREED:		
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD		
Contact Person	NA	Fax No.	68416315
Contact Number.	NA		

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	CAREWELL AUTO SERVICE	Attention.	NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No.	NA
Officer Incharge	SITHARA		

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Job Sheet (/ClaimWS/Surveyor/JobSheet/231412)



PRI Documents



Close



PRI Header Details

Claim No	D17011174MFSH	Policy No	D-15072702MFSH	Claimant S.No & Name	1 & CA
Workshop Name	CAREWELL AUTO SERVICE (Contact Person : KIM HUA)	Survey Location & Contact Details	160 SIN MING DRIVE #03-21 SIN MING AUTO Mobile: 98189926 , Phone: 64599926 , Fax: EmailId: CAREWELL@SINGNET.COM.SG		
Our Surveyor	LKK AUTO CONSULTANTS PTE LTD	Instructions To Surveyor	WITHOUT PREJUDICE: WE ADMIT LIABILITY Q		
Insured Name	CITYCAB PTE LTD	Insured Vehicle No	SHC7493D	TP Vehicle No	SKR51!
PRI Recieved Date	06-12-2017 02:04:48 PM	Surveyor Appointed Date	07-12-2017 06:24:09 PM	Surveyor Accept Date	08-12-

Survey Report Upload

Surveyor Inspection Date *:		Surveyor Report Date	08-12-2017	Upload Survey Report *:	
-----------------------------	--	----------------------	------------	-------------------------	--

Vehicle Particulars

Make	Please Select Make ▼	Model	Please Select Model ▼	Year	Select
Chasis No		Engine No		Mileage	
Color		Cubic Capacity			

Multiple Documents Upload

Upload Multiple Documents

File Name

Action

Surveyor Job Remarks

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Monday, 11 December, 2017 1:48 PM
To: 'Claim Workflow System'
Cc: SITHARA@FIRST-INSURANCE.COM.SG; SUR
Subject: RE: SURVEY ASSESSMENT - D17011174MFSH/1, SKR 515G
Attachments: SKR 515G PRELI ADVISED.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle SKR 515G
Date of survey: 8/12/2017
Number of days: 7-8 days

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Friday, 8 December, 2017 9:21 AM
To: 'Claim Workflow System' <cwsmotorclaims@first-insurance.com.sg>; assignments <assignments@lkkauto.com>
Cc: SITHARA@FIRST-INSURANCE.COM.SG; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D17011174MFSH/1

Dear Sir / Madam,

Thank you for the assignment.

Best Regards,

Catherine Chong | Admin

LKK Auto Consultants Pte Ltd

Phone: 6741-8434 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claim Workflow System [<mailto:cwsmotorclaims@first-insurance.com.sg>]
Sent: Thursday, 7 December, 2017 6:24 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWSMOTORCLAIMS@FIRST-INSURANCE.COM.SG; SITHARA@FIRST-INSURANCE.COM.SG
Subject: PRI: SURVEY ASSESSMENT - D17011174MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Best Regards,

Admin Team

Claim Workflow System

Motor Claims Department

First Capital Insurance Limited

Tel : 6507 3848

Fax : 6507 3849

PS: This is a system generated mail. Please do not reply to this mail.



24 Hours Towing Services

Efficient Towing Services

403 Sin Ming Avenue #13-307, Sin Ming Garden, Singapore 570403

Ah Di Mobile: 8588 8877

Email: efficienttowing.sg@gmail.com

Business Reg. No. 53349344K

CASH SALE JOB ORDER

Messrs:

K Kim Hin Auto
Pte Ltd

NO: 9412

Date: 02/12/17

Vehicle No.

SKR5156

车型 Model

Mazda B180

地点 Destination

Bukit Timah Road to Actcity

#02-18

司机 Driver

BAW

收费 Amount S\$

60/-

Signature

E. & O. I.



CAREWELL AUTO SERVICE

Blk 176 Sin Ming Drive #02-06 Sin Ming AutoCare Singapore 575721
Tel: 459 9926 (3 Lines) Fax: 459 9928
Reg. No. 307289 / 00A

Our Ref:

Dec 6th, 2017

Date:

Your Ref:

Not Authorised

1. B. 1

Putri B4 gain

7-day

Kenneth 8/12/17
HP: 96910663

8 7867.50

Miss Raena Aihara Cheong

28A Berrima Road

Singapore 299908

Vehicle No. SKR515G

Model No. M/BENZ B160

Estimates for supply of spare parts, repair and miscellaneous charges :-

- | | |
|---|-----------------------------|
| 1. 1 pc Rear Bumper | Br S\$ 1061-59 ✓ |
| 2. 1 pc Cross Member | Br 455-99 ✓ |
| 3. 1 pc Spare Wheel Well | R 841-55 X |
| 4. 1 pc Cover under Spare Well | R 257-92 X |
| 5. 1 pc Carpeting – Spare Wheel Cavity | Sm 167-99 X |
| 6. 1 pc Covering Lining/Trunk Sill | Sm 75-62 X |
| 7. 1 pc Plastic Trim, Lower section Rear Bumper | CM 171-14 ✓ |
| 8. 2 pcs Trim strip covers, Rear Bumper | Br 274-54 ✓ |
| 9. 2pcs LHS/RHS Holders, Rear Bumper | CM 43-24 ✓ |
| 10. 1 pc Trim Strip | Sm Rd 187-72 ✓ X |
| 11. 1 pc Guard Plate, Rear Bumper | CM 166-00 ✓ |
| 12. 2pcs Reflectors | Br 80.28 ✓ |

cont. 2/....

13. 1pc Rear Lid
14. 1 pc Rear Lid Weatherstrip
15. 1 pc Top Lock
16. 1 pc Lower Lock
17. 1 pc Mercedes Star
18. 1 pc Emblem B160
19. 1 set Windscreen Repair Kit
20. 2 pcs Thrust Rods, Rear Axle
21. 1 pc Coupling Bearing
22. 4pcs Engine Mountings
23. 1 pc Catalytic Converter
24. 3pcs Exhaust Mountings
25. 1 pc Exhaust Pipe
26. 1 pc Chrome Pipe
27. 1 pc Manifold Gasket
28. 1 pc Exhaust Cone
29. 2pcs Spring Clamps
30. 1set Front Number Plate
31. 1pc Number Plate Holder
32. Towing Service

R B 1734-66 X

Sm 174-17 X

Pl 173-93 ✓

R 29-43 X

M 45-54 ✓

M 73-48 ✓

M 154-73 ✓

B 249-58 ✓

T B 245-20 X

Sm 437-07 X

B 1,846-57 ✓

Pl 47-20 ✓

B 887-92 ✓

Pl 379-31 ✓

M 21-91 ✓

Sm 21-46 X

M 57-96 ✓

Pl 30-00 s/nett } 45 Sm
25-00 s/nett }

60-00 ✓

Sub Total ;

S\$ 10,478-07

Labour Charges

To knock, remove and install the related damaged parts

according to conditions

1,600-00 1100

To remove and install rear windscreen

300-00 120

To spray paint on the affected areas.

800-00 750

LKK Auto Consultants hence notify the TOTAL of the following:

S\$13,178-70

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI17023341/Kvbn2	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 27-04-2018	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHC 7493D	Veh. Inspected	SKR 515G
	Policy No.	D-15072702MFSH	Coverage (\$)	0.00
	Claim No.	D17011174MFSH	Excess (\$)	0.00
	Assign From	SITHARA	Assign Date	07/12/2017
2. Vehicle Particulars & Condition				
	Make & Model	MERCEDES B160 (A)	c.c	1498
	Engine No.	HIDDEN	Year of Reg.	2011
	Chassis No.	WDD2452312J706405	Colour	METALLIC BLACK
	Odometer	92326	Steering	IN ORDER
	Brakes	IN ORDER	Modification	STANDARD ALLOY RIM
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/45 R17	YOKOHAMA	7 mm
	L/H Front Tyre	215/45 R17	YOKOHAMA	7 mm
	R/H Rear Tyre	215/45 R17	YOKOHAMA	7 mm
	L/H Rear Tyre	215/45 R17	YOKOHAMA	7 mm
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR AND FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
	Accident Date	02/12/2017	Inspection Date	08/12/2017
	Survey held at	160 SIN MING DRIVE #03-21		
	Repairer	CAREWELL AUTO SERVICE		
5a. Remarks				
A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			7 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKR 515G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BUMPER	BUCKLED	1,061.59	1,061.59
1	CROSS MEMBER	BUCKLED	455.99	455.99
1	SPARE WHEEL WELL	TO REPAIR SEE LABOUR	841.55	-
1	COVER UNDER SPARE WELL	TO REPAIR SEE LABOUR	257.92	-
1	CARPETING-SPARE WHEEL CAVITY	SERVICEABLE	167.99	-
1	COVERING LINING-TRUNK SILL	SERVICEABLE	75.62	-
1	PLASTIC TRIM,LOWER SECTION REAR BUMPER	CRACKED	171.14	171.14
2	TRIM STRIP COVERS,REAR BUMPER	NECESSARY	274.54	274.54
2	LHS/RHS HOLDERS,REAR BUMPER	CRACKED	43.24	43.24
1	TRIM STRIP	SERVICEABLE	187.72	-
1	GUARD PLATE,REAR BUMPER	CRACKED	166.00	166.00
1	REAR LID	TO REPAIR SEE LABOUR	1,734.66	-
1	REAR LID WEATHERSTRIP	SERVICEABLE	174.17	-
1	TOP LOCK	DENTED	173.93	173.93
1	LOWER LOCK	TO REPAIR SEE LABOUR	29.43	-
1	MERCEDES STAR	NECESSARY	45.54	45.54
1	EMBLEM B160	NECESSARY	73.48	73.48
1	SET WINDSCREEN REPAIR KIT	NECESSARY	154.73	154.73
2	THRUST RODS,REAR AXLE	BENT	249.58	249.58
1	COUPLING BEARING	JAMMED	245.20	245.20
4	ENGINE MOUNTINGS	SERVICEABLE	437.07	-
1	CATALYTIC CONVERTER	BENT	1,846.57	1,846.57
3	EXHAUST MOUNTINGS	DISTORTED	47.20	47.20
1	EXHAUST PIPE	BENT	887.92	887.92
1	CHROME PIPE	DENTED	379.31	379.31
1	MANIFOLD GASKET	NECESSARY	21.91	21.91
1	EXHAUST CONE	SERVICEABLE	21.46	-
2	SORING CLAMPS	NECESSARY	57.96	57.96

Report Ref No. CS/FCI17023341/Kvbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	REFLECTORS	NECESSARY	80.28	80.28
	LESS 10% DISCOUNT		-	-643.61
			10,363.70	5,792.50
	SPECIAL NETT ITEMS			
1	SET FRONT NUMBER PLATE (SN) }	DENTED	30.00	45.00
1	NUMBER PLATE HOLDER (SN) }	DENTED	25.00	-
			55.00	45.00
	LABOUR			
	TOWING SERVICE.		60.00	60.00
	TO KNOCK,REMOVE AND INSTALL THE RELATED DAMAGED PARTS ACCORDING TO CONDITIONS.INCLUSIVE OF THE REPAIR OF SPARE WHEEL WELL, COVER UNDER SPARE WELL,REAR LID AND LOWER LOCK.		1,600.00	1,100.00
	TO REMOVE AND INSTALL REAR WINDSCREEN.		300.00	120.00
	TO SPRAY PAINT ON THE AFFECTED AREAS.		800.00	750.00
			2,760.00	2,030.00
GRAND TOTAL			13,178.70	7,867.50
RECOMMENDED COST OF REPAIRS				7,867.50

Report Ref No. CS/FCI17023341/Kvbn2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.